


Fault Code: 234-ECM2

Engine Speed High - Data Valid but Above Normal Operational Range - Most Severe Level

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 234 PID(P): SPN: 190 FMI: 0 Lamp: Red SRT:	Engine Speed High - Data Valid but Above Normal Operational Range - Most Severe Level	The fuel shutoff valve is de-energized (closed). The fuel shutoff valve is re-energized (opened) when engine speed falls below the calibrated value (2130 rpm).

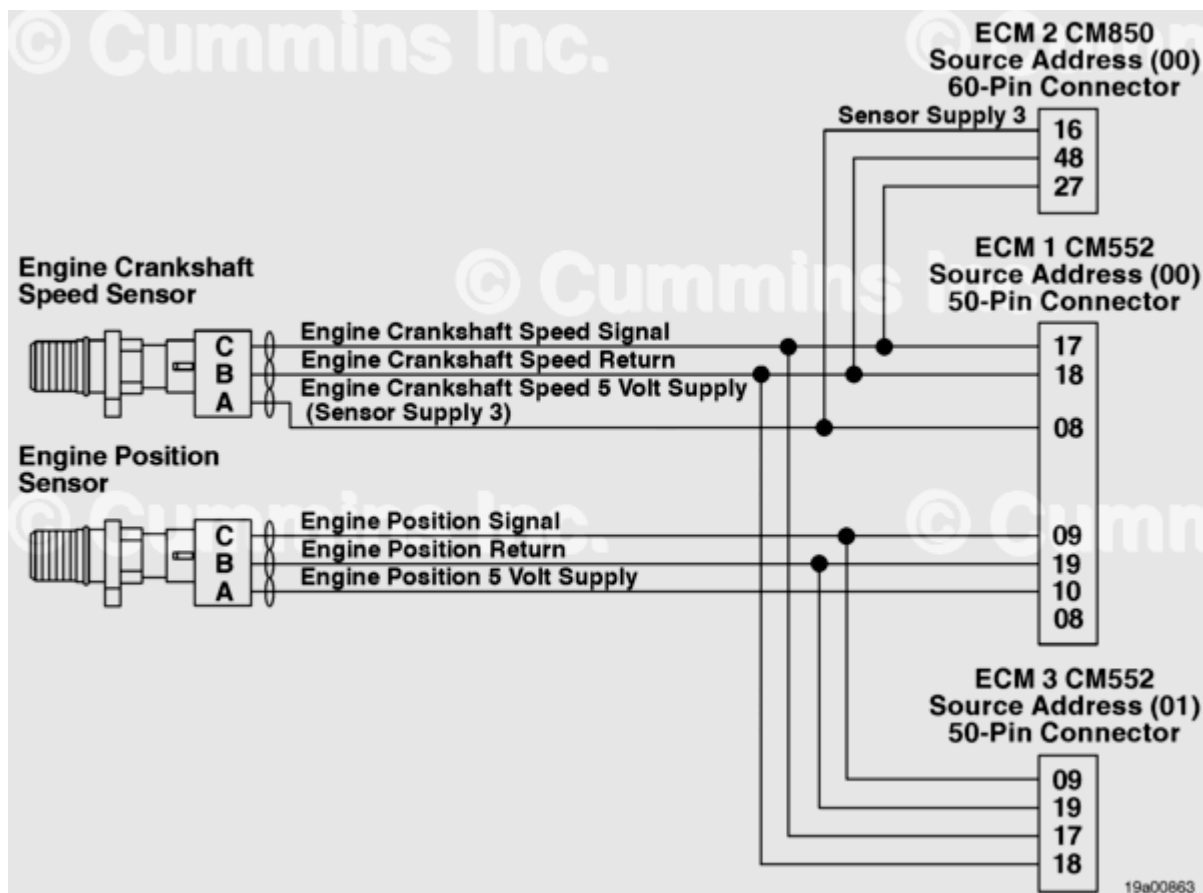

Engine Speed High Circuit - QST30 Power Generation Interface Engine

Circuit Description

The engine speed sensor monitors the engine position and the engine speed and passes this information to the electronic control module (ECM) through the engine harness.

Component Location

The engine speed sensor and the engine position sensor are located in the flywheel housing.

Shoptalk

- Inspect the intake manifold for sources of flammable vapors. Check the turbocharger seals to verify that there are no oil leaks.
- Inspect the engine speed sensor for signs of damage or tampering.

Refer to Troubleshooting Fault Code t05-234 (</qs3/pubsys2/xml/en/procedures/60/60-t05-234-ecm2.html>)