


Fault Code: 2727

SAE J1939 Data Link 2 Engine Network - Abnormal Update Rate

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 2727 PID(P): S206 SPN: 1231 FMI: 9/9 Lamp: Maintenance SRT:	Communication between the engine control module (ECM) and another device on the J1939 datalink has been lost.	Possible reduced engine performance.

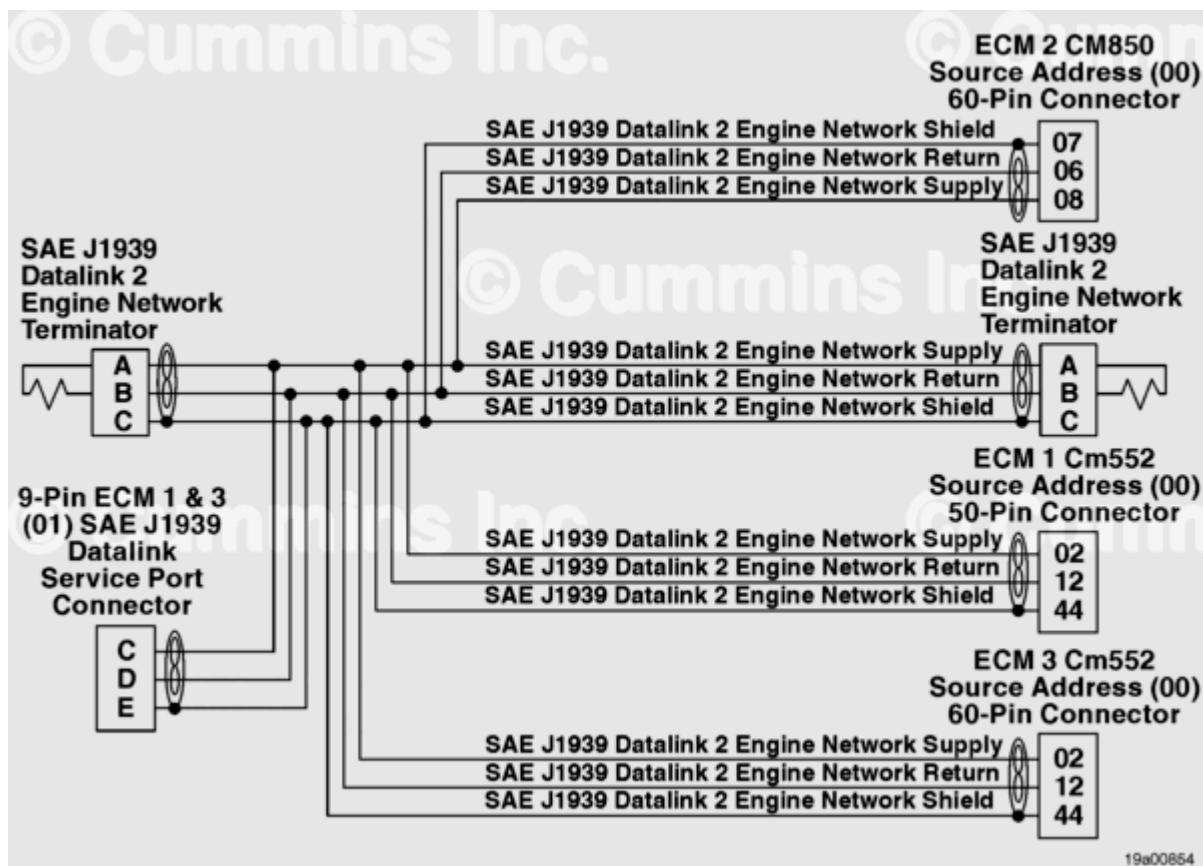

J1939 Data Link 2 Engine Network Circuit

Circuit Description

The ECM identified another device on the J1939 datalink network has stopped communicating on the network. The devices on the J1939 datalink network include: ECMs', and the Generator Interface Module. The harness for the J1939 datalink network has a shielded twisted pair of wires that connect each of the network devices and termination resistor.

Component Location

The Engine Control Modules (ECM) are located on a plate that is above the flywheel housing.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the generator set controller is active.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) did **not** receive a message from a multiplexed device.

Action Taken When The Fault Code Is Active

- The generator set controller displays a warning fault immediately when the diagnostics runs and fails.
- The multiplexed device will **not** operate.

Conditions For Clearing The Fault Code

- To validate the repair, start the engine and let it run for 1 minute at no load.
- The generator set controller will turn off the fault code immediately after the user presses reset.
- The "Reset All Faults" command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

Shoptalk

There are multiple ECMs for the engine models included in this manual. Each ECM has an individual source address that displays when Cummins® electronic service tool or equivalent is connected. When troubleshooting a fault code, use the source address displayed in Cummins® electronic service tool or equivalent to determine which ECM and circuit is affected.

Each smart device on the J1939 datalink network need power and ground to turn on, after the smart device turns on, it can then communicate on the J1939 datalink network.

Possible causes of this fault code include:

- Malfunctioning or damaged J1939 datalink wiring harness.

Refer to Troubleshooting Fault Code 2727 . (</qs3/pubsys2/xml/en/procedures/60/60-t05-2727.html>)

Last Modified: 28-Sep-2020
