


Fault Code: 144

Coolant Temperature Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 144 PID(P): P110 SPN: 110 FMI: 3/3 Lamp: Yellow SRT:	High voltage detected at the coolant temperature circuit.	Possible white smoke. Fan will stay on if controlled by the electronic control module (ECM). No engine protection for coolant temperature.

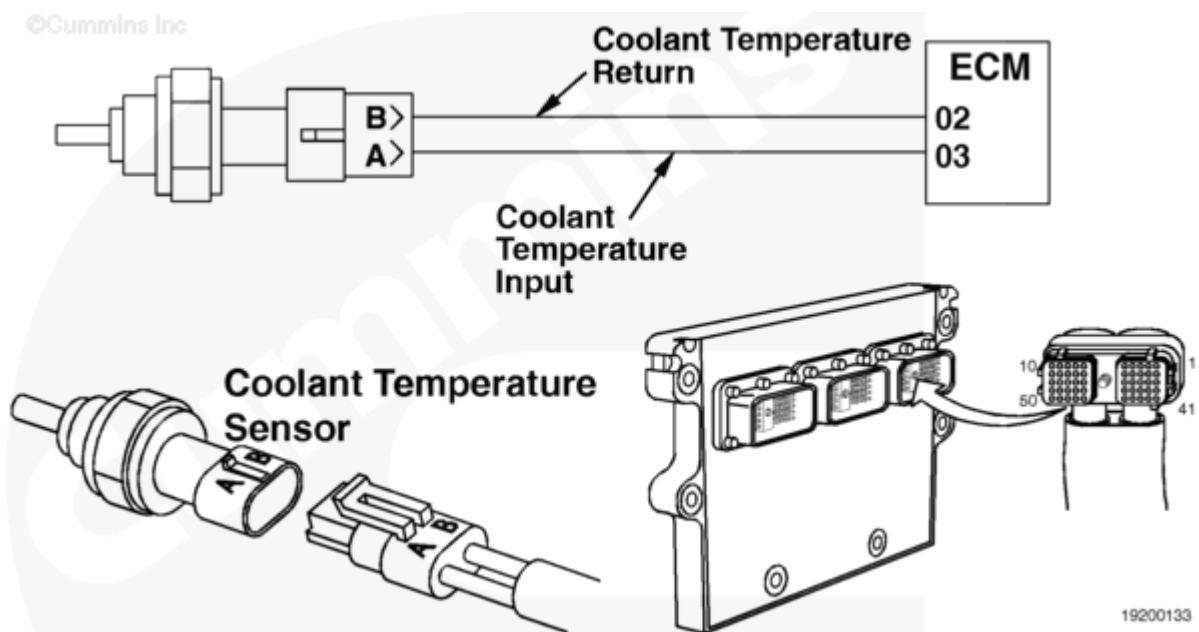

Coolant Temperature Sensor Circuit

Circuit Description

The coolant temperature sensor is used by the ECM to monitor the temperature of the engine coolant. The coolant temperature is used by the ECM for the engine protection system, timing, and fueling control.

Component Location

The coolant temperature sensor is located in front of the turbocharger.

Shoptalk

The resistance of the sensor varies with the temperature. Compare your reading to this table:

Temperature (°C)	Temperature [°F]	Resistance (ohms)
0	32	30k to 36k
25	77	9k to 11k
50	122	3k to 4k
75	167	1350 to 1500
100	212	600 to 675

Refer to Troubleshooting Fault Code t05-144 (/qs3/pubsys2/xml/en/procedures/82/82-t05-144.html)

Last Modified: 02-Sep-2010
