


Fault Code: 359

ICON™ Engine Auto Start Failure

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 359 PID(P): SPN: FMI: 11 Lamp: Yellow SRT:	The ICON™ system has failed to start the engine automatically.	The ICON™ system will be disabled. Only mandatory shutdown will be enabled. Can possibly start engine normally.

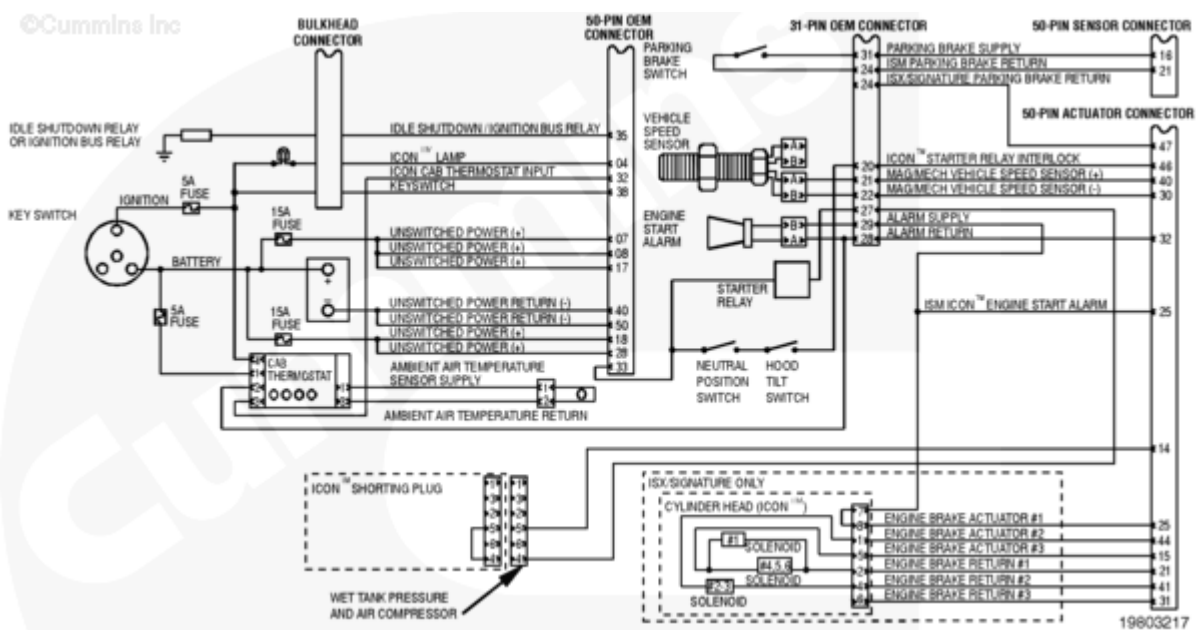

Integrated Idle ICON™ Circuit

Circuit Description

The starter relay circuit controls and monitors both the starter relay coil and return signal. The starter relay is used by the ICON™ feature to perform automatic starts of the engine.

Component Location

The starter relay is mounted on the fire wall of the vehicle on the intake side of the engine.

Shoptalk

This fault code is set if two consecutive automatic starts fail. If a start is commanded by the ECM and 200 rpm is **not** reached within 2 seconds nor 450 rpm within 14 seconds, then the start failed. After the first failure, ICON™ waits one minute and tries again. If the second start fails, the fault is set. It is cleared as soon as a manual start is successful.

Refer to Troubleshooting Fault Code t05-359 (</qs3/pubsys2/xml/en/procedures/82/82-t05-359.html>)

Last Modified: 02-Sep-2010
