


Fault Code: 435

Oil Pressure Sensor

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 435 PID(P): P100 SPN: 100 FMI: 2 Lamp: Yellow SRT:	An error in the oil pressure sensor signal was detected by the ECM.	None on performance; no engine protection for oil pressure.

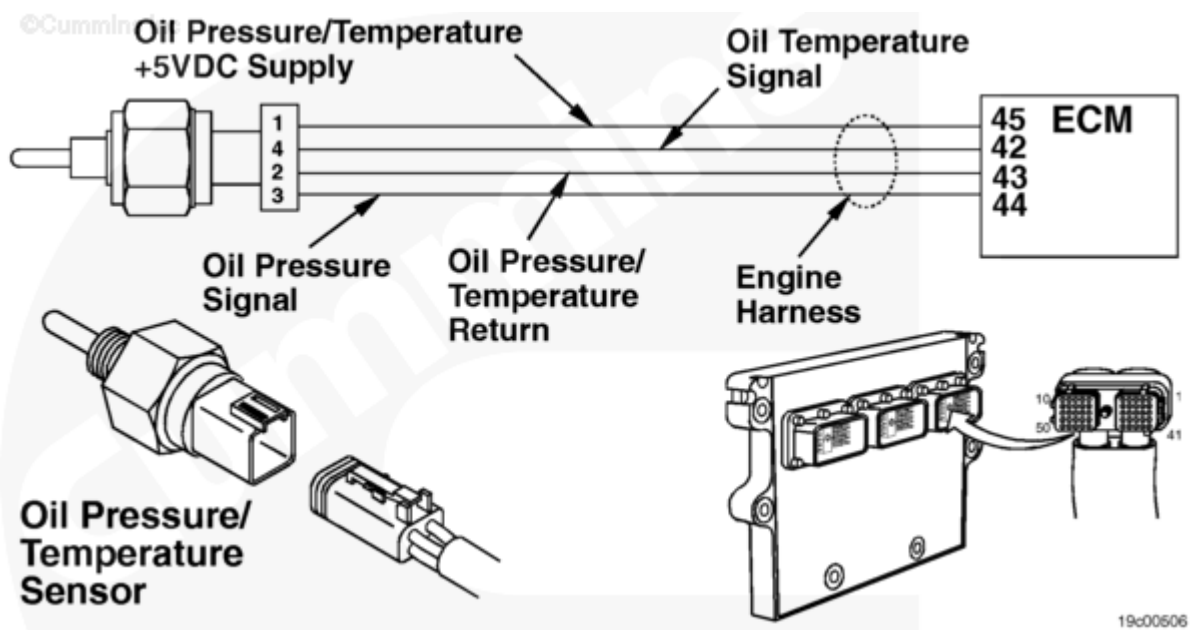

Oil Pressure Sensor

Circuit Description

Component Location

The oil pressure/temperature sensor is located on the engine block to the left of the fuel filter, behind the air compressor.

Shoptalk

At key-on, the readings for ambient pressure from the ambient air pressure sensor, intake manifold pressure sensor, and oil pressure sensor are compared. This fault code occurs if the oil pressure sensor reading is different from the other two.

Refer to Troubleshooting Fault Code t05-435 (</qs3/pubsys2/xml/en/procedures/82/82-t05-435.html>)

Last Modified: 02-Sep-2010
