


Fault Code: 582

Fuel Inlet Restriction Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 582 PID(P): P015 SPN: 1381 FMI: 4/4 Lamp: Yellow SRT:	Low voltage detected at the fuel inlet restriction sensor signal pin.	Fuel inlet restriction monitor deactivated.

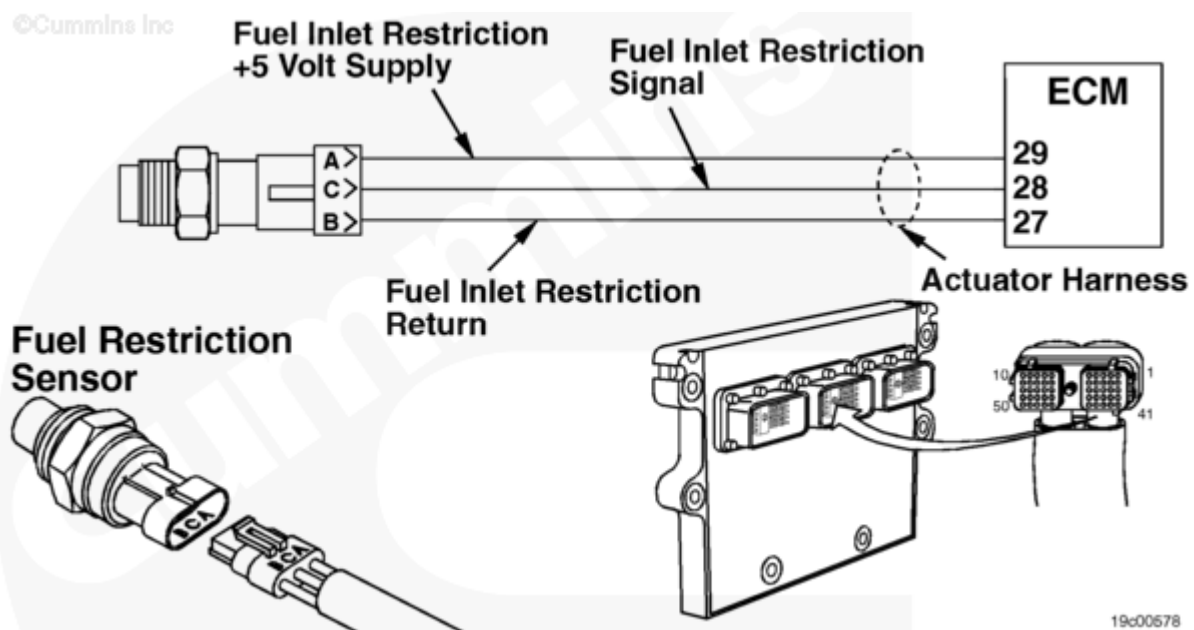

Fuel Inlet Restriction Sensor Circuit

Circuit Description

The fuel inlet restriction sensor provides a fuel pressure signal to the electronic control module (ECM).

Component Location

The fuel inlet restriction sensor is located on the fuel filter head.

Shoptalk

- This fault indicates that the voltage at signal pin 28 on the ECM is out of specification.
- The ECM provides a supply voltage of + 4.75 to 5.25 VDC. The sensor signal voltage to the ECM is from + 4.16 to 4.83 VDC.
- A quick check to determine if the sensor is functioning is to measure the pin-to-pin resistance of the sensor.

Description	Pin-to-Pin Resistance (k ohms)
Supply voltage to ground	13.35
Supply voltage to signal	1.77
Signal to ground	14.68

Refer to Troubleshooting Fault Code t05-582 (</qs3/pubsys2/xml/en/procedures/82/82-t05-582.html>)

Last Modified: 02-Sep-2010
