


Fault Code: 223

Centinel™ Burn Valve Solenoid Circuit - Voltage Incorrect

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 223 PID(P): S85 SPN: 1265 FMI: 4 Lamp: Yellow SRT:	The Centinel™ burn valve solenoid circuit is open or shorted. Less than 18.0 VDC detected at the Centinel™ burn valve solenoid supply pin of the engine harness or resistance of the solenoid has dropped below 80 ohms.	ECM turns off the burn valve supply voltage and the Centinel™ system is disabled.

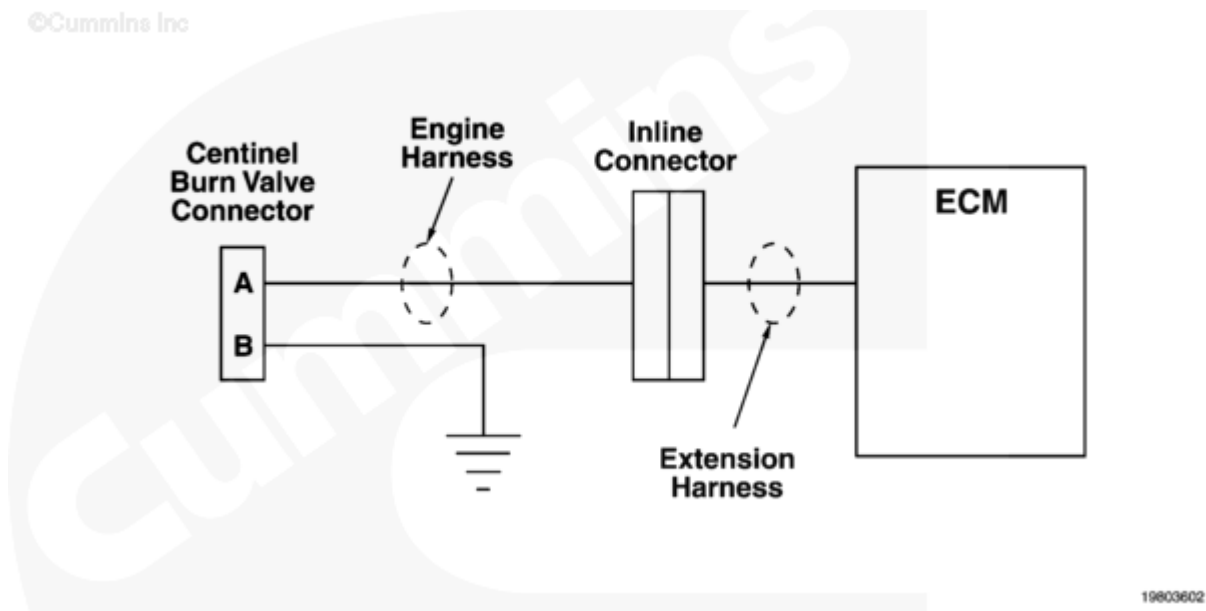

Burn Valve Solenoid Circuit

Circuit Description

The burn valve solenoid controls the flow of oil in the oil control valve during the burn cycle.

Component Location

The burn valve solenoid is located on top of the oil control valve.

Refer to Troubleshooting Fault Code t05-223 (</qs3/pubsys2/xml/en/procedures/87/87-t05-223.html>)

Last Modified: 29-Jul-2010
