


Fault Code: 254

EHAB (Fuel Shutoff Valve) Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 254 PID(P): S17 SPN: 632 FMI: 4 Lamp: Red SRT:	Less than 16.5 VDC detected at fuel shutoff solenoid supply pin 43 of the engine harness.	No action is taken by the electronic control module (ECM). Low voltage to the EHAB will cause it to stop fuel flow to the corresponding pump and shut down that engine bank.

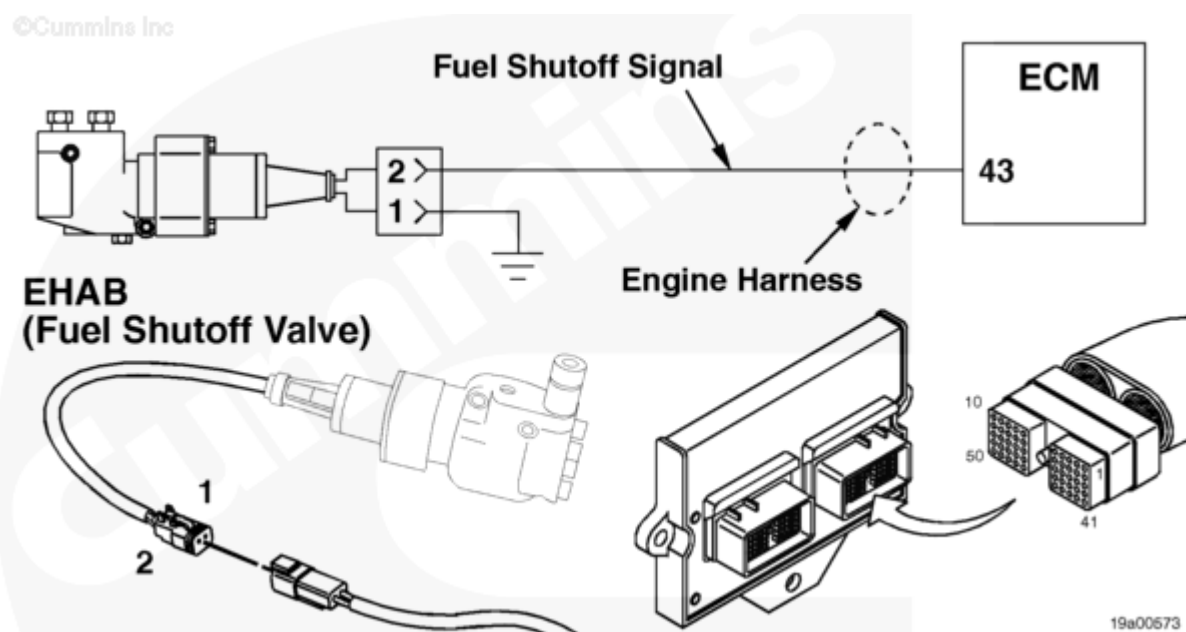

Electrohydraulic Shutoff Device (EHAB) Circuit

Circuit Description

The EHAB (fuel shutoff valve) is a device used by the ECM to stop the fuel supply into the injection pump. The ECM can shut down the engine by cutting off the power to the EHAB (fuel shutoff valve).

Component Location

The EHAB (fuel shutoff valve) is integral to the RP39 fuel pump.

Shoptalk

- The EHAB (fuel shutoff valve) **only** stops fuel to the RP39 fuel pump.
- Inspect the EHAB (fuel shutoff valve) circuit for external wires that can be spliced in to power another device. Remove any extra wires that are found in the circuit.
- If there is an external shutdown system on the vehicle that uses the EHAB (fuel shutoff valve) for engine shutdown, make sure it has **not** failed and lowered the voltage on the EHAB (fuel shutoff valve).
- Inspect the engine block to chassis ground wire to make sure it is securely fastened to a clean, dry surface.
- Check the starter solenoid "+" terminal for a loose connector and/or accessory wiring with damaged insulation.
- Check the module grounding to the block.
- Using the service tool, Part Number 3163531 (EHAB breakout cable), can be helpful for measuring closed circuit voltages. The EHAB valve requires 16.5 VDC to open.

Refer to Troubleshooting Fault Code t05-254 (</qs3/pubsys2/xml/en/procedures/87/87-t05-254.html>)