


Fault Code: 259

EHAB (Fuel Shutoff Valve) Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 259 PID(P): S17 SPN: 632 FMI: 7 Lamp: Red SRT:	EHAB (fuel shutoff valve) is open and will not close.	ECM commands rack position to zero, which stops fueling corresponding engine bank.

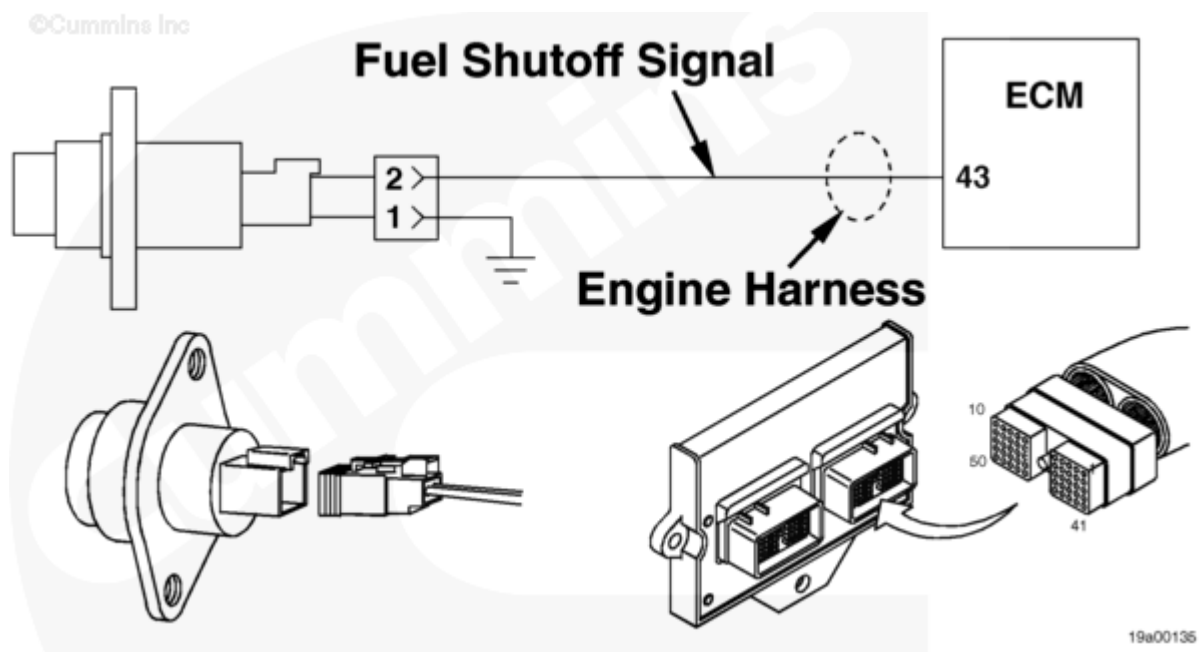

Electrohydraulic Shutoff Device (EHAB) Circuit

Circuit Description

The EHAB (fuel shutoff valve) is a device used by the ECM to stop the fuel supply into the injection pump. The ECM can shut down the engine by cutting off the power to the fuel shutoff valve.

Component Location

The EHAB (fuel shutoff valve) solenoid is integral to the RP39 fuel pump.

Shoptalk

- The EHAB (fuel shutoff valve) solenoid **only** stops fuel to the RP39 fuel pump.
- Inspect the EHAB (fuel shutoff valve) supply circuit for external wires that can be spliced in to power another device. Remove any extra wires that are found in the circuit.
- If there is an external shutdown system on the vehicle that uses the EHAB (fuel shutoff valve) for engine shutdown, make sure it has **not** failed and lowered the voltage on the EHAB (fuel shutoff valve) circuit.
- Inspect the engine block to chassis ground wire to make sure it is securely fastened to a clean, dry surface.
- Check the starter solenoid "+" terminal for a loose connector and/or accessory wiring with damaged insulation.
- Check the module grounding to the block.

Refer to Troubleshooting Fault Code t05-259 (</qs3/pubsys2/xml/en/procedures/87/87-t05-259.html>)