


Fault Code: 441

Unswitched Battery Supply Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 441 PID(P): P168 SPN: 168 FMI: 1 Lamp: Yellow SRT:	Less than 9.0-VDC battery voltage detected at the electronic control module (ECM).	ECM voltage supply approaching a level at which unpredictable operation will occur.

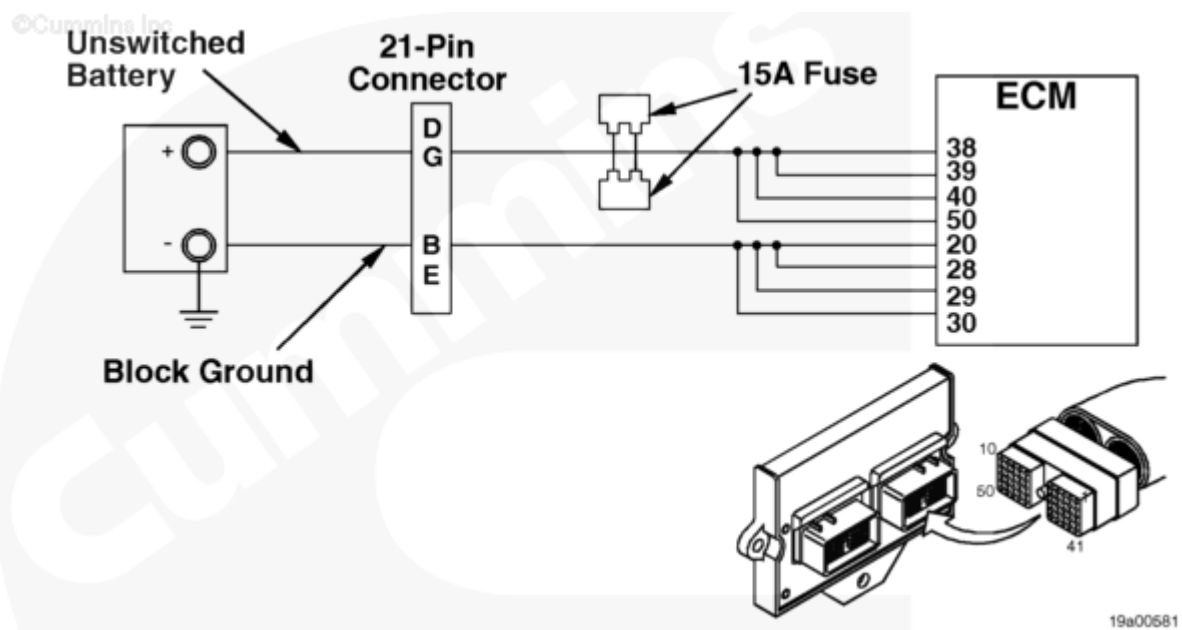

Unswitched Battery Supply Circuit

Circuit Description

The ECM receives unswitched battery voltage through the OEM harness and the engine harness. There is an in-line 15-amp fuse in the unswitched battery wires of the engine harness to protect the ECM. The battery return wires in the engine harness are connected to the engine block ground.

Component Location

The location of the battery will vary with the OEM. Refer to the OEM manual for the battery location.

Shoptalk

This fault is usually caused by loose or corroded battery connections.

Refer to Troubleshooting Fault Code t05-441 (</qs3/pubsys2/xml/en/procedures/87/87-t05-441.html>)

Last Modified: 29-Jul-2010
