


Fault Code: 729

Crankcase Blowby Pressure Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 729 PID(P): P030 SPN: 101 FMI: 4 Lamp: Yellow SRT:	Less than 0.34 VDC detected at the crankcase blowby pressure sensor signal pin 25 of the engine harness.	Engine protection for crankcase blowby pressure is disabled.

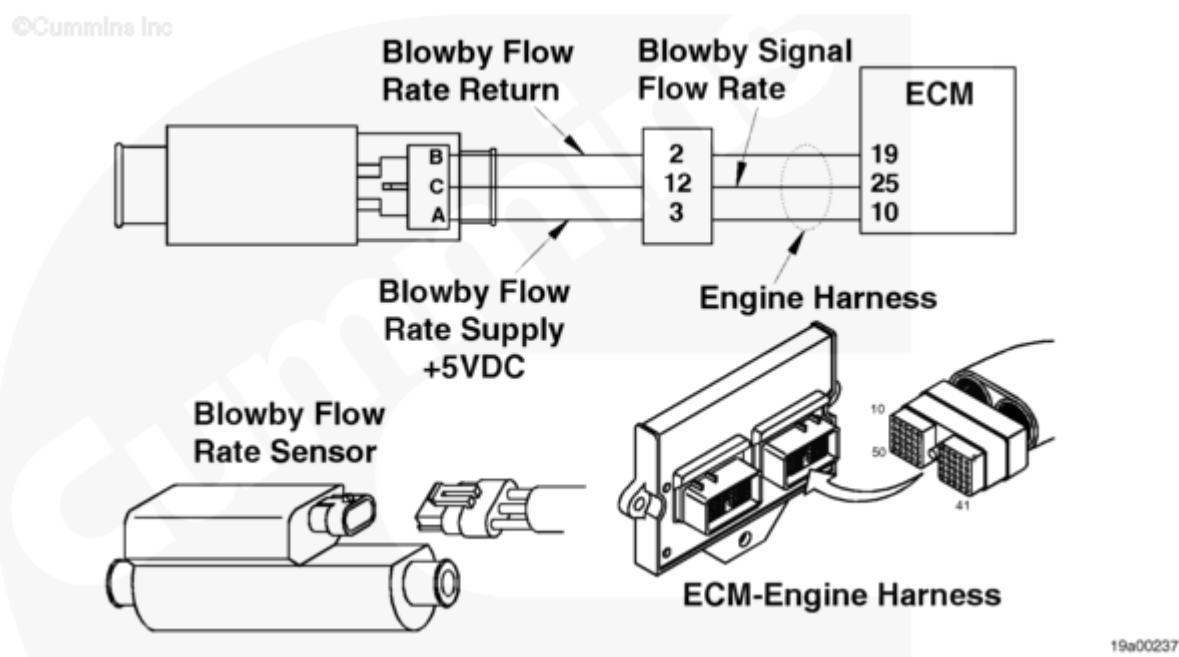

Crankcase Blowby Pressure Sensor Circuit

Circuit Description

The blowby pressure sensor monitors blowby pressure and passes this information to the electronic control module (ECM) through pin 25 of the engine harness.

The ECM monitors the voltage on pin 25 and expects to see the voltage vary between 0.5 and 4.5 VDC during normal engine operation.

Voltage below 0.34 VDC on pin 25 will trip Fault Code 729 and can be caused by short circuits in the supply, signal, or return wires, an open in the return wire, or a failed sensor.

Component Location

The blowby pressure sensor is located in the gear case on the left side of the engine.

Shoptalk

- Confirm that the blowby sensor, crankcase breathers, and breather tubes are **not** obstructed.
- The crankcase blowby pressure sensor is used in conjunction with CENSE™ engine monitoring system.

Refer to Troubleshooting Fault Code t05-729 (</qs3/pubsys2/xml/en/procedures/87/87-t05-729.html>)