


Trainings ▾

Preparatory Steps

⚠ WARNING ⚠

Batteries can emit explosive gases. To reduce the possibility of personal injury, always ventilate the compartment before servicing the batteries. To reduce the possibility of arcing, remove the negative (-) battery cable first and attach the negative (-) battery cable last.

- Disconnect the batteries.

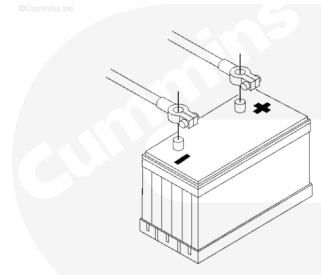

13900050

- Remove the rocker lever cover(s). Refer to Procedure 003-011 (</qs3/pubsys2/xml/en/procedures/40/40-003-011-tr.html>).
- Remove the rocker levers. Refer to Procedure 003-008 (</qs3/pubsys2/xml/en/procedures/40/40-003-008-tr.html>).




ck800wa

Remove

Remove the push rods.


Note : Mark the push rods to identify their location.

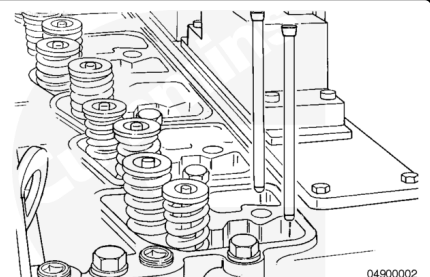


04900002

Clean and Inspect for Reuse


Clean the push rods in hot, soapy water.

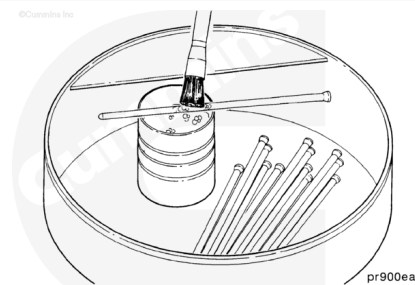

Inspect the push rods ball and socket for signs of scoring. Check for cracks where the ball and the socket are pressed into the rod.

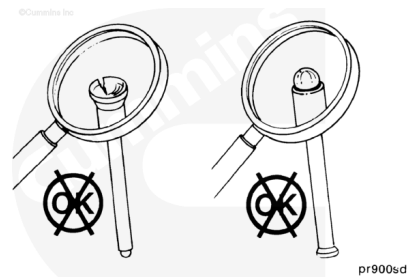

Check the push rods for roundness and straightness.

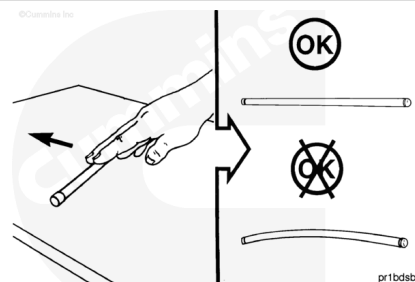


Install

Install the push rods into the sockets of the valve tappets.

Lubricate the push rods sockets with clean lubricating engine oil.

Note : The push rods and tappets must be installed in the same cylinder and intake or exhaust position from which they were removed.

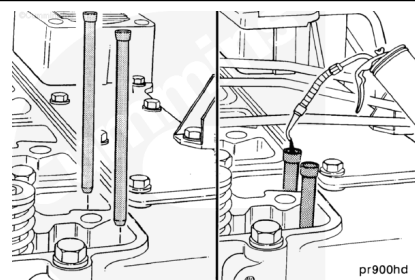

Finishing Steps

Note : Make sure the rocker lever adjusting screws are completely backed out.

- Install the rocker levers. Refer to Procedure 003-008 (</qs3/pubsys2/xml/en/procedures/40/40-003-008-tr.html>)
- Adjust the valves. Refer to Procedure 003-004 (</qs3/pubsys2/xml/en/procedures/40/40-003-004-tr.html>)
- Install the rocker lever cover(s) and gasket(s). Refer to Procedure 003-011 (</qs3/pubsys2/xml/en/procedures/40/40-003-011-tr.html>).

©Cummins Inc.




ck800wa

⚠ WARNING ⚠

Batteries can emit explosive gases. To reduce the possibility of personal injury, always ventilate the compartment before servicing the batteries. To reduce the possibility of arcing, remove the negative (-) battery cable first and attach the negative (-) battery cable last.

©Cummins Inc.

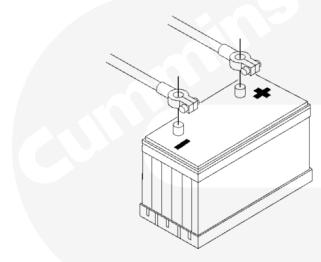

13900050

- Connect the batteries.