


Trainings ▾

Preparatory Steps

⚠ WARNING ⚠

Batteries can emit explosive gases. To reduce the possibility of personal injury, always ventilate the compartment before servicing the batteries. To reduce the possibility of arcing, remove the negative (-) battery cable first and attach the negative (-) battery cable last.


- Disconnect the batteries.

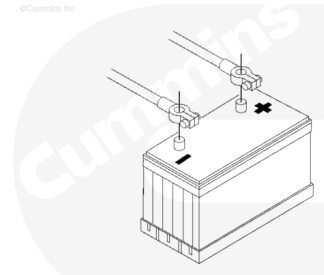

13900050

Remove


Disconnect all hydraulic lines from the pump.

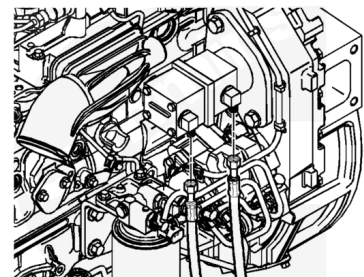

09d00008

Note : Refer to the OEM service manual for removal procedures.


Remove the hydraulic pump and gear assembly.

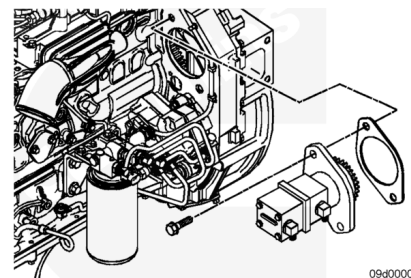

09d00009


Clean and Inspect for Reuse

Clean the gasket material from the hydraulic pump with a putty knife and a clean rag.

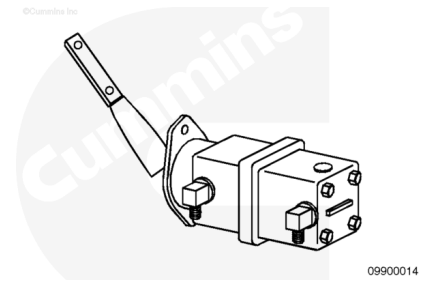

⚠ WARNING ⚠

When using solvents, acids, or alkaline materials for cleaning, follow the manufacturer's recommendations for use. Wear goggles and protective clothing to reduce the possibility of personal injury.

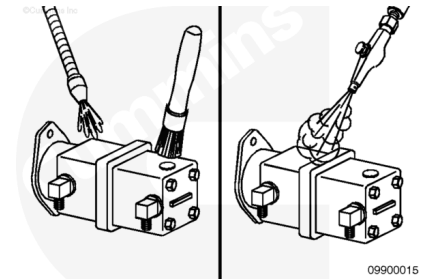


⚠ WARNING ⚠

Wear appropriate eye and face protection when using compressed air. Flying debris and dirt can cause personal injury.


Clean the hydraulic pump gear with solvent.

Dry with compressed air.

Inspect the hydraulic pump drive gear for cracks, broken teeth, and other damage.

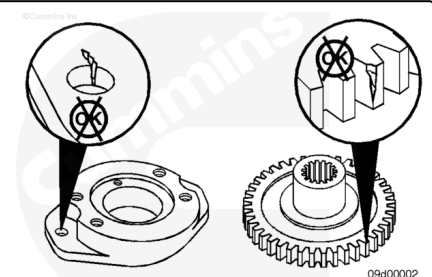


Inspect the inside diameter of the drive gear bore for excessive wear or damage; replace if necessary.

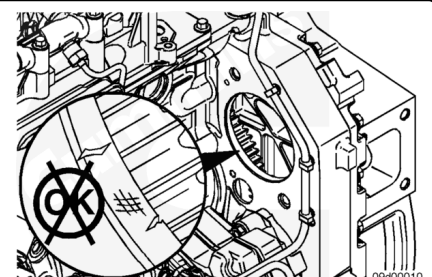


Install

Use a new gasket and install the hydraulic pump.

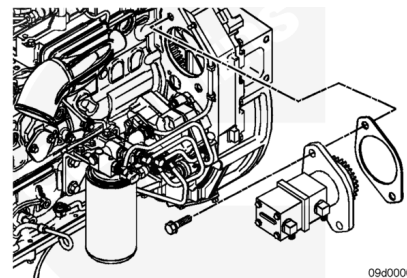


Connect all hydraulic lines to the pump.

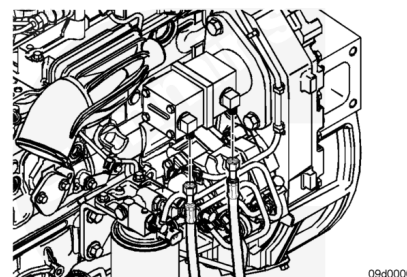

Tighten mounting capscrews.


Torque Value: 62 n•m [46 ft-lb]

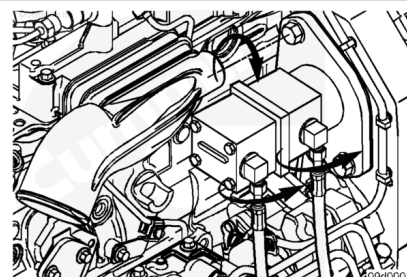

Finishing Steps


⚠ WARNING ⚠

Batteries can emit explosive gases. To reduce the possibility of personal injury, always ventilate the compartment before servicing the batteries. To reduce the possibility of arcing, remove the negative (-) battery cable first and attach the negative (-) battery cable last.

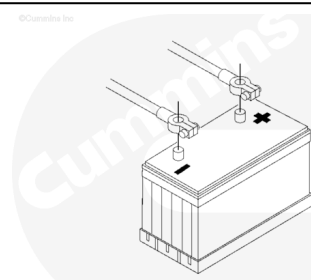

- Connect the batteries.

- Operate the engine and check for leaks.

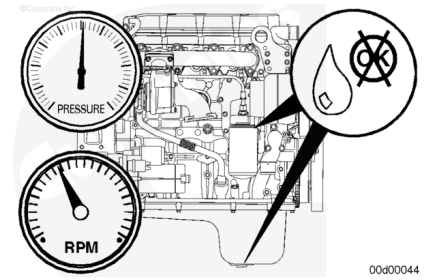

Last Modified: 31-Mar-2006
