


Fault Code: 113

Timing Actuator Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 113 PID(P): S20 SPN: 635 FMI: 3 Lamp: Yellow SRT: 00-343	Timing actuator circuit is open, or supply pin 1 is shorted to ground, or return pin 20 is shorted to battery voltage.	No action by the ECM is taken. Actuator is closed or partially closed. Engine exhausts white smoke and loses power. Fault Code 112 can possibly be logged.

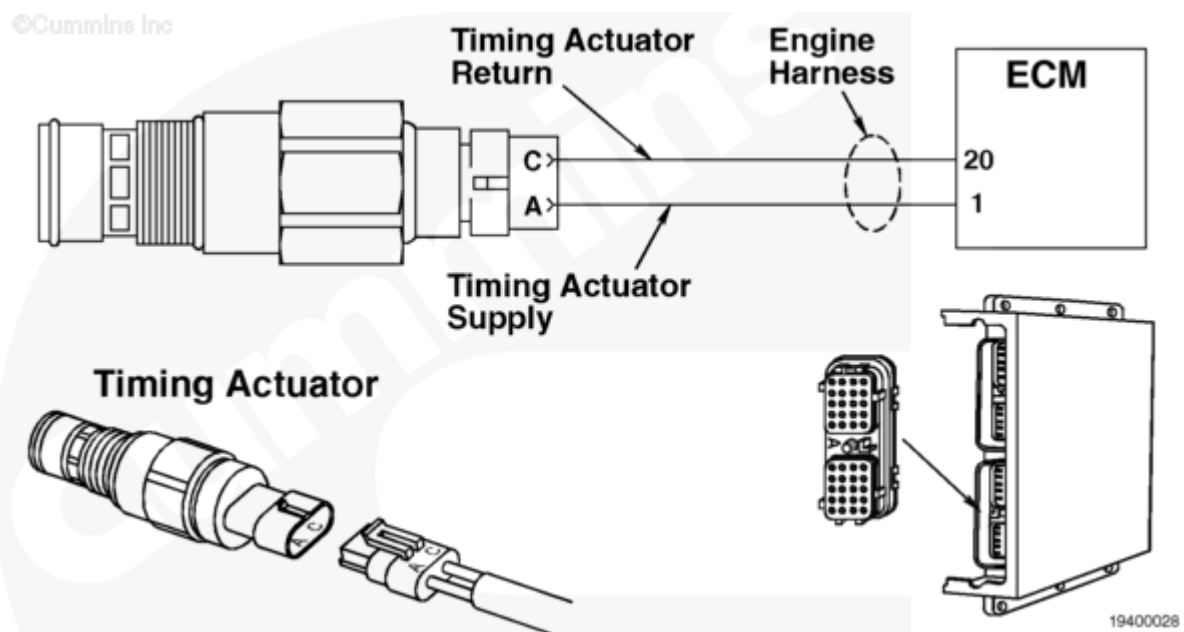

Timing Actuator Circuit

Circuit Description

The timing actuator circuit supplies current to the timing actuator. The ECM commands a varying amount of current to the timing actuator to control the amount of timing pressure to the injectors.

Component Location

The timing actuator is located on the top of the control valve body, toward the front of the engine and behind the ECM.

Shoptalk

- Confirm that the actuator connector is firmly in place.
- When there is no power to the actuator, the actuator closes and timing flow stops. This can cause Fault Code 112, timing fueling flow mismatch.

Refer to Troubleshooting Fault Code t05-113 (</qs3/pubsys2/xml/en/procedures/19/19-t05-113.html>)

Last Modified: 01-Mar-2011
