

Trainings ▾

Clean and Inspect for Reuse

⚠ WARNING ⚠


When using solvents, acids, or alkaline materials for cleaning, follow the manufacturer's recommendations for use. Wear goggles and protective clothing to reduce the possibility of personal injury.

⚠ WARNING ⚠

When using a steam cleaner, wear safety glasses or a face shield, as well as protective clothing. Hot steam can cause serious personal injury.

⚠ WARNING ⚠

Wear appropriated eye and face protection when using compressed air. Flying debris and dirt can cause personal injury.

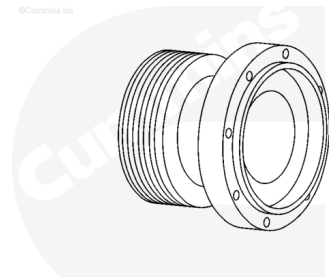

01600279


Use solvent or steam to clean the pulley and dry with compressed air.

Check all mounting pilots and surfaces for damage from fretting.

If it is **not** possible to remove the damage with a 240-grit abrasive cloth, the crankshaft pulley **must** be replaced.

Poly Vee pulley groove wear can be measured by placing a gauge ball or drill bit in the pulley groove and checking the protrusion with a straight edge. If the gauge ball or drill bit is below the pulley peaks, the pulley **must** be replaced.

All QSK45 and QSK60 engines use the L section pulley belt type.

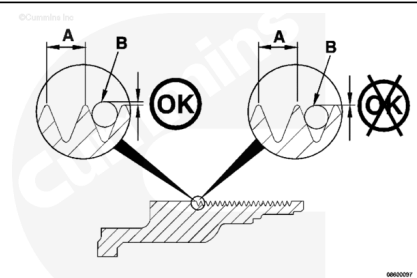

0000007

Poly Vee - Pulley Reuse Guidelines	
Groove peak to peak dimension	Measuring tool dimension (B)
4.70 mm [0.185 in]	4 mm [0.16 in] gauge ball or a number 20 drill bit