


Fault Code: 136

Pre-Oil Filter Pressure 1 Sensor Circuit - Voltage Above Normal or Shorted to High Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 136 PID(P): 99 SPN: 1208 FMI: 3 Lamp: None SRT: 00-688	Pre-Oil Filter Pressure 1 Sensor Circuit - Voltage Above Normal or Shorted to High Source. High voltage detected on prefilter oil pressure sensor SIGNAL pin 07 of the main harness A ECM connector.	Fault Code 612 is disabled.

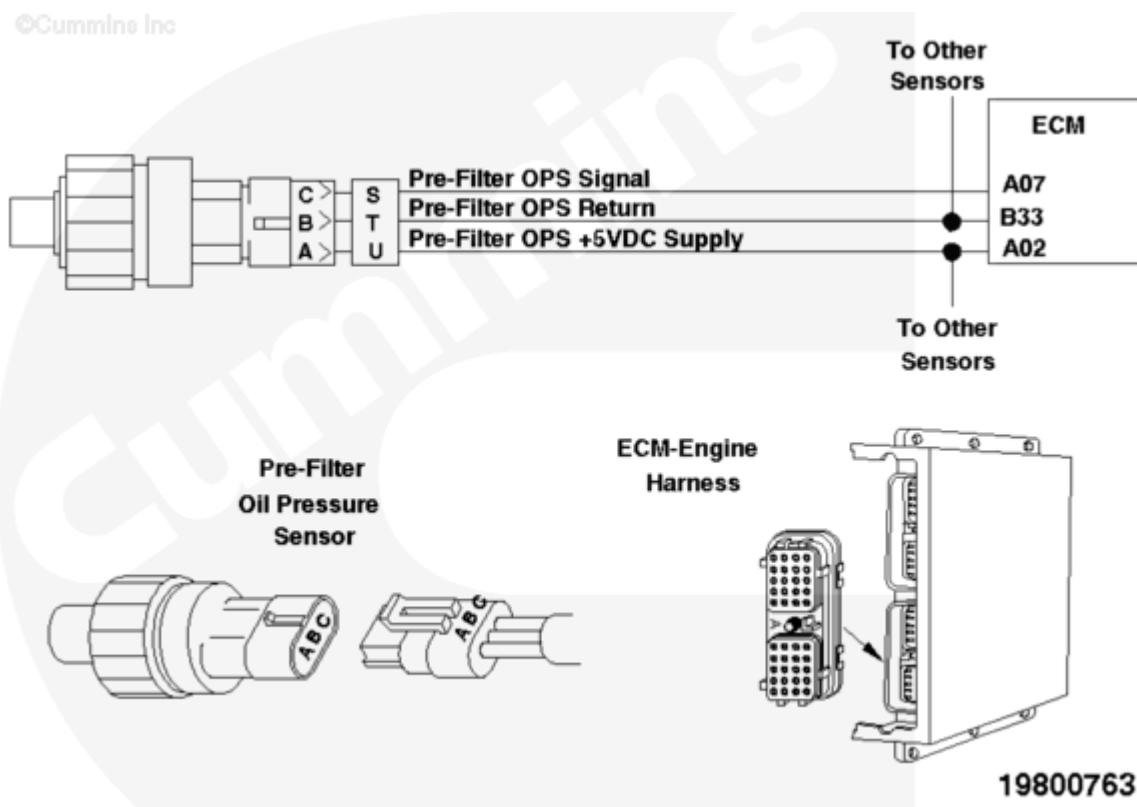

Prefilter Oil Pressure Sensor Circuit

Circuit Description

The prefilter oil pressure is the engine oil pressure before the oil has passed through the oil filters. The prefilter oil pressure sensor sends the prefilter oil pressure signal to the CENSE™ ECM.

Component Location

The prefilter oil pressure sensor is located on the oil inlet side of the lubricating oil system filter head.

Shoptalk

- If the fault occurs **only** in a cold environment, allow the oil to warm up and check to see if the fault becomes inactive.

Refer to Troubleshooting Fault Code t05-136 (</qs3/pubsys2/xml/en/procedures/81/81-t05-136.html>)