



Technical Service Bulletin

Technical Service Bulletin: TSB190108

Released Date: 24-Jun-2019

New Counterbore Cutting Tool Improvement Kit

New Counterbore Cutting Tool Improvement Kit

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- ISX (All Versions)
- ISX15 (All Versions)
- X15 (All Versions)
- QSX (All Versions)
- QSX15 (All Versions)

Description of Change

A new counterbore cutting improvement kit is available. The existing counterbore cutting tool design has been changed to reduce the stress and strain required to perform the counterbore cutting operation.

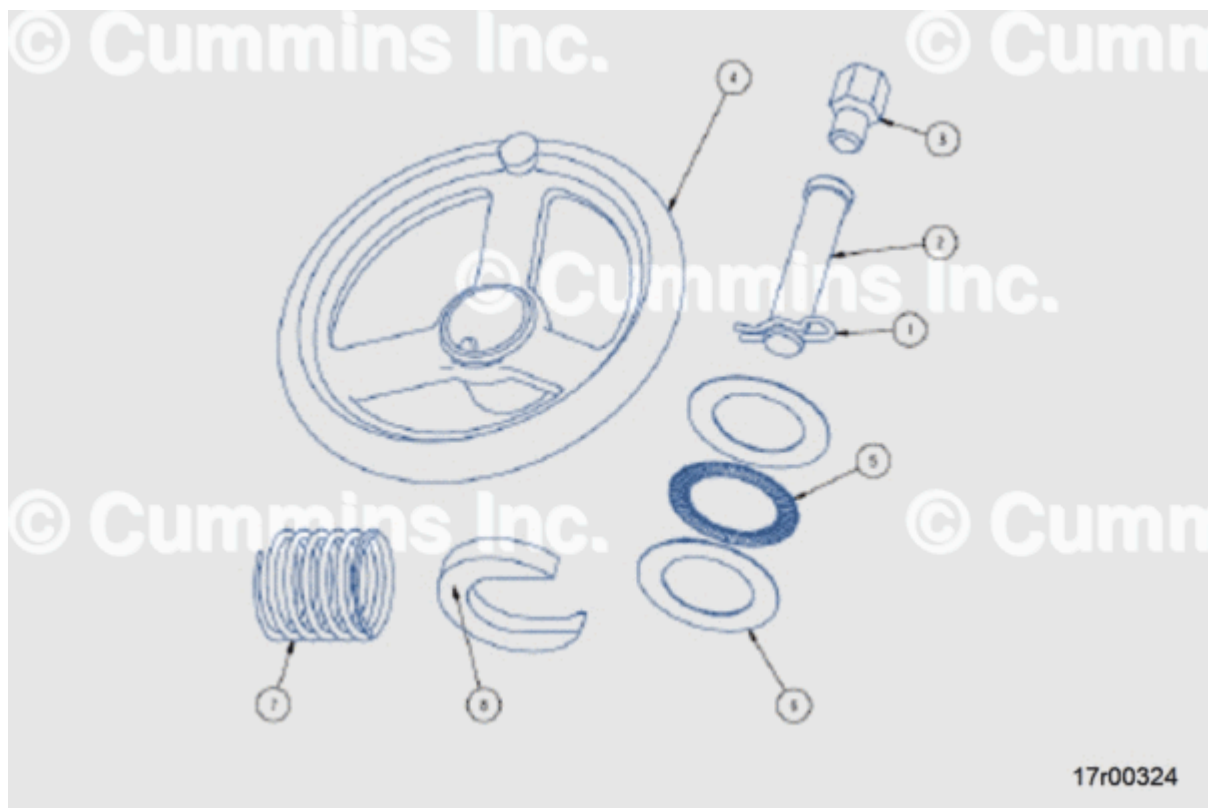


Figure 1, Counterbore Cutting Improvement Kit, Part Number 5395552.

1. Clip, wire retaining
2. Pin, clevis
3. Adapter, drive
4. Driver, counterbore cutter
5. Bearing, needle
6. Race, outer bearing
7. Spring, compression
8. Collar, stop

Reason for Change

- Is used to aid and improve the ergonomics of cylinder block counter bore cutting operations with the engine installed in the vehicle.
- Can be used with all engine-specific counter bore cutting kits that use counterbore ledge cutter drive unit, Part Number 3163785, as the drive unit for the cutter plate.

Service Instructions

- The stop collar, Part Number 5395558, has a recessed surface and ledge that reduces the collar's tendency to back away from the drive unit during rotation. The stop collar can be used as a direct replacement for the collar that comes with the drive unit. The recessed surface on the stop collar **must** face the drive unit body.
- There are two variables that control the quality of the counter bore manual machining operation this counterbore cutting improvement kit improves:
 - Cutter bit down pressure
 - Cutter bit rotational consistency
- The spring pack will generate consistent down pressure. No manual down pressure will be required.

- Consistent rotation can be achieved using any of the following as the situation and user preference allow:
 - The T-handle that comes with the drive unit.
 - The driver, Part Number 5395553, and pins, Part Number 5298566 and 3163875, in the counterbore cutting improvement kit.
 - The taller drive adapter, Part Number 5395143, in the counterbore cutting improvement kit, which replaces the bolt at the top of the drive unit, and a 22 mm socket with a ratchet wrench.

Service Tools Available

Service tools are available. See Table 1 for part numbers.

Table 1, Counterbore Cutting Improvement Kit, Part Number 5395552, Contents

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number	Quantity
Clip, Wire Retaining	-	-	-	3163875	1
Pin, Clevis	-	-	-	5298566	1
Adapter, Drive	-	-	-	5395143	1
Driver, Counterbore Cutter	-	-	-	5395553	1
Bearing, Needle	-	-	-	5395555	1
Race, Outer Bearing	-	-	-	5395556	2
Spring, Compression	-	-	-	5395557	1
Collar, Stop	-	-	-	5395558	1

Associated Publications

See Service Products Catalog, Bulletin 3377710. Reference Procedure 5395552 in Section 3.

Document History

Date	Details
2019-6-20	Module Created

