



Technical Service Bulletin: TSB200219

Released Date: 24-Nov-2020

Release of Thermal Recirculation Valve with Integrated Check Valve

Release of Thermal Recirculation Valve with Integrated Check Valve

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Note : Within this document the thermal recirculation valve will be referred to as TRV.

Product Affected

- X15 CM2350 X114B
- X15 CM2350 X116B

Reason for Change

The New TRV has an integrated check valve which will help

- Reduce air recirculation in the fuel system
- Higher temperature Thermostat helps reduce fuel gelling during operation
- Allow for upfit to extended life fuel filter for increased fuel filter intervals
- Reduce suction side fuel filter plugging

Customer Communication

Customer optional product improvement. The components in this document provide the following benefits:

- Integrated check valve Improving startability if air is trapped in fuel system from service or ingress at other connection
- Robustness to stage 1 filter plugging by higher temperature Thermal Recirculating Valve
- New plumbing provides clearance for longer stage 2 fuel filter for extended intervals

Overview

X15 CM2350 X114B

X15 CM2350 X114B uses two fuel line routings, configuration A or configuration B.

- For engines equipped with configuration A fuel lines, currently a service kit is **not** available.
- For engines equipped with configuration B fuel lines, kit part number 5633513 can be used.

Configuration A

There may be an overlap in engine serial number (ESN). Verify the vehicle's appropriate fuel supply tube configuration and part number before commencing repairs. See Figure 1 and Figure 2 for visual confirmation and Table 2 for part number verification.

Approximate engine serial number (ESN) range for configuration A: 79890940 to 80038419. For ESN outside of this range confirm part numbers from Table 2.

No service kit is available for this configuration.

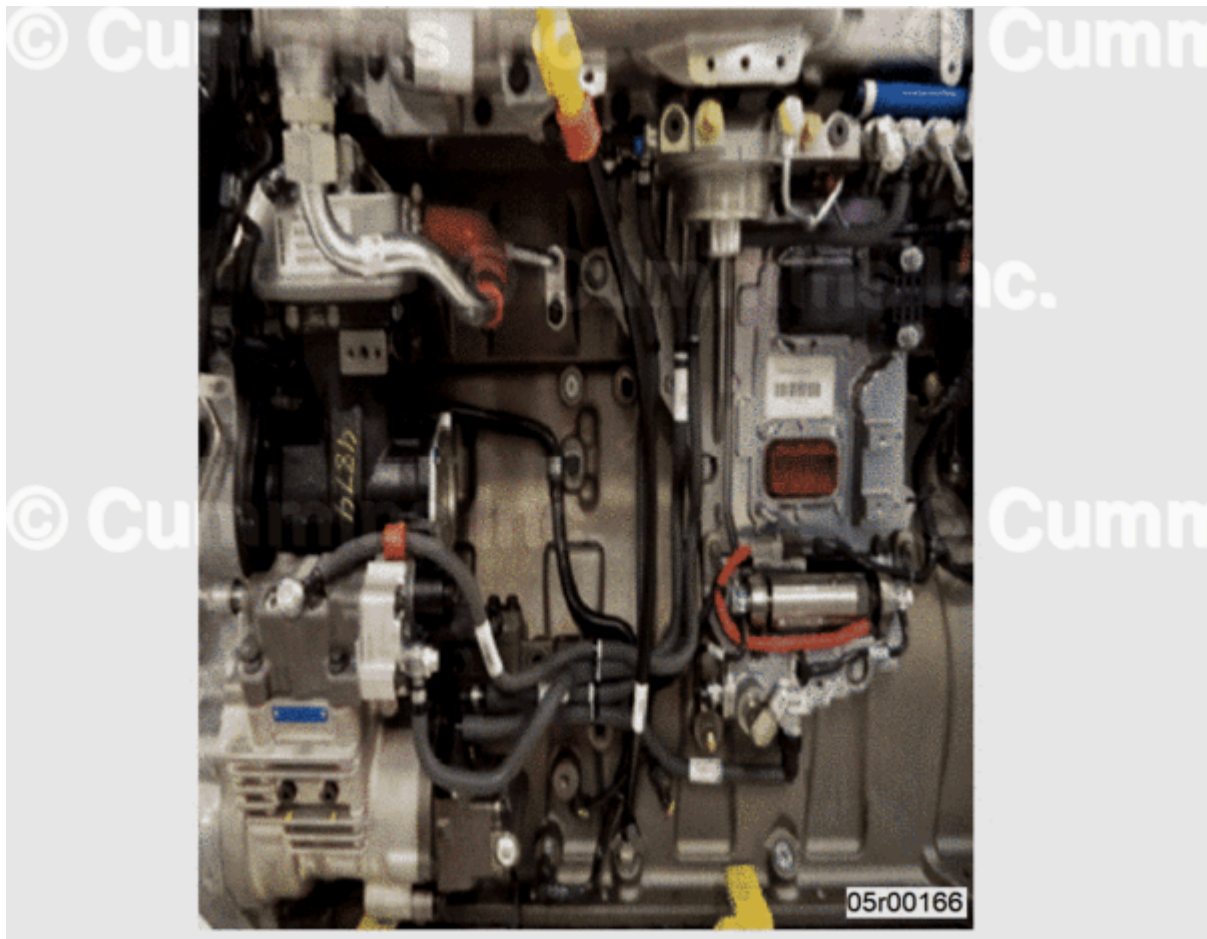


Figure 1, Representation of Configuration A.

Configuration B

There may be an overlap in engine serial number (ESN). Verify the vehicle's appropriate fuel supply tube configuration and part number before commencing repairs. See Figure 1 and Figure 2 for visual confirmation and Table 2 for part number verification.

Approximate engine serial number (ESN) range for configuration B: 79999784 – 80276968 For ESN outside of this range confirm part numbers from Table 2.

A service kit is available, Part Number 5633513, includes components required to upfit to TRV 105°F thermostat with integrated check valve and extended fuel filter. See Table 1 for list of components.

Table 1, X15 CM2350 X114B and ISX15 CM2350 X101 Configuration B Service Kit, Part Number 5633513

Part Description	Part Number	Quantity
WASHER,SEALING	3963990	4
CLAMP,WIRE TIE	4952223	1
TUBE,FUEL DRAIN	5536886	1
TUBE,FUEL DRAIN	5537254	1
MANIFOLD,FUEL	5612313	1



Figure 2, Representation of Configuration B.

Engines might have a nylon fuel supply line or a steel fuel supply line. See Table 2 below.

Table 2, Part Number Verification

Part Description	Nylon Fuel Supply Line	Steel Fuel Supply Line
Tube, Fuel Supply Configuration A	3691498	5575157
Tube, Fuel Supply Configuration B	5440474	5558764

X15 CM2350 X116B

X15 CM2350 X116B can use service kit, Part Number 5633511, to upfit to new TRV and upfit to extend fuel filter. Service kit, Part Number 5633511, includes components required to upfit to TRV 105°F thermostat with integrated check valve and extended fuel filter. See Table 3 below for list of components.

Table 3, X15 CM2350 X116B Service Kit, Part Number 5633511

Part Description	Part Number	Quantity
WASHER, SEALING	3963990	2
TUBE, FUEL DRAIN	5536886	1
TUBE, FUEL DRAIN	5536891	1
MANIFOLD, FUEL	5612313	1

Service Instruction

Follow the installation instruction procedures below for installing the TRV kits.

Table 4, Installation Instructions

Engine	Installation Instruction Number
X15 CM2350 X114B	5414689
X15 CM2350 X116B	5414689

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 5, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Fuel Manifold Kit (Performance Series)	-	No	No	563351100
Fuel Manifold Kit (Efficiency Series) X15 CM2350 X114B	-	No	No	563351300

Document History

Date	Details
2020-11-9	Module Created

Last Modified: 24-Nov-2020
