


Fault Code: 119

Fuel Pump Pressure Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 119 PID(P): P135 SPN: 135 FMI: 4 Lamp: Yellow SRT: 00-384	Less than 0.30-VDC detected at fuel pump pressure sensor signal pin 32 of the engine harness.	No action by the ECM is taken.

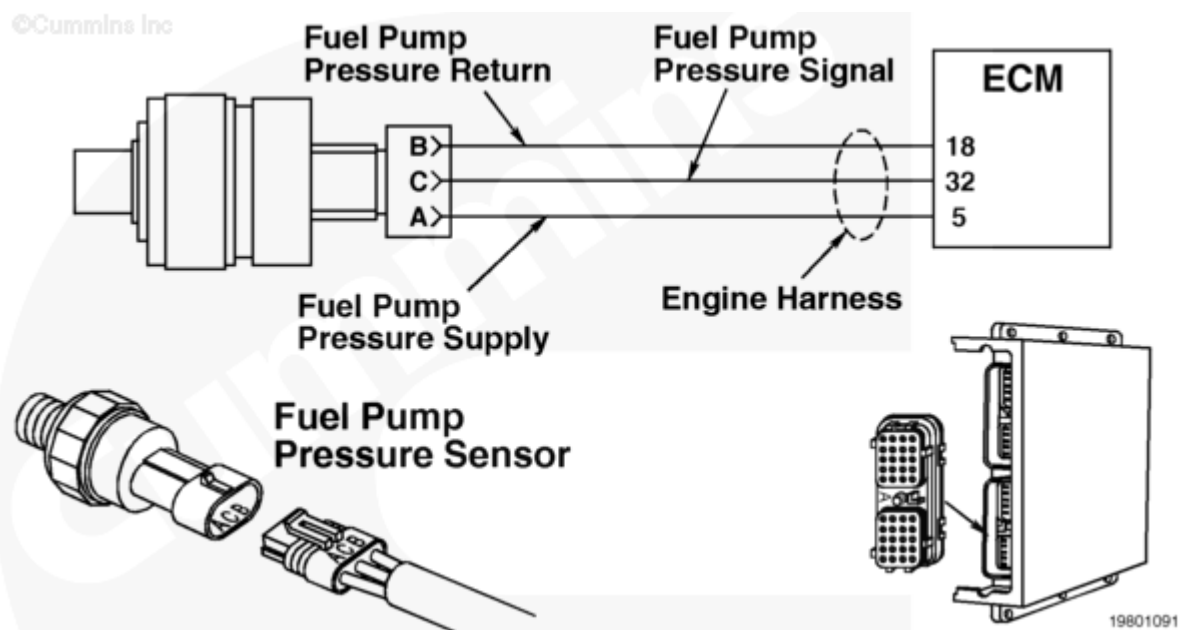

Fuel Pump Pressure Sensor Circuit

Circuit Description

The fuel pump pressure sensor provides the fuel pump pressure sensor signal to the ECM through the engine harness. The ECM uses the fuel pump pressure signal to monitor the fuel pump pressure going to the control valve body.

Component Location

The fuel pump pressure sensor is located on the fuel pump.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged fuel pump pressure sensor
- Malfunctioning or damaged engine wiring harness

Refer to Troubleshooting Fault Code t05-119 (</qs3/pubsys2/xml/en/procedures/19/19-t05-119.html>)

Last Modified: 28-May-2026
