


Fault Code: 221

Ambient Air Pressure Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 221 PID(P): P108 SPN: 108 FMI: 3 Lamp: Yellow SRT: 00-361	More than 4.78-VDC detected at the ambient air pressure sensor signal pin 34 of the engine harness.	Derate in power output of the engine.

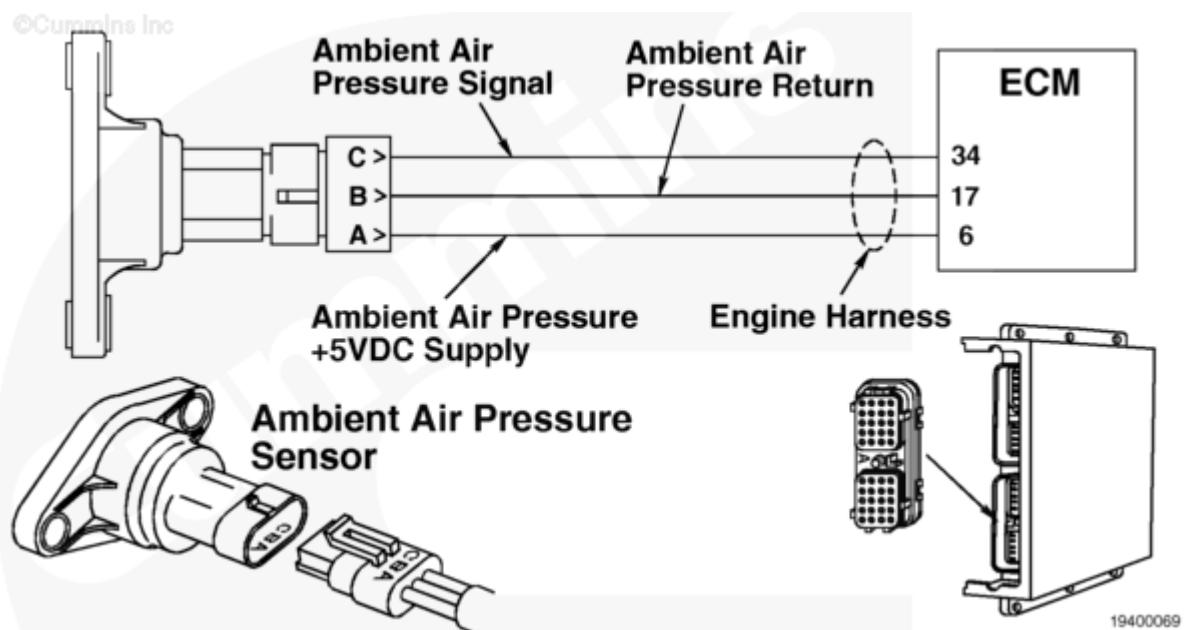

Ambient Air Pressure Sensor Circuit

Circuit Description

The ambient air pressure sensor provides the ambient air pressure signal to the ECM through the engine harness. The ECM uses the ambient air pressure sensor to adjust fueling based on the altitude.

Component Location

The ambient air pressure sensor is located below the ECM on the control valve body.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged ambient air pressure sensor
- Malfunctioning or damaged engine wiring harness

Refer to Troubleshooting Fault Code t05-221 (</qs3/pubsys2/xml/en/procedures/19/19-t05-221.html>)

Last Modified: 28-May-2026
