


Fault Code: 555

Blowby Pressure - Engine Protection

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 555 PID(P): P101 SPN: 1264 FMI: 0 Lamp: Engine Protection SRT: 00-676	High blowby pressure has been detected. Voltage signal at blowby pressure signal pin 25 indicates blowby pressure above 368 mm H ₂ O [14.5 in H ₂ O].	Calibration-dependent. Progressive power and speed derate and engine shutdown as pressure increases over thresholds.

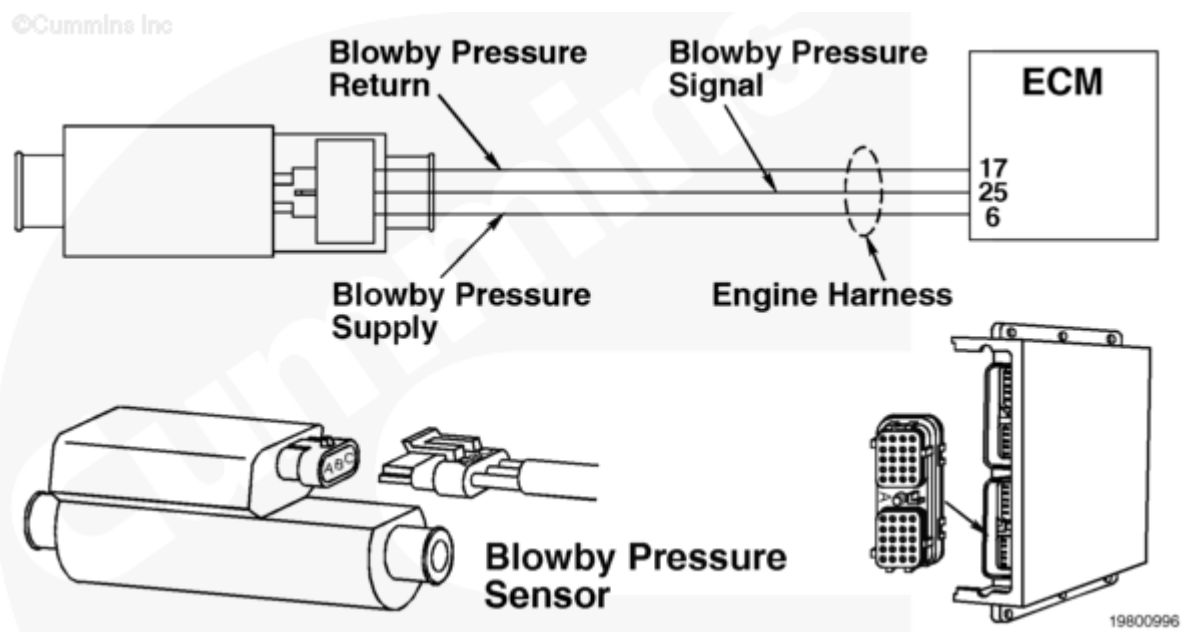

Blowby Pressure Sensor Circuit

Circuit Description

The blowby pressure sensor is used by the ECM to monitor the engine crankcase pressure. The ECM monitors the voltage on the signal pin and converts this to a pressure value. The blowby pressure value is used by the ECM for the engine protection system.

Component Location

The blowby pressure sensor is located on the exhaust side of the engine, below the water pump on the QSK19 series engines. See engine component views in Section E for location information for the QSK23, QSK45, QSK60, and QSK78 series engines.

Shoptalk

- Confirm that the crankcase breathers and breather tubes are **not** obstructed.

Refer to Troubleshooting Fault Code t05-555 (/qs3/pubsys2/xml/en/procedures/19/19-t05-555.html)

Last Modified: 01-Mar-2011
