


Fault Code: 1117

Power Supply Lost With Ignition ON - Data Erratic, Intermittent, or Incorrect

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 1117 PID(P): S251 SPN: 627 FMI: 2/2 Lamp: None SRT:	Power Supply Lost With Ignition ON - Data Erratic, Intermittent, or Incorrect. The ECM was not allowed to power down correctly (retain battery voltage for 30 seconds after key OFF).	Engine could possibly stall.

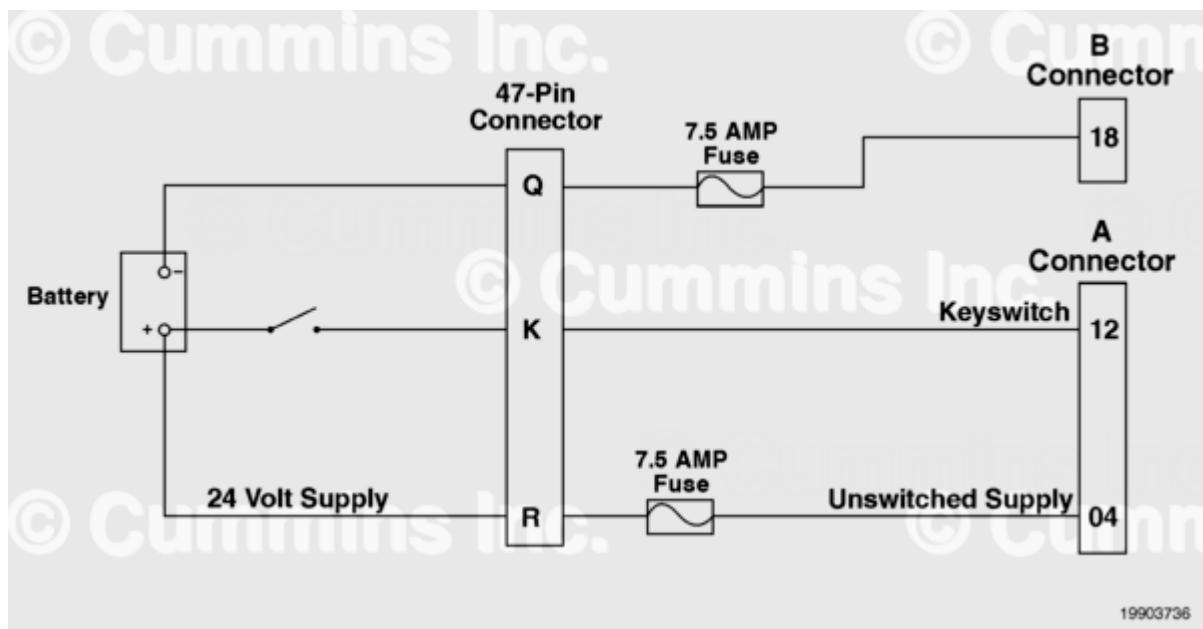

Power Supply Circuit

Circuit Description

The engine control module (ECM) receives constant voltage from the batteries through the ECM power wires that are connected through the original equipment manufacturer (OEM) harness. There is a 30 ampere fuse in the OEM harness to protect the harness from overheating. The ECM receives switched battery input through the keyswitch input when the ignition is turned ON. The ECM and inline module return wires are also connected through the OEM harness.

Component Location

The ECM is connected to the battery by the OEM power harness through the ECM battery supply stub. This provides a constant power supply for the ECM. The location of the battery will vary with the OEM. Refer to the equipment manufacturer service information.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the engine is running.

Conditions For Setting The Fault Codes

The ECM was **not** able to complete the power down routine correctly after keyswitch was turned OFF.

Action Taken When The Fault Code Is Active

The ECM will **not** be able to store updates to power down parameters such as customer selectable trims or fuel system tables.

Conditions For Clearing The Fault Code

To validate the repair, start the engine and let it idle for 1 minute.

- The fault code state will become inactive immediately after the ECM has properly powered down.
- The fault code can also be cleared with INSITE™ electronic service tool.

Shoptalk

If a battery disconnect switch is turned OFF after the keyswitch is turned OFF, but before the ECM completely powers down (up to 30 seconds), this fault code can register.

Refer to Troubleshooting Fault Code 1117. (</qs3/pubsys2/xml/en/procedures/81/81-t05-1117.html>)