


Fault Code: 412

SAE J1587/J1922 Datalink - Data Erratic, Intermittent, or Incorrect

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 412 PID(P): S250 SPN: FMI: 3 Lamp: On SRT: 00-632	Data erratic, intermittent, or incorrect data detected on the J1587/1922 data link.	None.

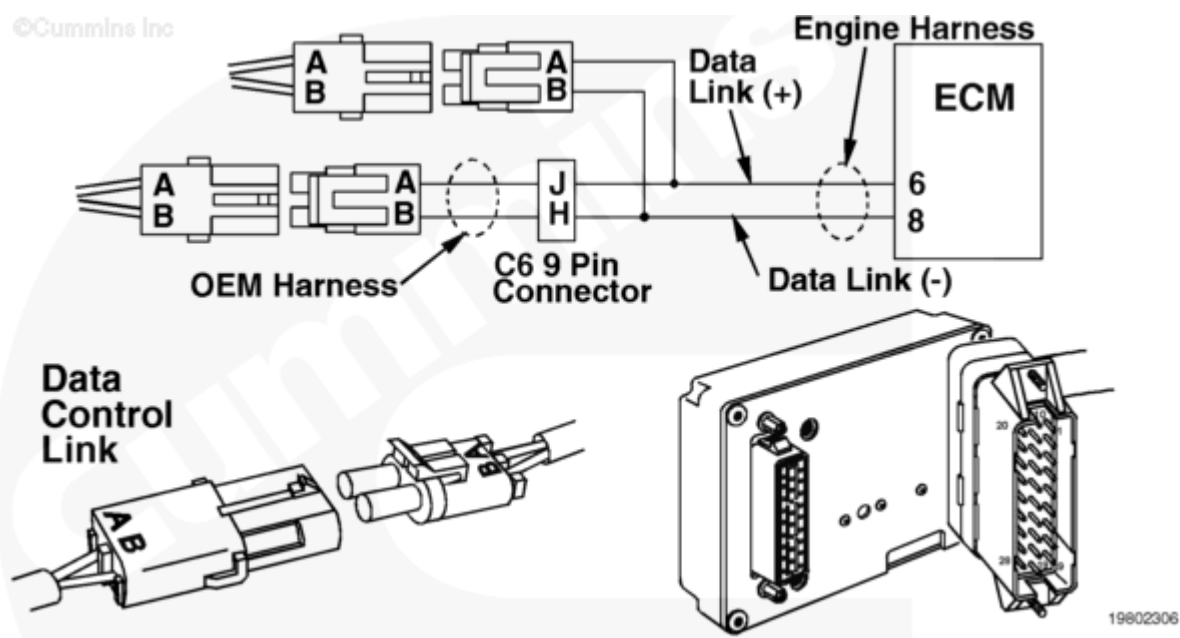

Datalink Circuit

Circuit Description

The J1587/1922 data link is a public data link that broadcasts engine operating data as well as fault codes.

Component Location

The J1587/1922 datalink is located in the engine wiring harness between the ECM and the datalink connectors.

Conditions For Running The Diagnostics

This diagnostic runs continuously when the keyswitch is in the ON position.

Conditions For Setting The Fault Codes

The Engine Control Module (ECM) has detected that the J1587/1992 datalink communication is erratic.

Action Taken When The Fault Code Is Active

- The ECM logs the fault code immediately when the diagnostic runs and fails.

For Power Generation Applications:

- The generator set controller displays the fault immediately when the diagnostics runs and fails.

Conditions For Clearing The Fault Code

- Turn the keyswitch OFF. Allow the ECM to completely power down and turn the keyswitch ON.
- The fault code status displayed by the recommended Cummins® electronic service tool or equivalent will change to INACTIVE immediately after the diagnostic runs and passes.
- The “Reset All Faults” command in the recommended Cummins® electronic service tool or equivalent can be used to clear active and inactive faults.

For Power Generation Applications:

- To validate the repair, start the engine and let it run for 1 minute at no load.
- The generator set controller will turn off the fault code immediately after the user presses reset.
- The “Reset All Faults” command in the recommended Cummins® electronic service tool or equivalent can be used to clear active faults.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged engine wiring harness.
- Malfunctioning or damaged OEM wiring harness.
- Damaged or loose connections.

Refer to Troubleshooting Fault Code t05-412 (/qs3/pubsys2/xml/en/procedures/98/98-t05-412.html)

Last Modified: 10-Sep-2021
