



Technical Service Bulletin

Technical Service Bulletin: TSB110028

Released Date: 27-Jan-2011

STC, HVT Tappet Assemblies and Rebuild Kits (T381)

STC, HVT Tappet Assemblies and Rebuild Kits (T381)

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document was originally released between 1994 and 2001. It has been added to QSOL for informational purposes

This document contains all current information on tappet assembly part numbers for the new "mushroom" design. This new STC tappet design was implemented for increased durability. Eleven different STC/HVT tappet assemblies that have been produced by Cummins and ReCon® have been superseded to 2 current part numbers (See Table 1).

Table 1: Tappet Assemblies

STC/HVT Tappet Assembly Part No.	Tappet Description	Engine Model	Tappet Rebuild Kit	New Tappet Assembly Part No.	ReCon "Mushroom" Tappet Part No. Assembly No.
3027405	Non-Flanged (Thin)	K/KV	None	3075381	3075381
3050341	Flanged (Thin)	NTTA-450	None	3075381	3075381
3053774	Top Stop (Thin)	NBC-IV	None	3075381	3075381
3055747	Grooved (Thin)	NT and K/KV	None	3075381	3075381
3055747	Noise Fixed (Thin)	NT and K/KV	None	3075381	3075381

STC/HVT Tappet Assembly Part No.	Tappet Description	Engine Model	Tappet Rebuild Kit	New Tappet Assembly Part No.	ReCon "Mushroom" Tappet Part No. Assembly No.
3066710	1991 L10 LP1 (Thin)	91L10 Only	None	3075383	3075383
3069701	1991 STC (Thin)	91 N14 and L10	None	3075383	3075383
3075381	Pre-91 (Mushroom Design)	NT and K/KV	3804700	None	3075381
3075383	1991 STC (Mushroom Design)	91 N14 and L10	3804700	None	3075383
3604618	Top Stop (Thick)	N and K/KV	3804700	3075381	3078531
3652737	1991 L10 LP1 (Thick)	1991 L10 Only	3804700	3075383	3075383


All thin socket assemblies/kits have a lower durability and can **not** be rebuilt with the new mushroom kit, Part No. 3804700. All thin socket kits and assemblies are obsoleted.

The fiel has the option of purchasing ReCon® rebuilt mushroom tappets to replace the thin design as shown above.

Thick socket rebuild kits are obsoleted, but they can be rebuilt with the new mushroom kit, Part No. 3804700.


All current production engine models with STC, HVT tappet assemblies have the current "mushroom" tappet design.

Tappet Physcial Descriptions

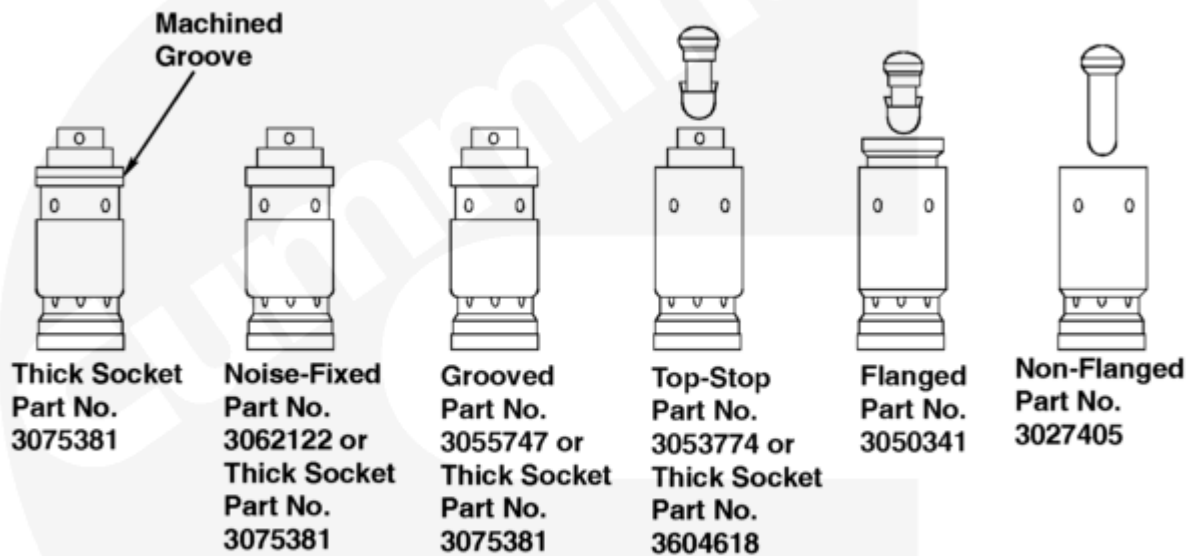


94T4001

Figure 1. Pre-1991 Tappets

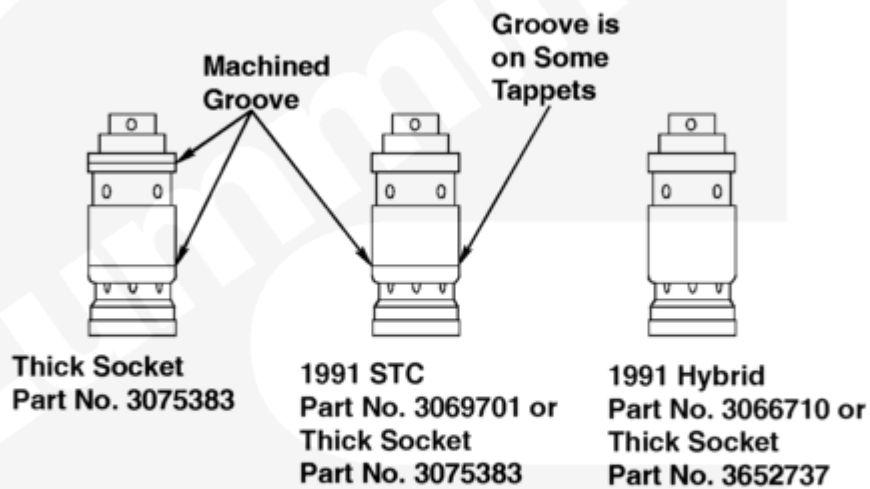


94T4002

Figure 2. 1991 Tappets

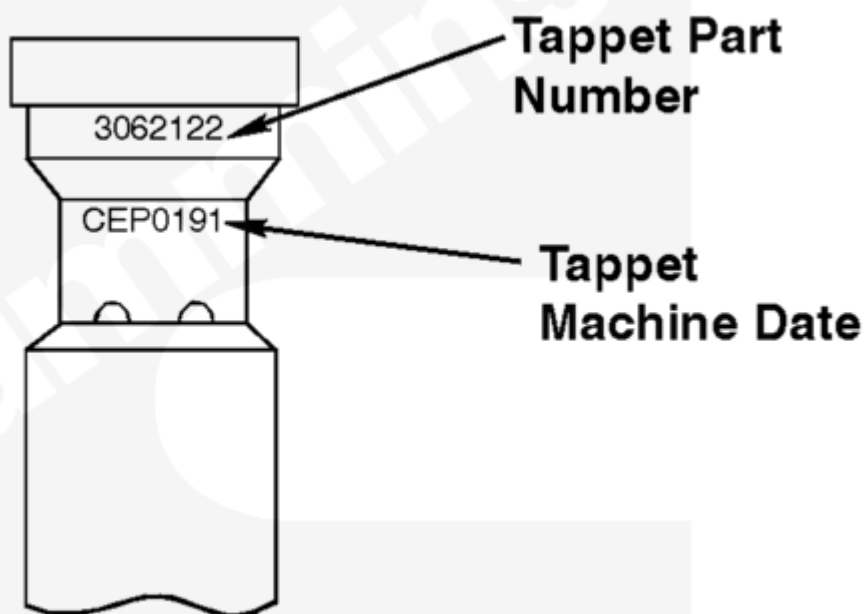


94T4003

Figure 3. Production Tappet Part No. Location

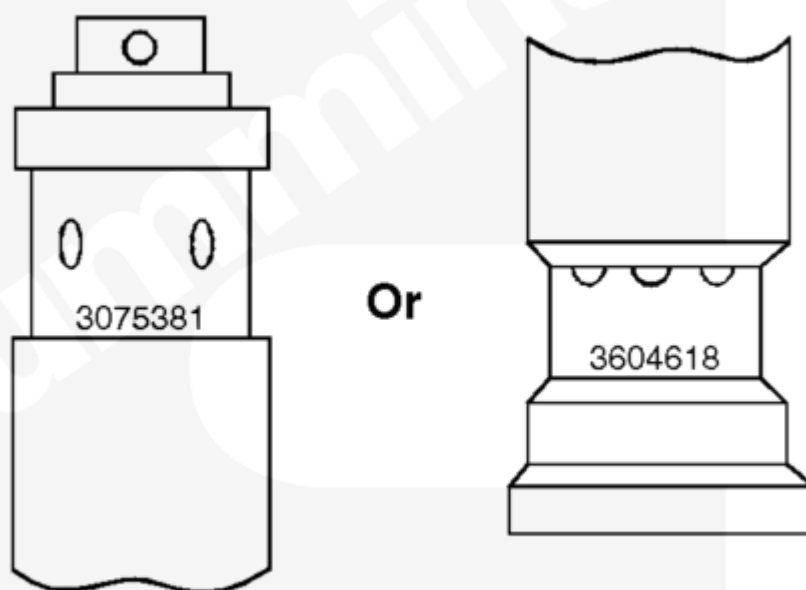


94T4004

Figure 4. ReCon® Tappet Part No. Location

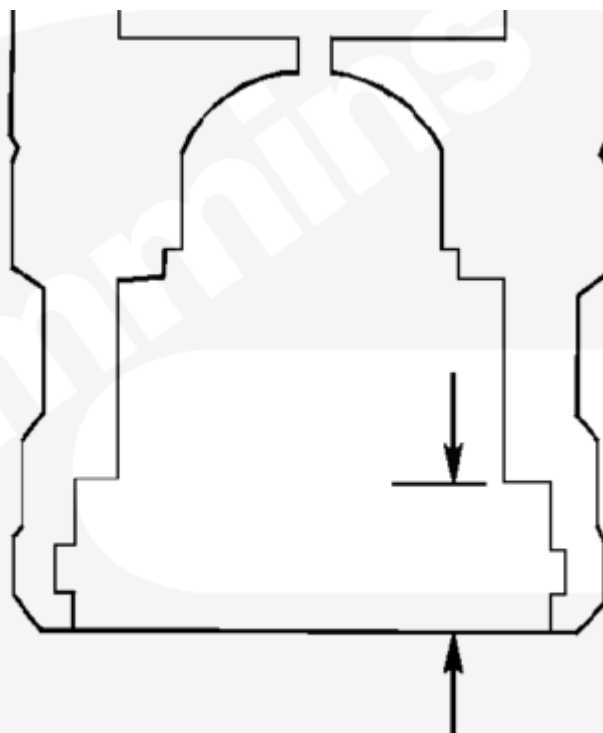

94t4006

Figure 5. Thick Socket Tappet

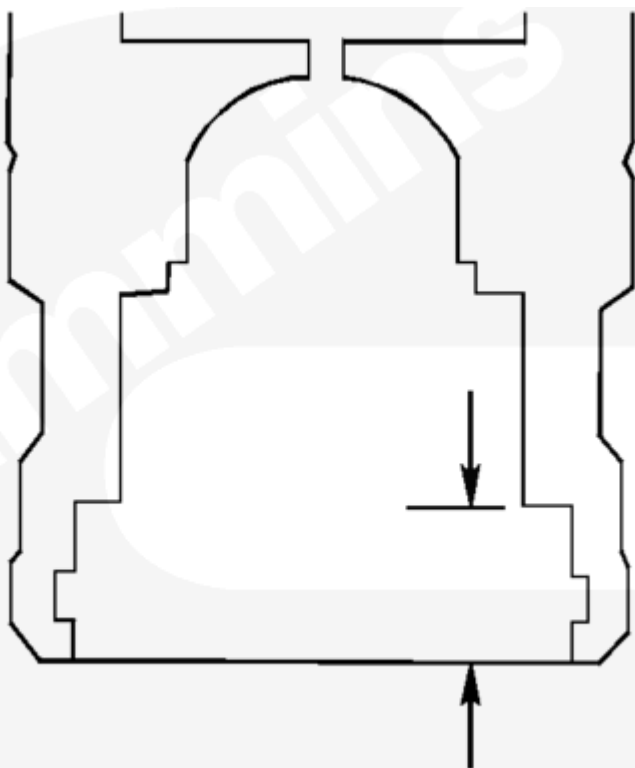

94t4007

Figure 6. Thin Socket Tappet

Table 2: STV/HVT Injector and Tappet Assembly Compatibility Matrix

Injector Assembly	Original Tappet	Original Tappet	Current Tappet	ReCon® Tappet
Part No.	Type	Part No.	Part No.	Part No.
3036444	Thin Socket	3055747	*1	-
3045816	Thin Socket	3055747	*1	-
3052226	Thin Socket	3027405	3075381	-
3052228	Thin Socket	3050341	*1	-
305206	Thin Socket	3027405	3075381	*1
3053764	Thin Socket	3053774	*1	-
3053766	Thin Socket	3053774	*1	-
3053767	Thin Socket	3053774	*1	-
3056495	Thin Socket	3055747	*1	-
3058800	Thin Socket	3055747	*1	*1
3058802	Thin Socket	3055747	*1	*1
3058852	Thin Socket	3055747	*1	-
3059255	Thin Socket	3055747	*1	-
3059257	Thin Socket	3055747	*1	-
3059458	Thin Socket	3055747	*1	-
3059923	Thin Socket	3055747	*1	-
3059925	Thin Socket	3055747	*1	-
3059927	Thin Socket	3055747	*1	-
3059960	Thin Socket	3055747	*1	-
3060410	Thin Socket	3050341	*1	-
3060594	Thin Socket	3055747	*1	-
3052092	Thin Socket	3055747	*1	*1
3062147	Thin Socket	3062122	*1	-
3062148	Thin Socket	3062122	*1	-
3062149	Thin Socket	3062122	*1	-
3062150	Thin Socket	3062122	*1	-
3062151	Thin Socket	3062122	*1	-
3062152	Thin Socket	3062122	*1	-
3062153	Thin Socket	3062122	3075381	3075381
3062611	Thin Socket	3062122	*1	-
3063228	Thin Socket	3062122	*1	-
3064457	Thin Socket	3062122	*1	-
3065349	Thin Socket	3062122	*1	-

Table 2: STV/HVT Injector and Tappet Assembly Compatibility Matrix

3065350	Thin Socket	3062122	*1	-
3066915	Thin Socket	3062122	*1	-
3067393	Thin Socket	3062122	*1	-
3067403	Thin Socket	3062122	*1	-
3068086	Thin Socket	3066710	-	-
3068824	Thin Socket	3062122	3075381	3075381
3068824	Thin Socket	3062122	3075381	3075381
3068825	Thin Socket	3062122	3075381	3075381
3068826	Thin Socket	3062122	3075381	3075381
3068899	Thin Socket	3062122	3075381	3075381
3070178	Thin Socket	3062122	3075381	3075381
3070421	Thin Socket	3069701	*2	-
3070422	Thin Socket	3069701	*2	-
3070649	Thin Socket	3062122	3075381	3075381
3071491	Thin Socket	3062122	3075381	3075381
3071492	Thin Socket	3062122	3075381	3075381
3071494	Thin Socket	3062122	3075381	3075381
3071497	Thin Socket	3062122	3075381	3075381
3071498	Thin Socket	3062122	3075381	3075381
3071499	Thin Socket	3062122	3075381	3075381
3071500	Thin Socket	3062122	3075381	3075381
3071565	Thin Socket	3069701	*2	-
3072029	Thin Socket	3066710	-	3652737
3072030	Thin Socket	3066710	-	3652737
3073569	Thin Socket	3069701	*2	*2
3073571	Thin Socket	3069701	*2	*2
3073572	Thin Socket	3069701	*2	*2
3073574	Thin Socket	3069701	*2	*2
3074250	Thin Socket	3069701	3075383	3075383
3074251	Thin Socket	3069701	3075383	3075383
3074252	Thin Socket	3069701	3075383	3075383
3074319	Thin Socket	3069701	3075383	3075383
3075343	Thin Socket	3062122	3075381	3075381
3075447	Thin Socket	3062122	3075383	3075383
3076034	Thick Socket	3075383	3075383	3075383
3076050	Thick Socket	3075383	3075383	3075383

Table 2: STV/HVT Injector and Tappet Assembly Compatibility Matrix

3076130	Thick Socket	3075381	3075381	-
3076132	Thicket Socket	3075381	3075381	-
3076133	Thick Socket	3075381	3075381	-
3076134	Thick Socket	3075381	3075381	-
3076700	Thick Socket	3075381	3075381	-
3076702	Thick Socket	3075381	3075381	-
3076703	Thick Socket	3075381	3075381	-
3076704	Thick Socket	3075381	3075381	-
3077714	Thick Socket	3075381	3075381	-
3077715	Thick Socket	3075381	3075381	-
3077718	Thick Socket	3075381	3075381	3075381
3078194	Thick Socket	3075383	3075383	3075383
3078195	Thick Socket	3075383	3075383	3075383
3078196	Thick Socket	3075383	3075383	3075383
3078197	Thick Socket	3075383	3075383	3075383
3078198	Thick Socket	3075383	3075383	3075383
3078206	Thick Socket	3075383	3075383	3075383
3079669	Thick Socket	3075381	3075381	3075381
3079946	Thick Socket	3075381	3075381	3075381
3079947	Thick Socket	3075381	3075381	3075381
3083764	Thick Socket	3075383	3075383	3075383
3279719	Thin Socket	3062122	*1	-
3729777	Thin Socket	3062122	*1	-
3279830	Thin Socket	3062122	3075381	3075381
3279847	Thin Socket	3062122	*1	-
3627922	Thick Socket	3075381	3075381	-
3652513PX	Thick Socket	-	-	3075381
3652514PX	Thick Socket	-	-	3075381
3652515PX	Thick Socket	-	-	3075381

***Notes:**

1. These injector assemblies are obsolete in production, at ReCon®, or both. However, when servicing those injectors that still exist in the field, use any of the Pre-1991 tappets listed for that assembly, or tappet Part No. 3075381.


2. These injector assemblies are obsolete in production, at ReCon®, or both. However, when servicing those injectors that still exist in the field, use any of the 1991 tappets listed for that assembly, or tappet, Part No. 3075383.

Note : Tappet Part Nos 3053774, and 3604618 must be used with top stop screw, Part No. 3053771, or poor engine performance will result.

Tappet Rebuild Kit Information

The following shows the rebuild kit that has been obsoleted.

©Cummins Inc

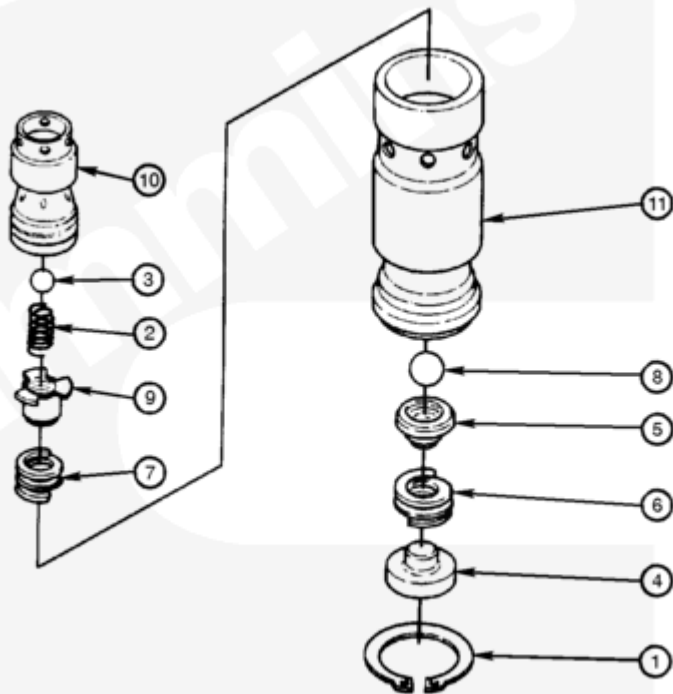

94T4005

Figure 7. ObsoletedTappet Rebuild Kit

Table 3: Obsoleted STC Injector Tappet Repair Kit

Item No.	Description
1	Retaining Ring
2	Plunger Check Ball Spring
3	Inlet Check Ball
4	Tappet Socket
5	Sleeve Spring Guide
6	Sleeve Spring
7	Plunger Spring
8	Sleeve Check Ball
9	Plunger Spring Guide
10	Tappet Plunger
11	Tappet Sleeve

Below is information on the parts that make up the current tappet rebuild kit. There is only 1 tappet rebuild kit available. The tappet rebuild kit, Part No. 3804700, contains the new "mushroom" socket and will work with **only** the thick style sockets. Thin style sockets can **not** be rebuilt and **must** be replaced.

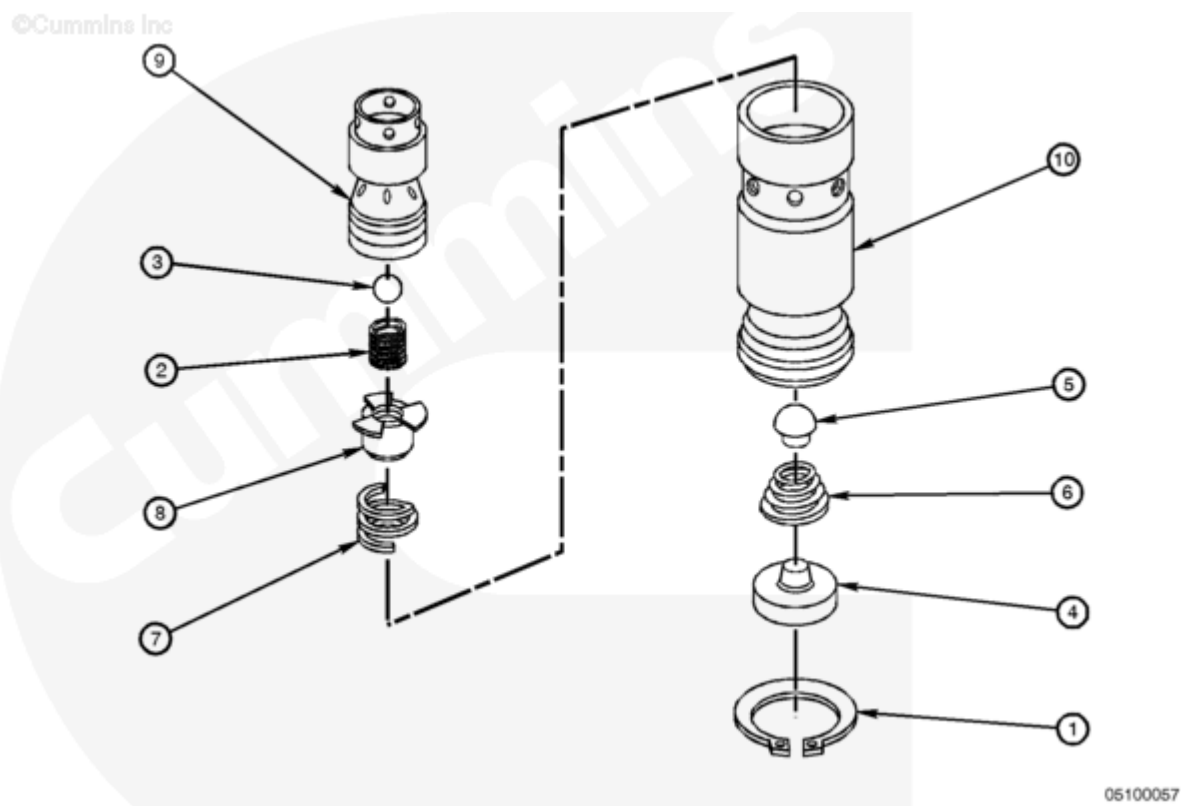


Figure 8. Current STC Injector Tappet Parts

Table 4: Current STC Injector Tappet Repair Kit

Item No.	Description	Part No.
1	Retaining Ring	3027988
2	Plunger Check Ball Spring	3027994
3	Inlet Check Ball	3027996
4	Tappet Socket	3085345
5	Sleeve Spring Guide	3085344
6	Sleeve Spring	3085343
7	Plunger Spring	3054852*
8	Plunger Spring Guide	3076033*
9	Tappet Plunger	-
10	Tappet Sleeve	-

* These parts are also available individually.

Document History

Date	Details
2011-1-21	Module Created

Last Modified: 27-Jan-2011
