



Technical Service Bulletin

Technical Service Bulletin: TSB110143

Released Date: 10-May-2011

STC, HVT Tappet Assemblies and Rebuild Kits (1224)

STC, HVT Tappet Assemblies and Rebuild Kits (1224)

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document was originally released between 1994 and 2001. It has been added to QSOI for informational purposes

This document contains all of the current information on New and ReCon® STC/HVT tappet assembly part numbers, physical descriptions, compatibility matrix, and tappet rebuild kit information. Desregard all STC/HVT tappet information in the following Service Parts Topics: 86T6-5, 86T6-5A, 87T6-7, 87T6-11, 88T6-4, 88T6-4A, 88T6-8, 88T6-9, 89T6-9A, 90T6-5, 91T6-5, and 93T6-2, topic except the rebuild guidelines in SPT 91T6-11.

STC/HVT Tappet Assemblies

There are 11 different STV/HVT tappet assemblies that have been produced by Cummins Engine Company and Diesel ReCon®. Table 1 lists the important information for each of these assemblies. Refer to Figure 1 and Figure 2 for tappet physical descriptions.

Table 1: STC/HVT Tappet Assembly Information

STC/HVT Tappet Assembly Part No.	Tappet Description	Engine Model	Tappet Rebuild Kit	Superseding Tappet Assembly Part No.	ReCon® Thick Socket Tappet* Part No.
3027405	Non-flanged	K/KV	None	3055747	None
3050341	Flanged	NTTA-450	3803101	3053774	None
3053774	Top-Stop	NBC-IV	3803101	3055747	3604618
3055747	Grooved	NT & K/KV	3803101	3062122	3075381
3062122	Noise Fixed	NT & K/KV	3803101	3075381	3075381
3066710	1991 L10 LP1	91 L10 Only	3803101	None	3652737


Table 1: STC/HVT Tappet Assembly Information

3069701	1991 STC	91 N14 & L10	3803101	3075383	3075383
3075381	Pre-1991 Thick Socket	NT & K/KV	3803497	None	None
3075383	1991 STC Thick Socket	91 N14 & L10	3803497	None	None
3604618*	Top-Stop Thick Socket	NT & K/KV	3803497	None	None
3652737	1991 L10 LP1 Thick Socket	91 L10 Only	3803497	None	None


*ReCon® Machined tappets to accept thick socket hardware. These tappets are **only** used in ReCon® remanufactured STC injectors. Refer to Figure 4: ReCon® Tappet Part No. Location.

Tappet Physical Descriptions

©Cummins Inc

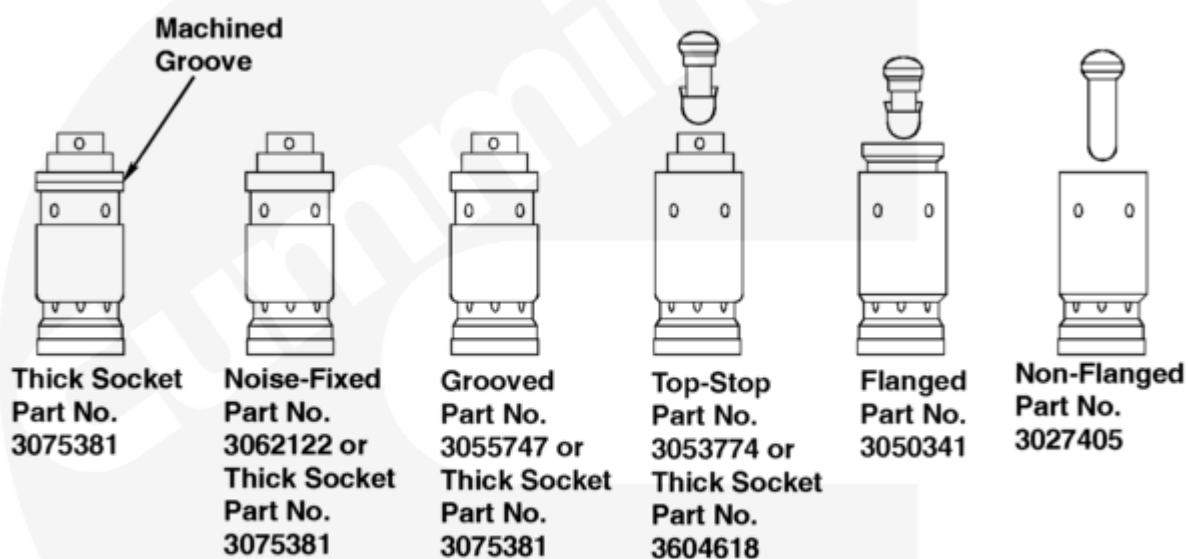


94T4001

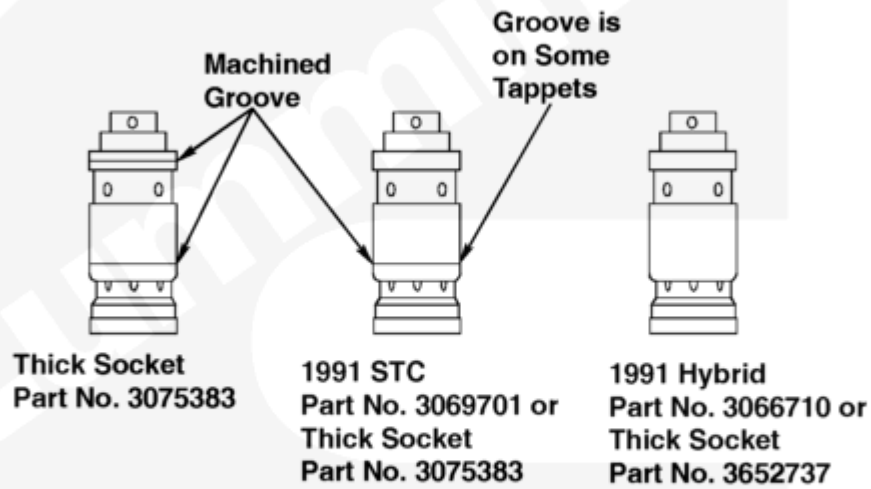


94T4002

Figure 2: 1991 Tappets

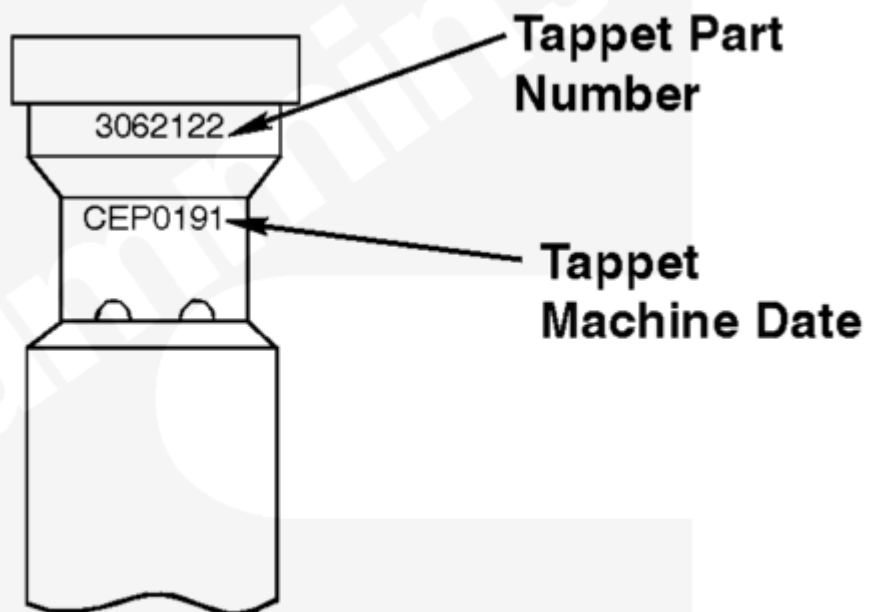

94T4003

Figure 3: Production Tappet Part No. Location

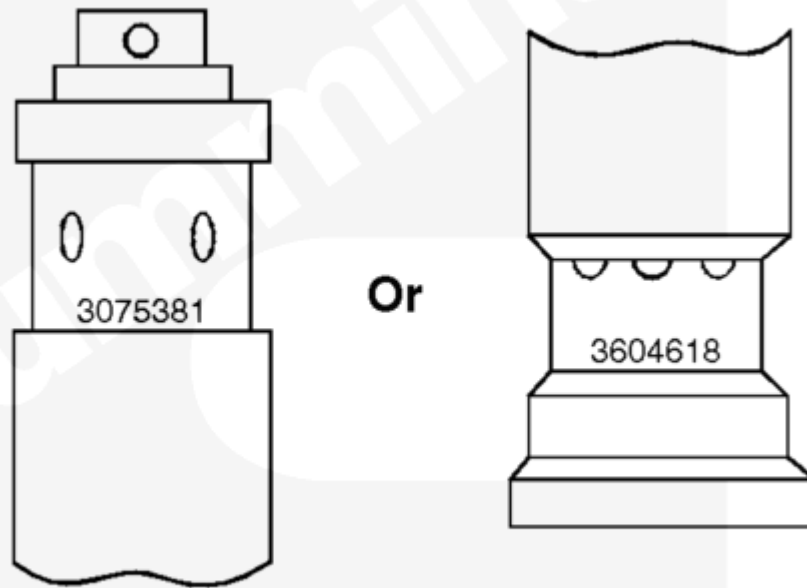

94T4004

Figure 4: ReCon Tappet Part No. Location

Table 2: STC/HVT Injector and Tappet Assembly Compatibility Matrix

Injector Assembly Part No.	Original Tappet Type	Original Tappet Part No.	Current Tappet Part No.	ReCon® Tappet Part No.
3036444	Thin Socket	3055747	*1	-
3045816	Thin Socket	3055747	*1	-
3052226	Thin Socket	3027405	3075381	-
3052228	Thin Socket	3050341	*1	-
3053206	Thin Socket	3027405	3075381	*1
3053764	Thin Socket	3053774	*1	-
3053766	Thin Socket	3053774	*1	-
3053767	Thin Socket	3053774	*1	-
3056495	Thin Socket	3055747	*1	-
3058800	Thin Socket	3055747	*1	*1
3058802	Thin Socket	3055747	*1	*1
3058852	Thin Socket	3055747	*1	-
3059255	Thin Socket	3055747	*1	-
3059257	Thin Socket	3055747	*1	-
3059458	Thin Socket	3055747	*1	-
3059923	Thin Socket	3055747	*1	-
3059925	Thin Socket	3055747	*1	-

Table 2: STC/HVT Injector and Tappet Assembly Compatibility Matrix

3059927	Thin Socket	3055747	*1	-
3059960	Thin Socket	3055747	*1	-
3060410	Thin Socket	3050341	*1	-
3060594	Thin Socket	3055747	*1	-
3062092	Thin Socket	3055747	*1	*1
3062147	Thin Socket	3062122	*1	-
3062148	Thin Socket	3062122	*1	-
3062149	Thin Socket	3062122	*1	-
3062150	Thin Socket	3062122	*1	-
3062151	Thin Socket	3062122	*1	-
3062152	Thin Socket	3062122	*1	-
3062153	Thin Socket	3062122	3075381	3075381 or 3604618
3062611	Thin Socket	3062122	*1	-
3063228	Thin Socket	3062122	*1	-
3064457	Thin Socket	3062122	*1	-
3065349	Thin Socket	3062122	*1	-
3065350	Thin Socket	3062122	*1	-
3066915	Thin Socket	3062122	*1	-
3067393	Thin Socket	3062122	*1	-
3067403	Thin Socket	3062122	*1	-
3068086	Thin Socket	3066710	-	-
3068824	Thin Socket	3062122	3075381	3075381 or 3604618
3068825	Thin Socket	3062122	3075381	3075381 or 3604618
3068826	Thin Socket	3062122	3075381	3075381 or 3604618
3068899	Thin Socket	3062122	3075381	3075381 or 3604618
3070178	Thin Socket	3062122	3075381	3075381 or 3604618
3070421	Thin Socket	3059701	*2	-
3070422	Thin Socket	3069701	*2	-
3070649	Thin Socket	3062122	3075381	3075381 or 3604618
3071491	Thin Socket	3062122	3075381	3075381 or 3604618

Table 2: STC/HVT Injector and Tappet Assembly Compatibility Matrix

3071492	Thin socket	3062122	3075381	3075381 or 3604618
3071494	Thin Socket	3062122	3075381	3075381 or 3604618
3071497	Thin Socket	3062122	3075381	3075381 or 3604618
3071498	Thin Socket	3062122	3075381	3075381 or 3604618
3071499	Thin Socket	3062122	3075381	3075381 or 3604618
3071500	Thin Socket	3062122	3075381	3075381 or 3604618
3071565	Thin Socket	3069701	*2	-
3072029	Thin Socket	3066710	-	3652737
3072030	Thin Socket	3066710	-	3652737
3073569	Thin Socket	3069701	*2	*2
3073571	Thin Socket	3069701	*2	*2
3073572	Thin Socket	3069701	*2	*2
3073574	Thin Socket	3069701	*2	*2
3074250	Thin Socket	3069701	3075383	3075383
3074251	Thin Socket	3069701	3075383	3075383
3074252	Thin Socket	3069701	3075383	3075383
3074319	Thin Socket	3069701	3075383	3075383
3075343	Thin Socket	3062122	3075381	3075381 or 3604618
3075447	Thin Socket	3062122	3075381	3075381 or 3604618
3076034	Thick Socket	3075383	3075383	3075383
3076050	Thick Socket	3075383	3075383	3075383
3076130	Thick Socket	3075381	3075381	-
3076132	Thick Socket	3075381	3075381	-
3076132	Thick Socket	3075381	3075381	-
3076134	Thick Socket	3075381	3075381	-
3076700	Thick Socket	3075381	3075381	-
3076702	Thick Socket	3075381	3075381	-
3076703	Thick Socket	3075381	3075381	-
3076704	Thick Socket	3075381	3075381	-
3077714	Thick Socket	3075381	3075381	-

Table 2: STC/HVT Injector and Tappet Assembly Compatibility Matrix

3077715	Thick Socket	3075381	3075381	-
3077718	Thick Socket	3075381	3075381	3075381 or 3604618
3078194	Thick Socket	3075383	3075383	3075383
3078195	Thick Socket	3075383	3075383	3075383
3078196	Thick Socket	3075383	3075383	3075383
3078197	Thick Socket	3075383	3075383	3075383
3078198	Thick Socket	3075383	3075383	3075383
3078206	Thick Socket	3075383	3075383	3075383
3079669	Thick Socket	3075381	3075381	3075381 or 3604618
3079946	Thick Socket	3075381	3075381	3075381 or 3604618
3079947	Thick Socket	3075381	3075381	3075381 or 3604618
3083765	Thick Socket	3075383	3075383	3075383
3279719	Thin Socket	3062122	*1	-
3729777	Thin Socket	3062122	*1	-
3279830	Thin Socket	3062122	3075381	3075381 or 3604618
3279847	Thin Socket	3062122	*1	-
3627922	Thick Socket	3075381	3075381	-
3652513PX	Thick Socket	-	-	3075381 or 3604618
3652514PX	Thick Socket	-	-	3075381 or 3604618
3652515PX	Thick Socket	-	-	3075381 or 3604618

Note : These injector assemblies are obsolete in product, at ReCon®, or both. However, when servicing those injectors that still exist in the field, use any of the Pre-1991 tappets listed for that assembly, or tappet Part No. 3075381.

Note : These injector assemblies are obsolete in production, at ReCon®, or both. However, when servicing those injectors that still exist in the field, use any of the 1991 tappets listed for that assembly, or tappet Part No. 3075383.

⚠ CAUTION ⚠

Tappet Part Nos. 3053774 and 3604618 MUST be used with top stop screw Part No. 3053771 or poor engine performance will result.


Tappet Rebuild Kit Information

Below is information on the parts that make up a tappet rebuild kit. There are 3 different tappet rebuild kits. Two kits Part Nos. 3801688 and 3803101, are for thin socket tappets. The other kit, Part No. 3803497, is for thick socket tappets. Refer to Figure 5: STC Injector Tappet Parts and Table 3: STC Injector Tappet Repair Kits.

⚠ CAUTION ⚠

Do NOT use tappet rebuild kit Part No. 3801688 or 3803101, to rebuild any Thick Socket tappet or severe engine damage will occur.

©Cummins Inc

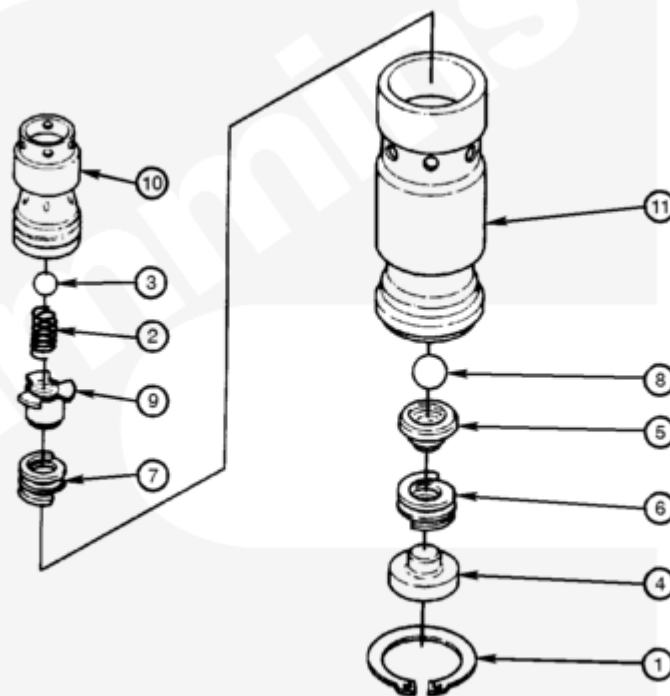

94T4005

Figure 5: STC Injector Tappet Parts

Table 3: STC Injector Repair Kits

Item No.	Description	Thin Socket Kit Part No. 3801688	Thin Socket Kit Part No. 3803101	Thick Socket Kit Part No. 3803497
1	Retaining Ring	3027988	Same as in Kit 3801688	Same as in Kit 3801688
2	Plunger Check Ball Spring	3027994	Same as in kit 3801688	Same as in kit 3801688

Table 3: STC Injector Repair Kits

3	Inlet Check Ball	3027996	Same as in Kit 3801688	Same as in Kit 3801688
4	Tappet Socket	3031198	Same as in Kit 3801688	3075384
5	Sleeve Spring Guide	3050344*	Same as in Kit 3801688	3075385*
6	Sleeve Spring	3050345*	Same as in Kit 3801688	Same as in Kit 3801688
7	Plunger Spring	3054852*	Same as in Kit 3801688	Same as in Kit 3801688
8	Sleeve Check Ball	3050346	3062119	Same as in Kit 3803101
9	Plunger Spring Guide	3076033*	Same as in Kit 3801688	Same as in Kit 3801688
10	Tappet Plunger	-	-	-
11	Tappet Sleeve	-	-	-

* These parts are also available individually.

If a rebuild kit is required to replace a part, use the following procedure to select the correct tappet rebuild kit.

Table 4: Thick Socket Tappets**Tappet Part No.**

3075381


3075383

3604618

3652737


If the tappet part number is **not** one of the part numbers listed above, measure the depth of the socket seat. Refer to Figures 6 and 7 for details on measuring the depth of the socket seat.

Use Rebuild Kit, Part No. 3803497, if the socket seat depth is 0.281 ± 0.005 inches or use Rebuild Kit, Part No. 3803101, if the socket seat depth is $0.241 \pm$

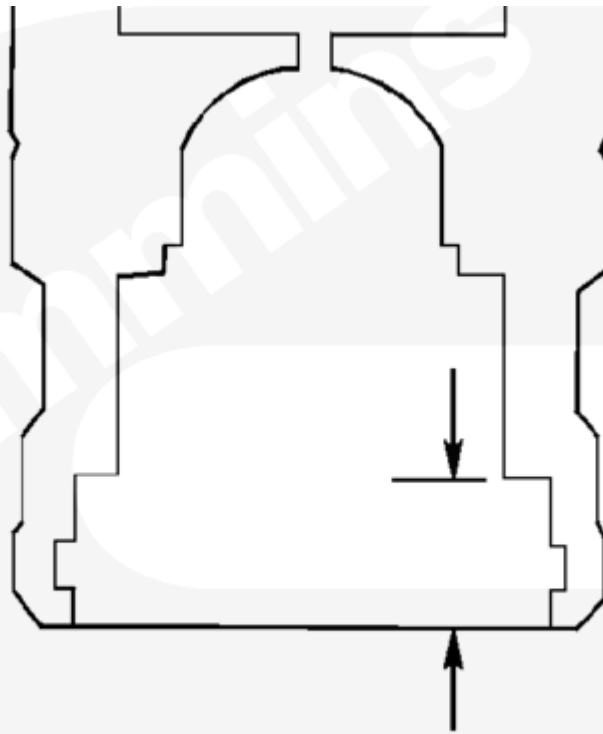

94t4006

Figure 6: Thick Socket Tappet

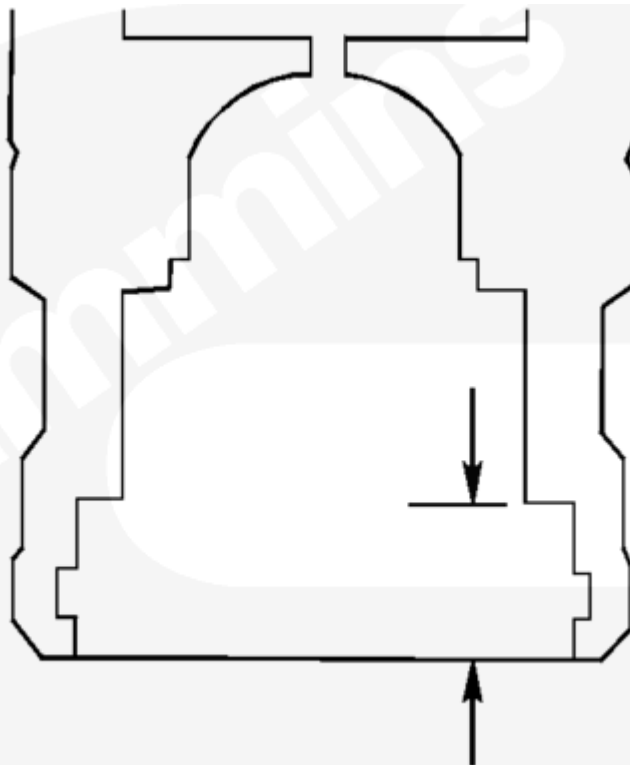

94t4007

Figure 7: Thin Socket Tappet

Date	Details
2011-5-9	Module Created

Last Modified: 10-May-2011
