


Fault Code: 121

Engine Speed Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 121 PID(P): P190 SPN: 190 FMI: 10 Lamp: Yellow SRT: 00-345	Engine Speed Sensor Circuit. No engine speed signal detected at one pair of pins, either pin 27, 28, 37, or 38 of the engine harness.	No action by the engine control module (ECM) is taken.

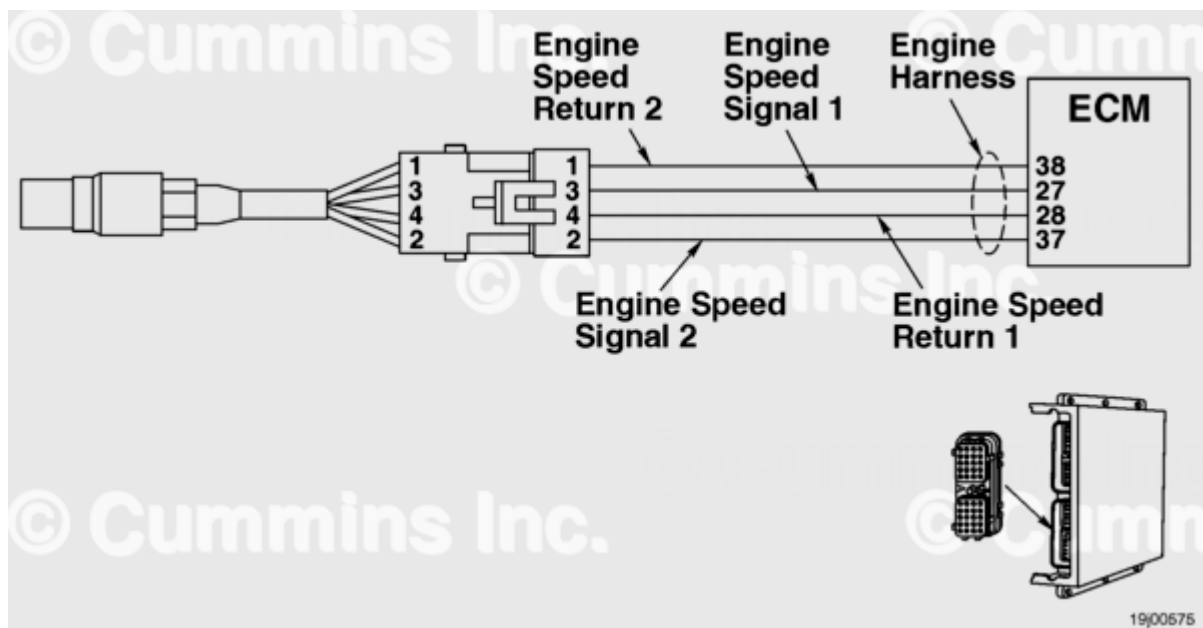

Engine Speed Sensor Circuit

Circuit Description

The engine speed sensor is a dual-coil circuit that provides the engine speed signal to the ECM through the engine harness.

Component Location

The engine speed sensor is located on the flywheel housing.

Shoptalk

- If the problem occurs **only** at a certain engine temperature, be sure to check the engine speed sensor circuit while the engine is at that particular temperature.
- Measure camshaft end clearance to make sure that camshaft gear is **not** moving too far away from the end of the engine speed sensor.

Refer to Troubleshooting Fault Code t05-121 (</qs3/pubsys2/xml/en/procedures/19/19-t05-121.html>)

Last Modified: 19-Dec-2024
