

Fault Code: 259


Fuel Shutoff Valve Stuck Open

 Printable Version

Overview


Codes	Reason	Effect
Fault Code: 259 PID(P): S17 SPN: 632 FMI: 7 Lamp: Red SRT: 00-396	Fuel shutoff valve is open and will not close.	No action by the engine control module (ECM) is taken.

©Cummins Inc

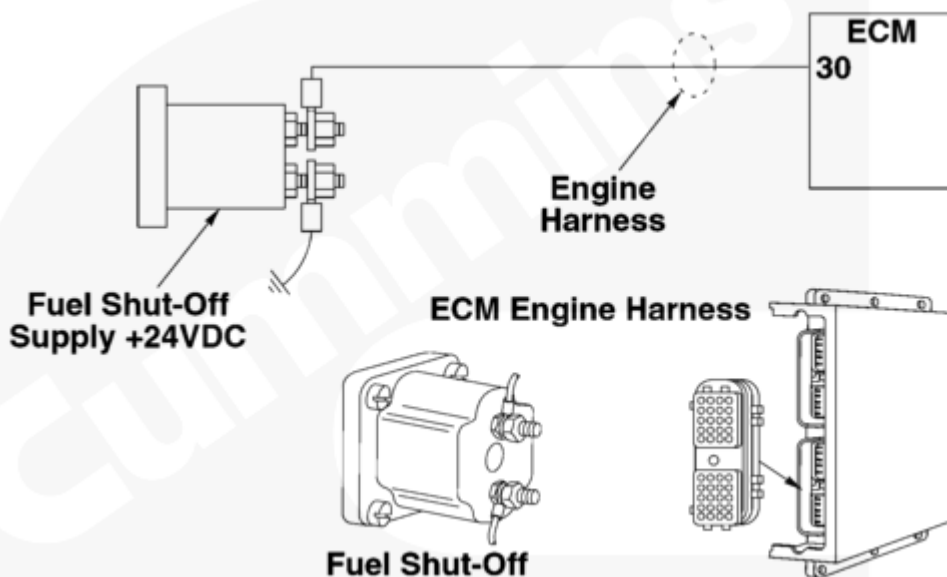

19400833

QSK19, QSK45, and QSK78 - Fuel Shutoff Solenoid Circuit

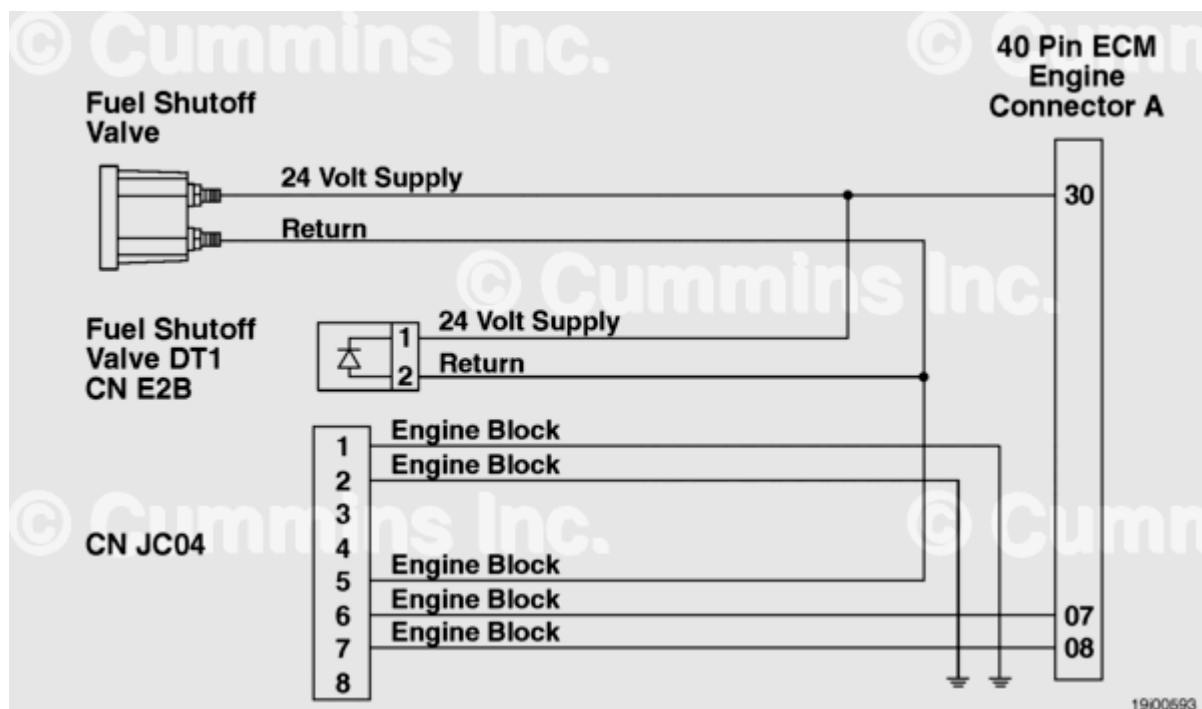

QSK23 - Fuel Shutoff Solenoid Circuit

Circuit Description

The fuel shutoff solenoid is a device used by the ECM to control the fuel supply to the rail fueling circuit. The ECM can shut down the engine by cutting off the power to the fuel shutoff solenoid.

Component Location

The fuel shutoff solenoid is located between the rail and timing actuators on the control valve body behind the ECM.

Shoptalk

- The fuel shutoff solenoid **only** stops fuel to the rail circuit; the timing circuit bypasses the fuel shutoff solenoid.
- Inspect the fuel shutoff supply circuit for external wires that can be spliced in to power another device. Remove any extra wires that are found in the circuit.
- If there is an external shutdown system on the vehicle that uses the fuel shutoff valve for engine shutdown, make sure it has **not** failed and lowered the voltage on the fuel shutoff circuit.
- Inspect the engine block-to-chassis ground wire to make sure it is securely fastened to a clean, dry surface.
- Check the starter solenoid positive (+) terminal for a loose connector and/or accessory wiring with damaged insulation.

Refer to Troubleshooting Fault Code t05-259 (/qs3/pubsys2/xml/en/procedures/19/19-t05-259.html)

Last Modified: 02-Jan-2017
