



Technical Service Bulletin: TSB220244

Released Date: 06-Dec-2022

Idler Pulley Bracket Installation for Option FA1611 and FA1608

Idler Pulley Bracket Installation for Option FA1611 and FA1608

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- ISX15 CM2250
- ISX15 CM2250 SN
- ISX15 CM2350 X101
- X15 CM2350 X114B
- X15 CM2350 X116B
- X15 CM2350 X123B
- X15 CM2350 X129B
- X15 CM2450 X124B
- X15 CM2450 X134B

Description of Change

Releasing a new idler pulley bracket mounting capscrew for options FA1611 and FA1608. The new capscrew will improve the joint robustness and allow the installation torque to be increased.

Reason for Change

The previous idler pulley bracket, part number 3688069, load column had a soft p-clip under the capscrew and insufficient thread engagement resulting in poor bolt load retention and risk of thread strip. This change moves the p-clip to an alternative location, increases thread engagement, and increases the capscrew grade to allow an increase in installation torque.

Service Instructions

- Remove and discard capscrews, Part Number 3901446, see Table 2.
- Relocate P-clip for breather tube options BR1774 or BR1775 from hole number 6 (seen in Figure 1) to hole number 3 (seen in Figure 2), according to the gear cover capscrew numbers displayed in Figure 3.
- Install capscrews, Part Number 3966976, see Table 2.

- Torque to 41 N•m [30 ft-lbs]

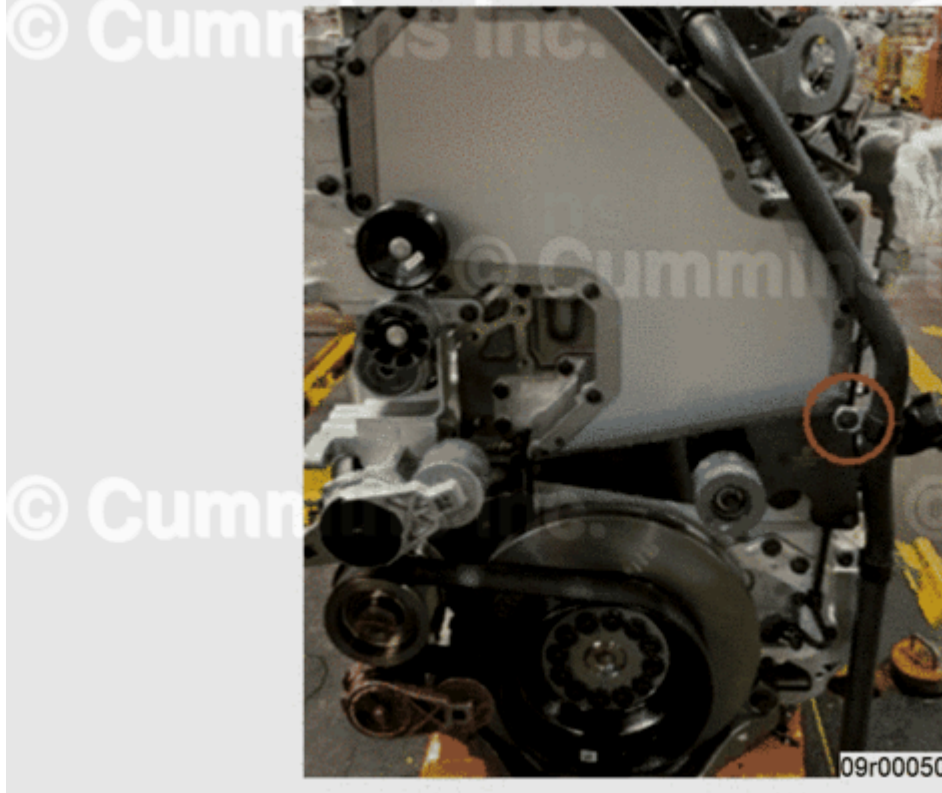


Figure 1, Existing P-clip Location.

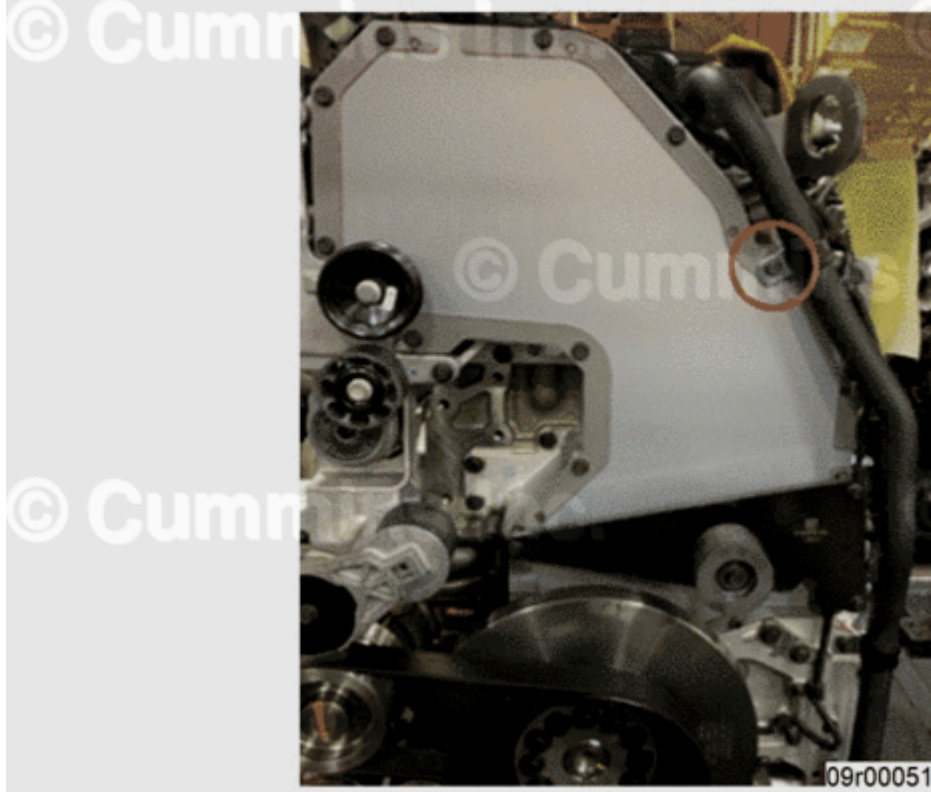


Figure 2, New P-clip Location.

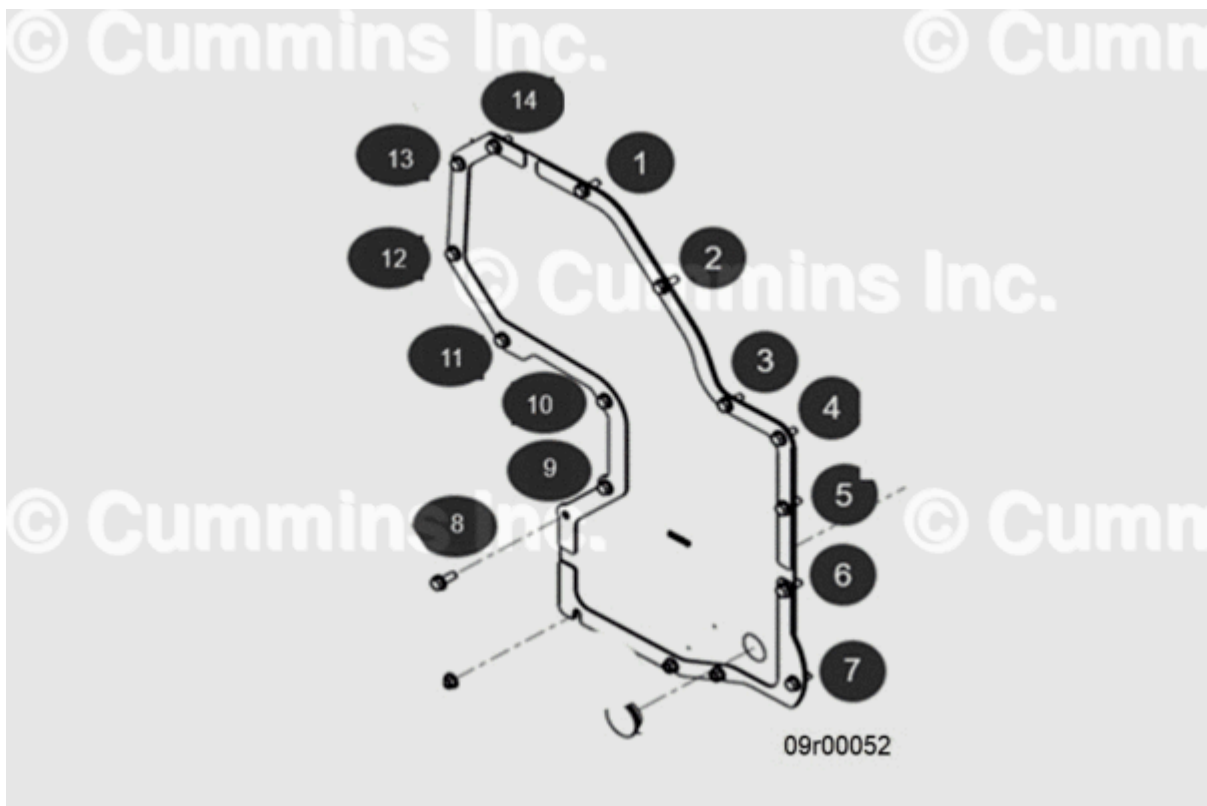


Figure 3, Gear Cover Capscrew Numbers.

Service Parts

Table 1, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
SCREW, HEX FLANGE HEAD CAP	3901446	No	No	3966976

Part Compatibility

Capscrew, Part Number 3901446, is **only** to be replaced using capscrew, Part Number 3966976, in options: FA1611 or FA1608.

Part Identification

Table 2, Difference Between Capscrew Part Numbers 3901446 and 3966976

	3901446 (Existing)	3966976 (New)
Length	60 mm [2.36 in]	65 mm [2.56 in]
Grade	9.8	10.9
Allowable Torque	31 N•m [23 ft-lbs]	41 N•m [30 ft-lbs]
Figure Number	4	5



Figure 4, Existing Capscrew, Part Number 3901446.



Figure 5, New Capscrew, Part Number 3966976.

Production Status

Implemented for production. See Table 3.

Table 3, Production Information

ESN First	Build Date ¹	Plant
80426197	9 May 2022	Jamestown Engine Plant
¹ Engine build date can be found on the engine dataplate.		

Publications Affected

Table 4, Publications Affected

Manual Type	Engine	Bulletin Number	Procedure Title	Procedure	Section
Service Manual	ISX15 CM2250	4022250	Fan Drive Idler Pulley Assembly	008-030	8
	ISX15 CM2250 SN	4310736			
	ISX15 CM2350 X101	4310641			
	X15 CM2350 X114B	5411181			
	X15 CM2350 X116B	5411186			
	X15 CM2350 X123B	5504510			
	X15 CM2350 X129B	5504557			
	X15 CM2450 X124B	5504583			
	X15 CM2450 X134B	5613373			

Document History

Date	Details
2022-12-1	Module Created

