


Fault Code: 1324

Analog Input Signal Circuit for Load Govern kVAR Setpoint - Voltage Above Normal or Shorted to High Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 1324 PID(P): SPN: FMI: Lamp: Warning SRT:	The analog input signal for the load governed kilovolt-ampere setpoint is shorted high.	No action is taken by the engine control module. Possible loss of performance.

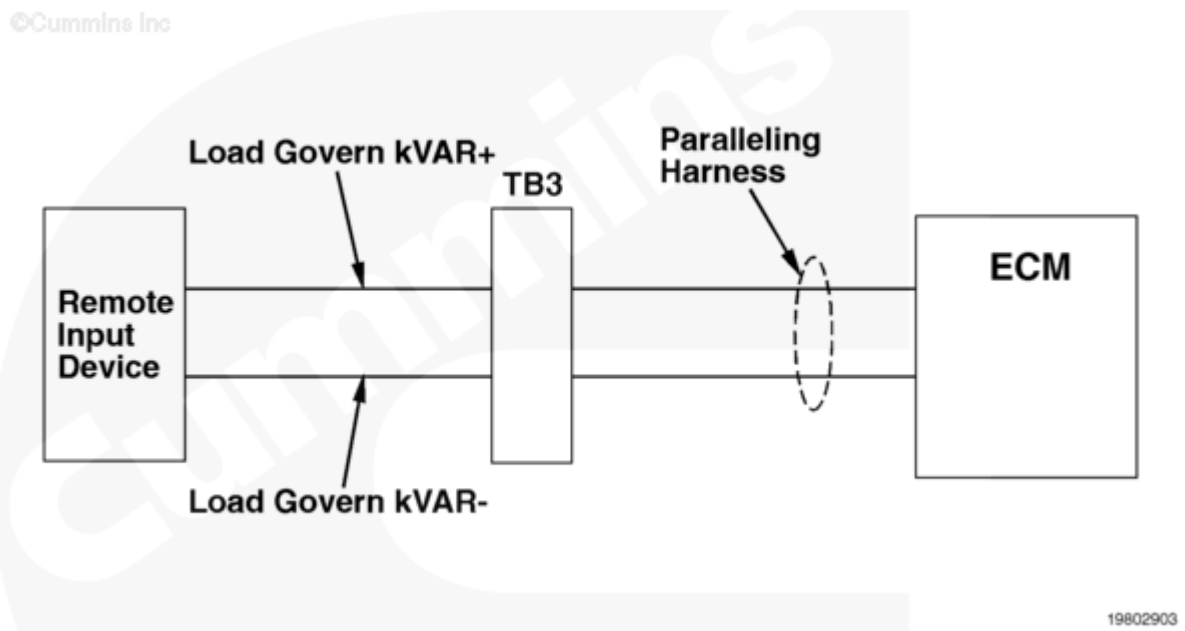

Load Govern Kilovolt-Ampere Setpoint - Remote Input Device Circuit

Circuit Description

The load govern kilovolt-ampere setpoint analog input signal is an external input into the engine control module used to control and vary the kilovolt-ampere output of the alternator while the generator set is paralleled to the utility. The load govern kilovolt-ampere setpoint analog input signal is sent to the engine control module from a remote device, usually a PLC that is monitoring another source to determine the amount of power to be provided by the generator.

The engine control module monitors the voltage on the load govern kilovolt-ampere setpoint analog input signal pin and expects to see a voltage vary between 0.5 and 4.5-VDC during normal engine operation.

High voltage will trip Fault Code 1324 and can be caused by shorts in the signal wire or a failed input device.

Component Location

Reference Section E for location of the engine control module card cage.

Reference the customer/facility/installation documentation for the location of the remote input device.

Shoptalk

The possible failure modes are open circuit, short to battery positive (+), and failed input device.

Make sure shields and grounds are good.

Check input voltage using INSITE™ electronic service tool.

Can reduce kilovolt-amperes to zero and run the unit at a unity PF.

Refer to Troubleshooting Fault Code t05-1324. (</qs3/pubsys2/xml/en/procedures/01/01-t05-1324.html>)