

Fault Code: 1325


Analog Input Signal Circuit for Load Govern kVAR Setpoint - Voltage Below Normal or Shorted to Low Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 1325 PID(P): SPN: FMI: Lamp: Warning SRT:	The analog input signal for the load governed kilovolt-ampere setpoint is shorted low.	No action is taken by the engine control module. Possible loss of performance.

©Cummins Inc

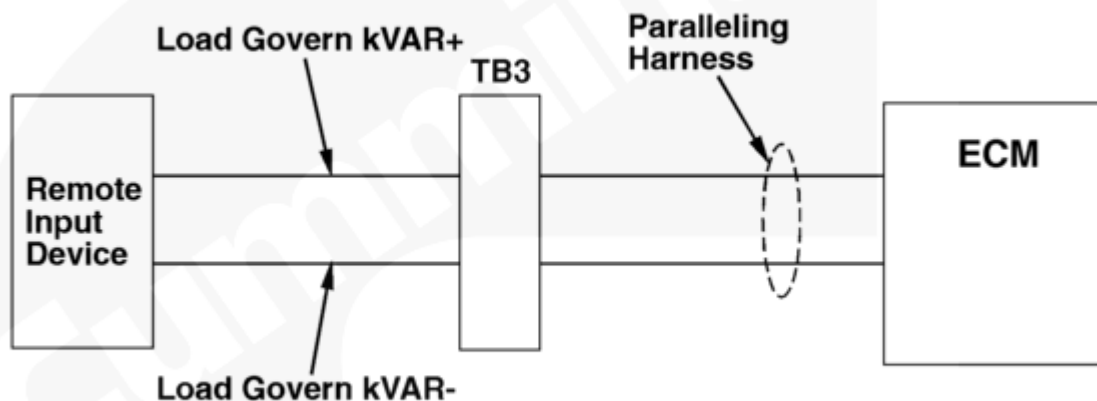

19802903

Load Govern Kilovolt-Ampere Setpoint - Remote Input Device Circuit

Circuit Description

The load govern kilovolt-ampere setpoint analog input signal is an external input into the engine control module used for load governing of the engine/generator set. The load govern kilovolt-ampere setpoint analog input signal is sent to the engine control module from the remote input device.

The engine control module monitors the voltage on the load govern kilovolt-ampere setpoint analog input SIGNAL pin and expects to see a voltage vary between 0.5 and 4.5-VDC during normal engine operation.

Low voltage will trip Fault Code 1325 and can be caused by shorts in the signal wire, an open in the signal, or a malfunctioned input device.

Component Location

Reference Section E for location of the engine control module card cage.

Reference the customer/facility/installation documentation for the location of the remote input device.

Shoptalk

The possible failure modes are open circuit, short to ground, and failed input device.

Make sure shields and grounds are good.

Check input signal with INSITE™ electronic service tool.

Refer to Troubleshooting Fault Code t05-1325. (</qs3/pubsys2/xml/en/procedures/01/01-t05-1325.html>)