


Fault Code: 1421

Timing Rail Number 1 Driver Diagnostic



Overview

Codes	Reason	Effect
Fault Code: 1421 PID(P): SPN: FMI: Lamp: Warning SRT:	Timing rail Number 1 driver diagnostic has detected an error.	No action is taken by the ECM. Possible loss of performance.

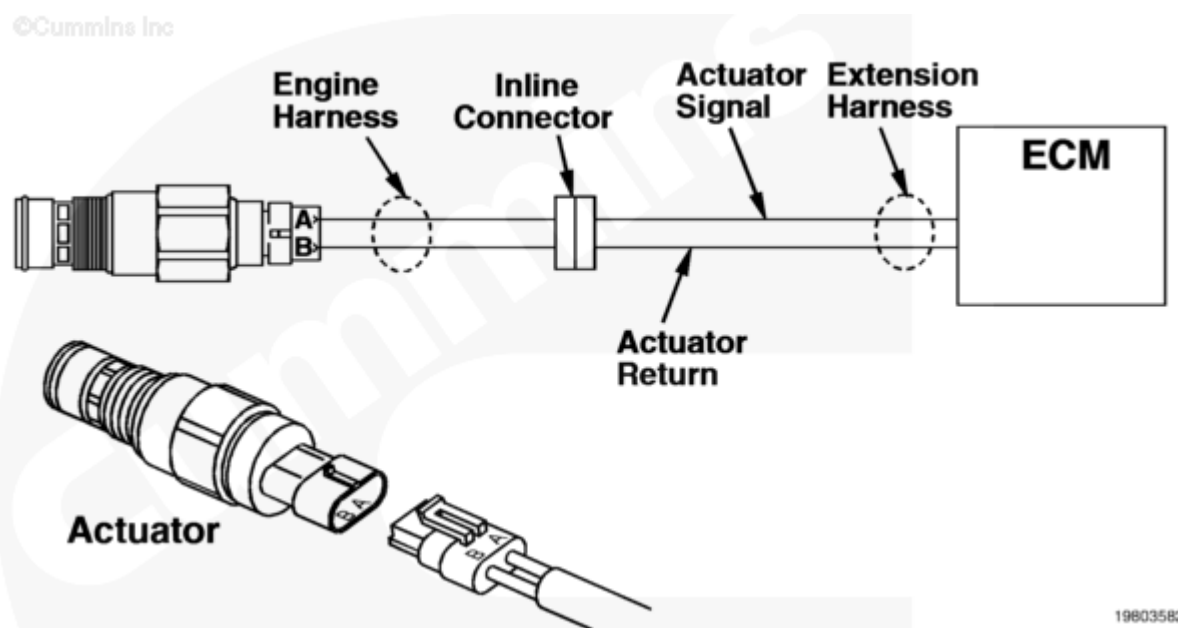

Timing Rail Number 1 Actuator Circuit

Circuit Description

The ECM checks the timing rail Number 1 actuator driver to sustain correct operation. The timing rail Number 1 actuator is actuated by the electronic control module (ECM) to control fuel metering. Each fuel actuator is connected to the ECM by a supply and a return wire. An electrical pulse is sent to the fuel actuator from the ECM on the supply wire and returns to the ECM on the

return wire. Each solenoid valve is normally closed, and it is **only** opened by an electrical pulse from the ECM during metering. The ECM monitors the voltage, no voltage will trip Fault Code 1421, and can be caused by shorts, opens, or a failed fuel pump actuator driver in the ECM.

Component Location

The timing rail Number 1 driver is located in the ECM.

Shoptalk

The possible failure modes are open circuit, short to ground, high actuator resistance, and loss of boost voltage inside the ECM.

Refer to Troubleshooting Fault Code t05-1421 (</qs3/pubsys2/xml/en/procedures/01/01-t05-1421.html>)

Last Modified: 29-Jul-2010
