

Fault Code: 1436


HPI-PT Fuel System Driver Diagnostic

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 1436 PID(P): SPN: FMI: Lamp: Warning SRT:	HPI-PT fuel system driver common diagnostic has detected an error.	No action is taken by the ECM. Possible loss of performance.

©Cummins Inc

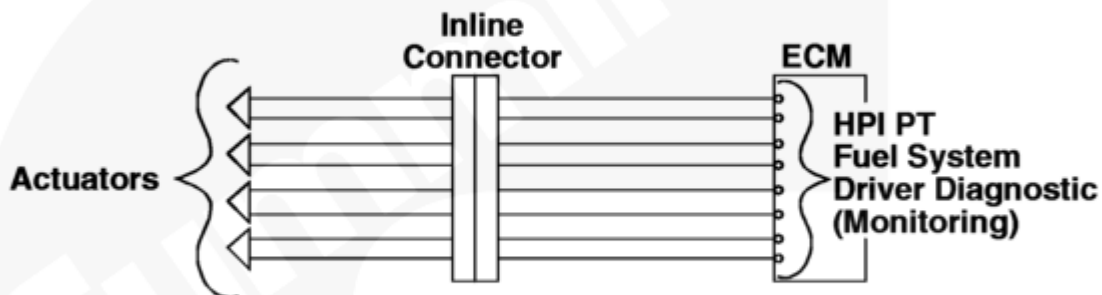

19803591

HPI-PT Fuel System Driver Diagnostic Circuit

Circuit Description

The electronic control module (ECM) checks the HPI-PT fuel system actuator drivers to sustain correct operation. The fuel system actuators are actuated by the ECM to control fuel metering. Each fuel actuator is connected to the ECM by a supply and a return wire. An electrical pulse is sent to the fuel actuator from the ECM on the supply wire and returns to the ECM on the return wire. Each solenoid valve is normally closed, and it is **only** opened by an electrical pulse from the ECM during metering.

The ECM monitors the voltage, no voltage will trip Fault Code 1436, and can be caused by shorts, opens, or a failed fuel pump actuator driver in the ECM.

Component Location

Refer to the OEM manual for location of the ECM. Refer to Procedure 100-002 (</qs3/pubsys2/xml/en/procedures/01/01-100-002.html>) for the component location.

Shoptalk

The possible failure modes are open circuit, short to ground, high actuator resistance, and loss of boost voltage inside the ECM.

Refer to Troubleshooting Fault Code t05-1436 (</qs3/pubsys2/xml/en/procedures/01/01-t05-1436.html>)

Last Modified: 29-Jul-2010
