


Fault Code: 145

Engine Coolant Temperature Sensor Circuit - Shorted Low

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 145 PID(P): SPN: FMI: Lamp: Warning SRT:	Engine coolant temperature sensor signal is shorted low.	No engine protection for coolant temperature. Possible white smoke.

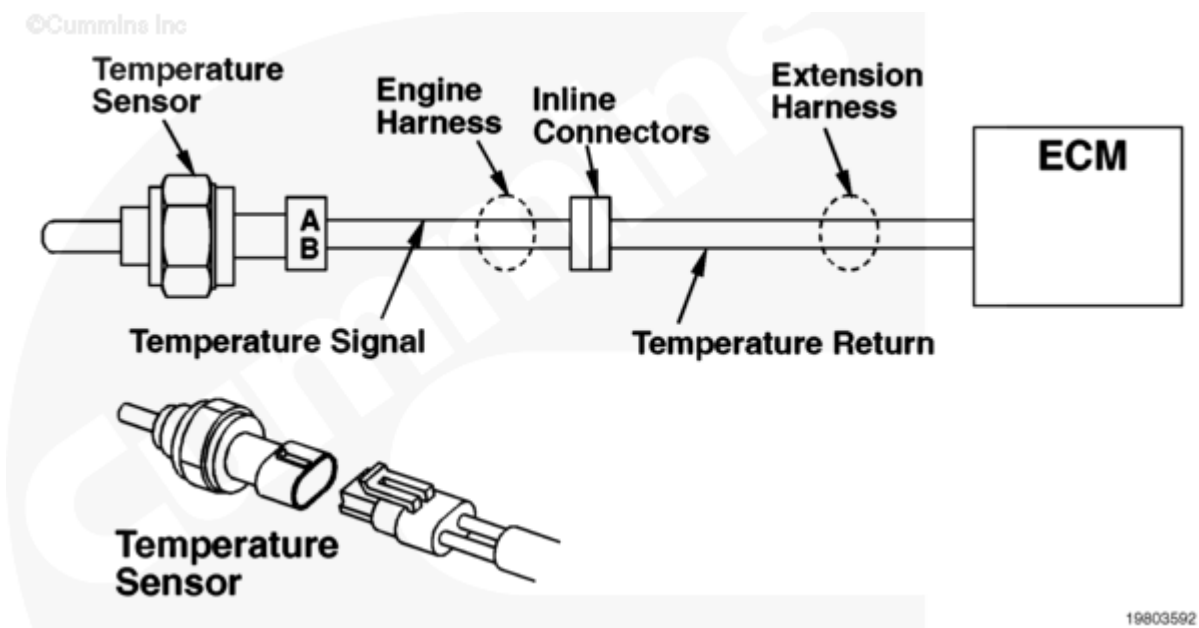

Coolant Temperature Sensor Circuit

Circuit Description

The coolant temperature sensor is used by the electronic control module (ECM) to monitor the temperature of the engine coolant. The coolant temperature is used by the ECM for the engine protection system, timing and fueling control. If the voltage is low for more than 2 seconds, the ECM will log Fault Code 145. Low voltage can be caused by shorts to ground on the supply or return wires or an internally grounded failed sensor.

Component Location

Refer to the Engine Diagrams. 100-002 (/qs3/pubsys2/xml/en/procedures/01/01-100-002.html) for the component location.

Shoptalk

The resistance of the sensor varies with the temperature.

Refer to Troubleshooting Fault Code t05-145 (/qs3/pubsys2/xml/en/procedures/01/01-t05-145.html)

Last Modified: 29-Jul-2010
