


Fault Code: 1459

Generator is Absorbing Power From the Electric Bus - Data Valid But Below Normal Operating Range - Most Severe Level

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 1459 PID(P): SPN: FMI: Lamp: Shutdown SRT:	Reverse kW detected (generator is absorbing voltage from the electric bus).	The generator set will shut down.

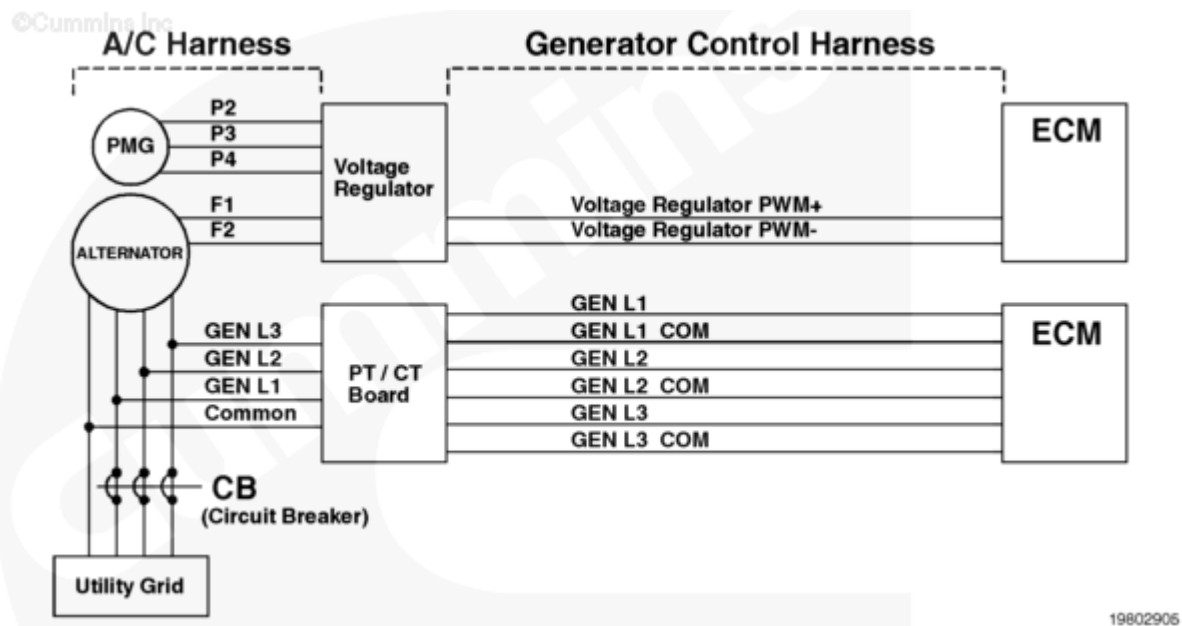

Generator Circuit

Circuit Description

Under normal operating conditions, the generator set connects to the bus. Generator set is producing power, and when it connects to the bus, power is added to the main electric bus. When some events occur, a condition can occur when the generator set is no longer producing power for the electric bus, but rather is drawing power from the electric bus. This condition is called reverse kW.

Component Location

Reference Section E for location of the engine control module (ECM) card cage. Reference customer/facility/installation documentation for the location of the generator set circuit breaker and interface with the electric bus.

Shoptalk

The system (electric bus) is driving the engine using the alternator as a motor.

If the problem occurs at initial start-up, verify proper connection of the generator's current transformers.

Verify proper connection of load-sharing lines.

Verify that the generator is operating at the correct frequency and voltage.

Verify that there are no new fuel system problems that are causing the engine **not** to be able to pick up the load.

Refer to Troubleshooting Fault Code t05-1459. (</qs3/pubsys2/xml/en/procedures/01/01-t05-1459.html>)

Last Modified: 08-May-2012
