


Fault Code: 2561

Engine Gear Box Oil Pressure Low - Critical

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 2561 PCODE(P): SPN: FMI: Lamp: Shutdown SRT:	Voltage signal indicates the engine gear box oil pressure has dropped below the shutdown threshold for low engine gear box oil pressure.	Generator set will shutdown.

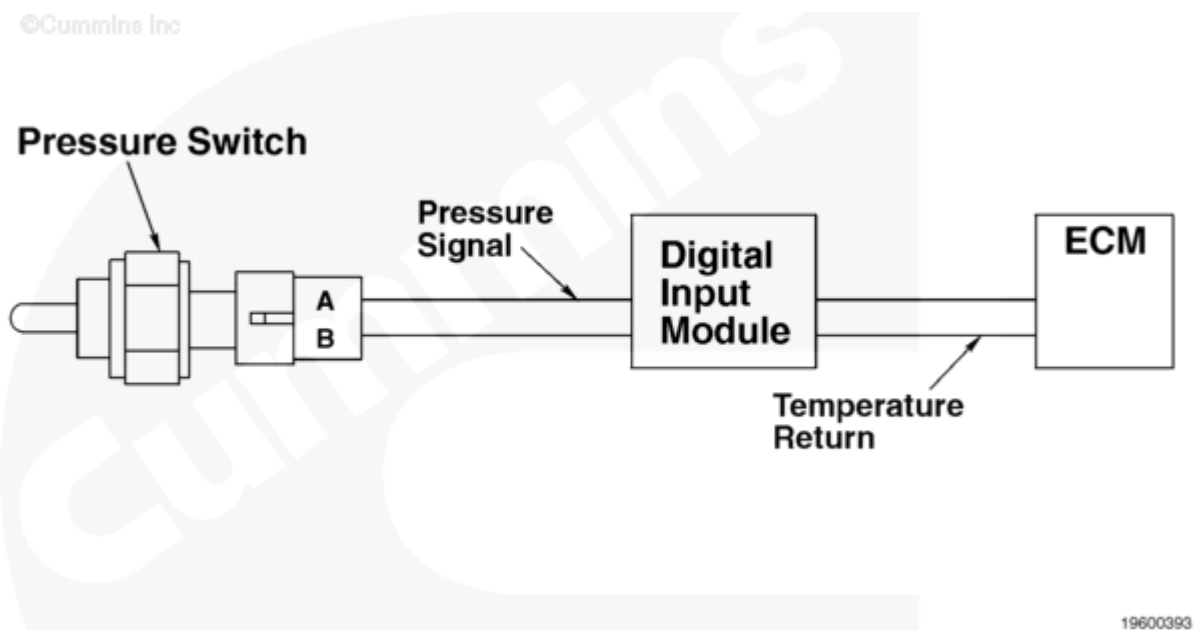

Engine Gear Box Oil Pressure Sensor Circuit

Circuit Description

The engine gear box oil pressure sensor is a switch type sensor. After the pressure drops below the switch point, the sensor will close the circuit. This closed circuit will cause the LonWorks digital input module to send a signal on the LonWorks network to the generator set ECM indicating an engine gear box oil pressure low - critical condition exists.

Component Location

The engine gear box oil pressure sensor is located on the gear box.

Shoptalk

This fault can be caused by a low pressure condition, or a short circuit in the engine gear box oil pressure switch to digital input module circuit. Both pressure of the gearbox oil and a check for a short circuit **must** be performed to troubleshoot this fault.

Refer to Troubleshooting Fault Code t05-2561 (</qs3/pubsys2/xml/en/procedures/01/01-t05-2561.html>)

Last Modified: 29-Jul-2010
