


Fault Code: 2562

Engine Gear Box Oil Temperature High - Critical

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 2562 PCODE(P): SPN: FMI: Lamp: Shutdown SRT:	Voltage signal indicates the engine gear box oil temperature has exceeded the shutdown threshold for high engine gear box oil temperature.	Generator set will shutdown.

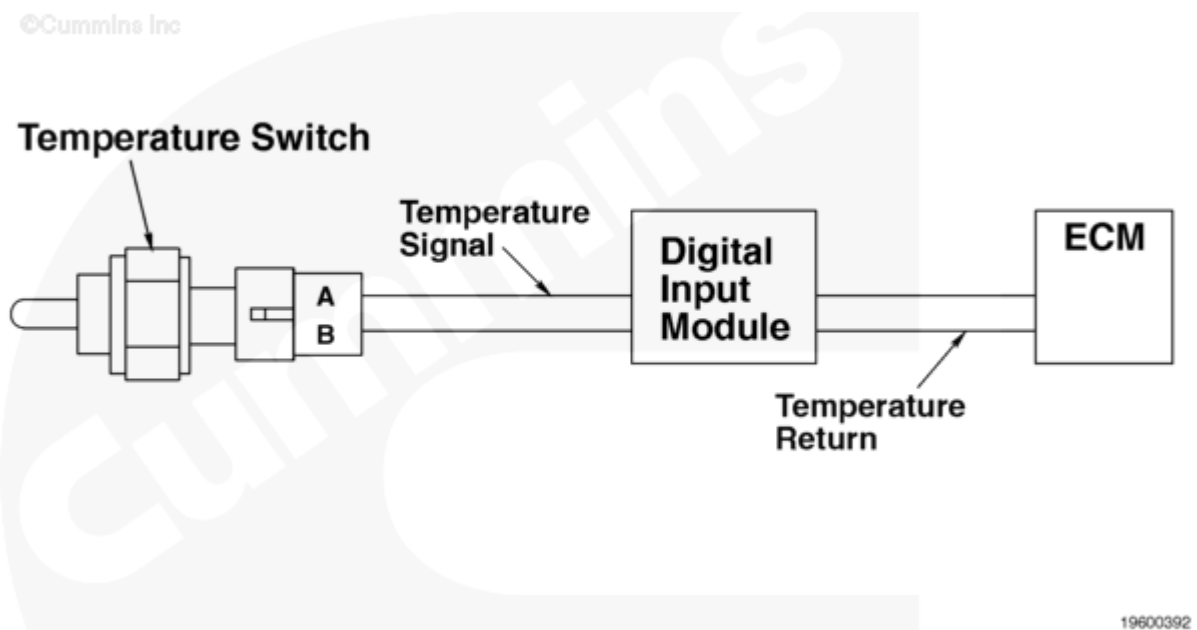

Engine Gear Box Oil Temperature Sensor Circuit

Circuit Description

The engine gear box oil temperature sensor is a switch type sensor. After the temperature increases above the switch point, the sensor will close the circuit. This closed circuit will cause the LonWorks digital input module to send a signal on the LonWorks network to the generator set ECM indicating an engine gear box oil temperature high - critical condition exists.

Component Location

The engine gear box oil temperature sensor is located on the gear box.

Shoptalk

This fault code can be caused by a high temperature condition, or a short circuit in the engine gear box oil temperature switch to digital input module circuit. Both temperature of the gear box oil and a check for a short circuit **must** be performed to troubleshoot this fault.

Refer to Troubleshooting Fault Code t05-2562 (</qs3/pubsys2/xml/en/procedures/01/01-t05-2562.html>)

Last Modified: 29-Jul-2010
