


Fault Code: 259

Fuel Shutoff Valve - Stuck Open

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 259 PID(P): SPN: FMI: Lamp: Warning SRT:	Fuel shutoff valve - stuck open.	No action is taken by the electronic control module (ECM). Possible engine slow shutdown.

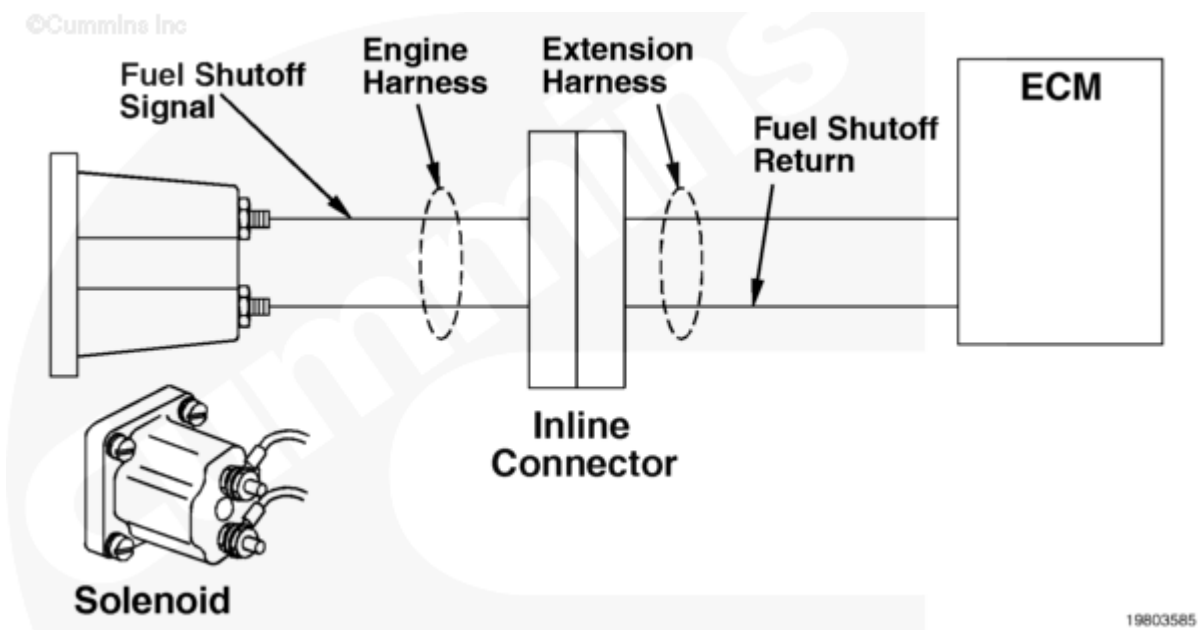

Fuel Shutoff Valve Solenoid Circuit

Circuit Description

Voltage is supplied to the fuel shutoff valve by the ECM while the Run/Stop switch is in the Run position and engine speed is equal to crank. Upon placing the Run/Stop switch in the Stop position, the voltage to the fuel shutoff valve solenoid is turned off by the ECM. The fuel shutoff valve closes and stops fuel from flowing to the fueling and timing actuators.

Component Location

Refer to the Engine Diagrams (Procedure 100-002 (</qs3/pubsys2/xml/en/procedures/01/01-100-002-tr.html>)) in Section E of this manual for the component location.

Shoptalk

With the Run/Stop switch in the Stop position, the ECM turns off the voltage supplied to keep the fuel shutoff valve open. The ECM continues to fire the fueling and timing actuators as the engine spins down. The ECM monitors the engine speed. If the engine speed does **not** drop after the fuel shutoff valve solenoid is turned off, the ECM activates this fault.

Refer to Troubleshooting Fault Code t05-259 (</qs3/pubsys2/xml/en/procedures/01/01-t05-259.html>)

Last Modified: 29-Jul-2010
