


Fault Code: 378

Fueling Actuator Number 1 - Open Circuit (Front)

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 378 PID(P): SPN: FMI: Lamp: Shutdown SRT:	Fueling actuator Number 1 circuit - open circuit. (front)	Engine will shut down.

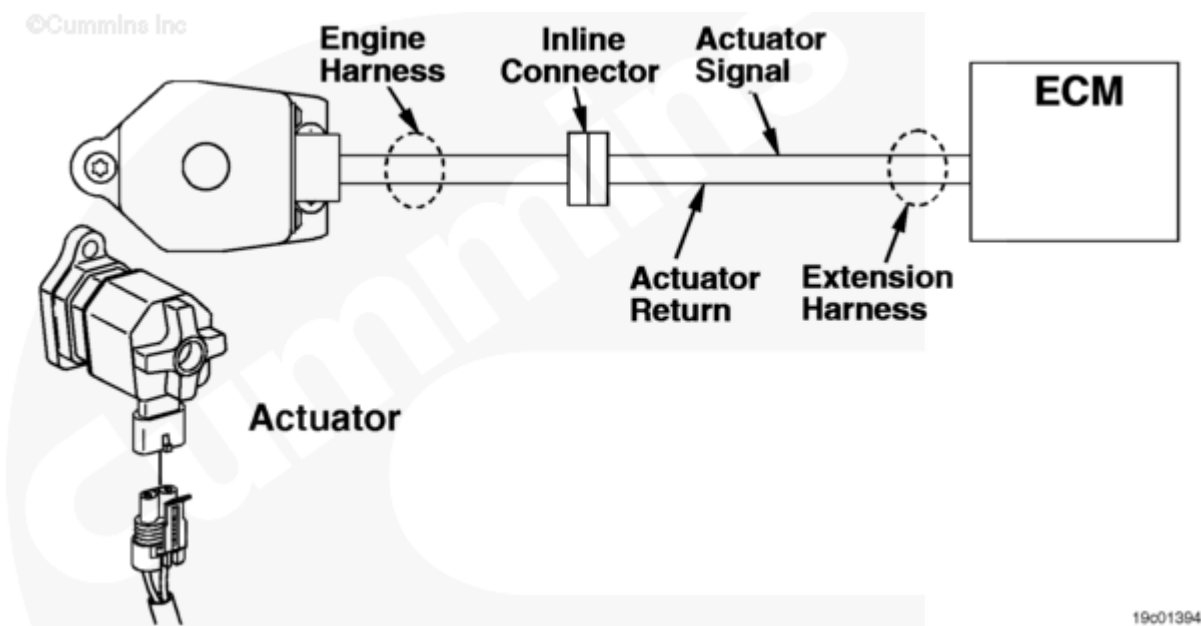

Fueling Actuator Number 1 Circuit

Circuit Description

The fuel actuators are actuated by the ECM to control fuel metering. Each fuel actuator is connected to the ECM by a supply and a return wire. An electrical pulse is sent to the fuel actuator from the ECM on the supply wire and returns to the ECM on the return wire. Each solenoid valve is normally closed, and it is **only** opened by an electrical pulse from the ECM during metering.

Component Location

The front fueling actuator is mounted on the fuel delivery housing. It is the actuator closest to the front of the QSX15 engine.

Shoptalk

The possible failure modes are open circuit, short to ground, high actuator resistance, supply wire shorted to battery, and loss of boost voltage inside of ECM.

Refer to Troubleshooting Fault Code t05-378 (</qs3/pubsys2/xml/en/procedures/01/01-t05-378.html>)

Last Modified: 29-Jul-2010
