


Fault Code: 398

Timing Actuator Number 2 - Open Circuit (Rear)

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 398 PID(P): SPN: FMI: Lamp: Shutdown SRT:	Timing actuator Number 2 circuit - open circuit. (rear)	Engine will shut down.

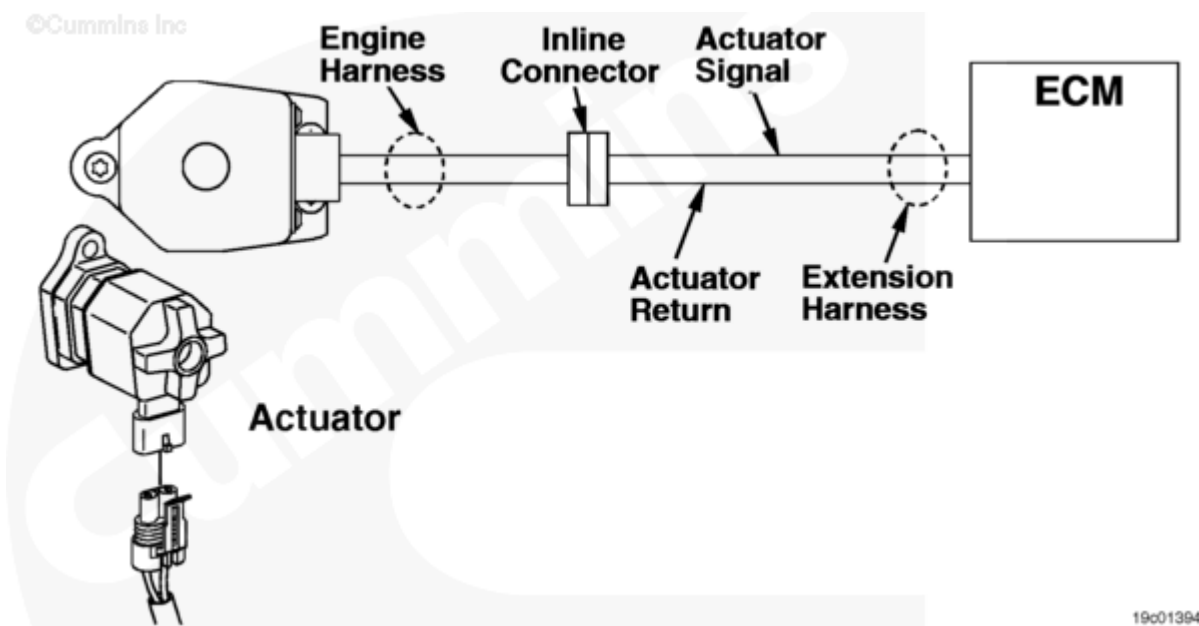

Timing Actuator Number 2 Circuit

Circuit Description

The timing actuators are actuated by the ECM to control fuel metering. Each timing actuator is connected to the ECM by a supply and a return wire. An electrical pulse is sent to the timing actuator from the ECM on the supply wire and returns to the ECM on the return wire. Each solenoid valve is normally closed, and it is **only** opened by an electrical pulse from the ECM during metering.

Component Location

The rear timing actuator is mounted on the fuel delivery housing. It is the third actuator from the front of the QSX15 engine.

Shoptalk

The possible failure modes are open circuit, short to ground, and high actuator resistance.

Refer to Troubleshooting Fault Code t05-398 (</qs3/pubsys2/xml/en/procedures/01/01-t05-398.html>)

Last Modified: 29-Jul-2010
