


Fault Code: 399

Timing Actuator Number 2 - Grounded Circuit (Rear)

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 399 PID(P): SPN: FMI: Lamp: Shutdown SRT:	Timing actuator Number 2 circuit - grounded circuit. (rear)	Engine will shut down.

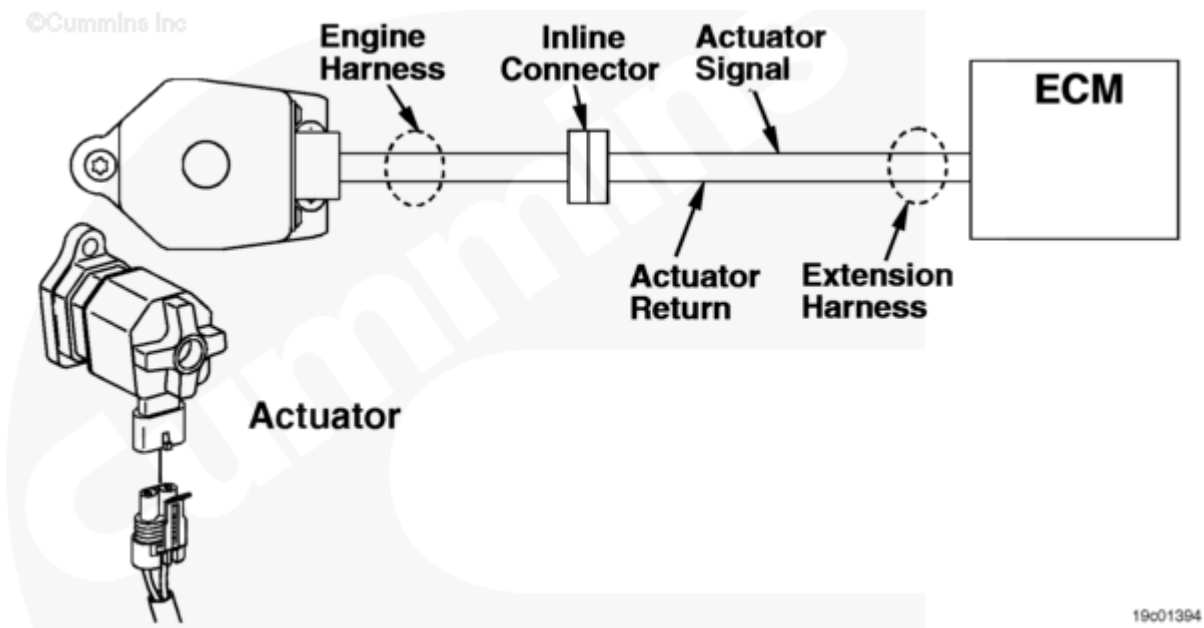

Timing Actuator Number 2 Circuit

Circuit Description

The timing actuators are actuated by the electronic control module (ECM) to control fuel timing. Each timing actuator is connected to the ECM by a supply and a return wire. An electrical pulse is sent to the timing actuator from the ECM on the supply wire and returns to the ECM on the return wire. Each solenoid valve is normally closed, and it is **only** opened by an electrical pulse from the ECM during metering.

Component Location

The rear timing actuator is mounted on the fuel delivery housing. It is the third actuator from the front of the QSX15 engine.

Shoptalk

The possible failure modes are short to battery, low actuator resistance, or short between supply and return wires.

Refer to Troubleshooting Fault Code t05-399 (</qs3/pubsys2/xml/en/procedures/01/01-t05-399.html>)

Last Modified: 29-Jul-2010
