

Fault Code: 449


High Fuel Pressure

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 449 PID(P): SPN: FMI: Lamp: Warning SRT:	High fuel supply pressure was detected at the fuel pressure sensor.	No action is taken by the ECM. Possible black smoke.

©Cummins Inc

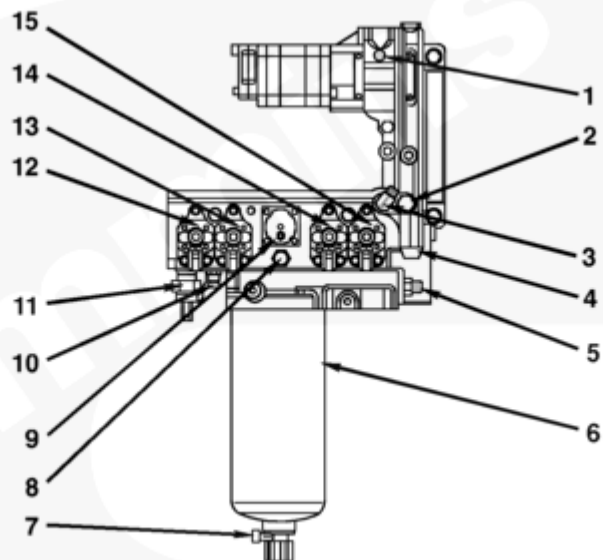

06c00120

Fuel System Circuit

Circuit Description

The gear pump draws fuel from the fuel tank through the fuel filter and anti-drainback valve. The gear pump develops 689 to 2206 kPa [100 to 320 psi] of fuel pressure. The fuel flows through the fuel filter screen and fuel shutoff valve to the fueling and timing actuators and the fuel pressure sensor. The 1724 kPa [250 psi] regulator controls the fuel pressure.

Component Location

Hydraulic Fuel System Circuit Components							
1	Quick-disconnect pressure tap - suction side	5	Fuel inlet	9	Fuel shutoff valve solenoid	13	Front timing actuator
2	2206 kPa [320 psi] pressure regulator	6	Fuel filter/water separator	10	Quick-disconnect pressure tap - pressure side	14	Rear timing actuator
3	Fuel return line fitting	7	Fuel/water separator drain valve/Water-in-fuel sensor	11	Fuel pressure sensor	15	Rear metering actuator
4	36-micron filter screen	8	1724 kPa [250 psi] pressure regulator	12	Front metering actuator		

Shoptalk

The fuel pressure is monitored by the ECM. If the fuel pressure is outside of an acceptable range the fault code is activated.

Refer to Troubleshooting Fault Code t05-449 (/qs3/pubsys2/xml/en/procedures/01/01-t05-449.html)

