


Fault Code: 719

Blowby Pressure Sensor - Shorted High

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 719 PID(P): SPN: FMI: Lamp: Warning SRT:	Crankcase blowby pressure sensor circuit - shorted high.	No engine protection for blowby pressure.

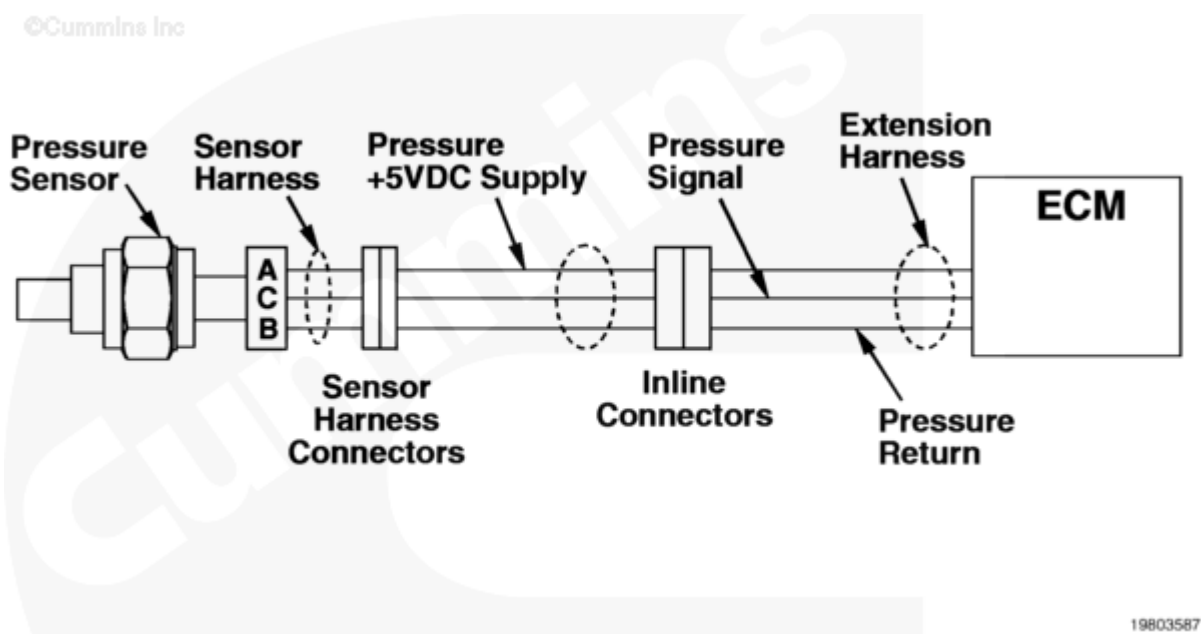

Blowby Pressure Sensor Circuit

Circuit Description

The blowby pressure sensor monitors crankcase blowby pressure and passes information to the electronic control module (ECM). High voltage will trip Fault Code 719 and can be caused by shorts in the supply, signal, or return wires, an open in the return wire, or a failed sensor.

Component Location

Refer to the Engine Diagrams. 100-002 (/qs3/pubsys2/xml/en/procedures/01/01-100-002.html) for the component location.

Shoptalk

Confirm that the crankcase breathers, breather tubes, and blowby sensor are **not** obstructed.

Refer to Troubleshooting Fault Code t05-719 (/qs3/pubsys2/xml/en/procedures/01/01-t05-719.html)

Last Modified: 29-Jul-2010
