


Fault Code: 124

Intake Manifold Pressure High - Data Valid but Above Normal Operating Range



Overview

Codes	Reason	Effect
Fault Code: 124 PID(P): P102 SPN: 102 FMI: 16 Lamp: Amber SRT:	Intake manifold pressure high - data valid but above normal operating range - moderately severe level.	No action taken.

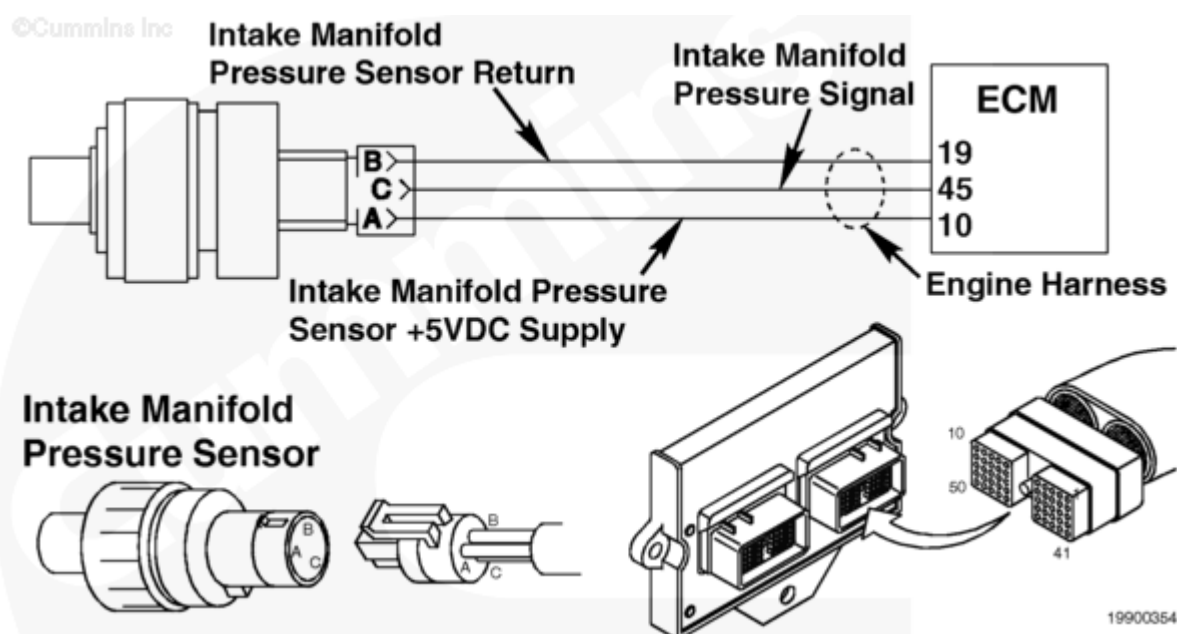

Intake Manifold Pressure Sensor Circuit

Circuit Description

The intake manifold pressure sensor is used by the electronic control module (ECM) to monitor the engine intake manifold pressure. The ECM monitors the voltage on the intake manifold pressure signal pin and converts this to a pressure value. The intake manifold pressure value is used by the ECM for the engine protection system.

Component Location

Reference Section E for a detailed component location view. The intake manifold pressure sensor is located next to the air intake heater behind the ECM.

Shoptalk

Possible causes:

- Malfunctioning turbocharger wastegate. Refer to Procedure 010-050 (</qs3/pubsys2/xml/en/procedures/41/41-010-050.html>) in the Troubleshooting and Repair Manual, C Series Engines, Bulletin 3666003.
- A faulty sensor.

Refer to Troubleshooting Fault Code t05-124 (</qs3/pubsys2/xml/en/procedures/07/07-t05-124.html>)

Last Modified: 18-Dec-2012
