


Fault Code: 135

Oil Pressure Sensor Circuit - Voltage Above Normal or Shorted to High Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 135 PID(P): P100 SPN: 100 FMI: 3 Lamp: Amber SRT:	Oil pressure sensor circuit - voltage above normal or shorted to high source.	Engine protection for oil pressure disabled.

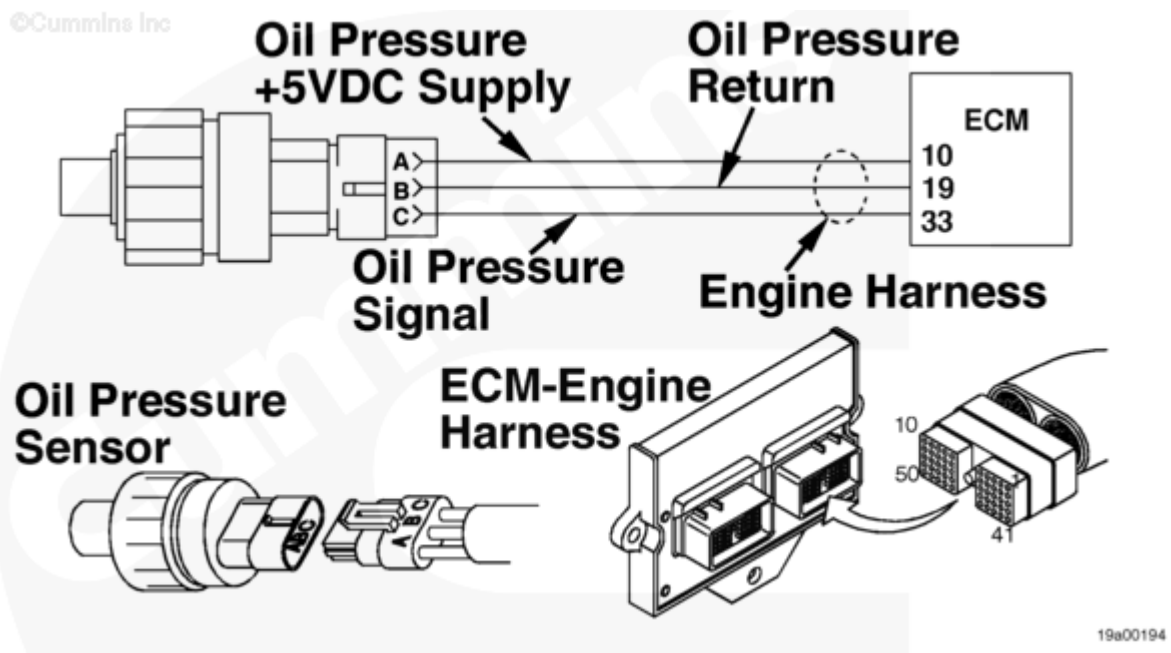

Oil Pressure Sensor Circuit

Circuit Description

The oil pressure sensor monitors oil pressure and passes information to the electronic control module (ECM) through the oil pressure signal pin of the engine harness. The ECM monitors the voltage on the oil pressure signal pin. Voltage exceeding the control threshold will trip Fault Code 135.

Component Location

Reference Section E for a detailed component location view. The oil pressure sensor is located between the coolant filter and the heater solenoids.

Shoptalk

If the fault occurs **only** in cold weather, allow the oil to warm up and see if the fault goes inactive.
If Fault Code 143 or 415 is **not** present, the problem is **not** base engine related.

Refer to Troubleshooting Fault Code t05-135 (</qs3/pubsys2/xml/en/procedures/07/07-t05-135.html>)

Last Modified: 18-Dec-2012
