


Fault Code: 153

Intake Manifold Air Temperature Sensor Circuit - Voltage Above Normal or Shorted to High Source

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 153 PID(P): P105 SPN: 105 FMI: 3 Lamp: Amber SRT:	Intake manifold air temperature sensor circuit - voltage above normal or shorted to high source.	No engine protection for circuit or sensor failure.

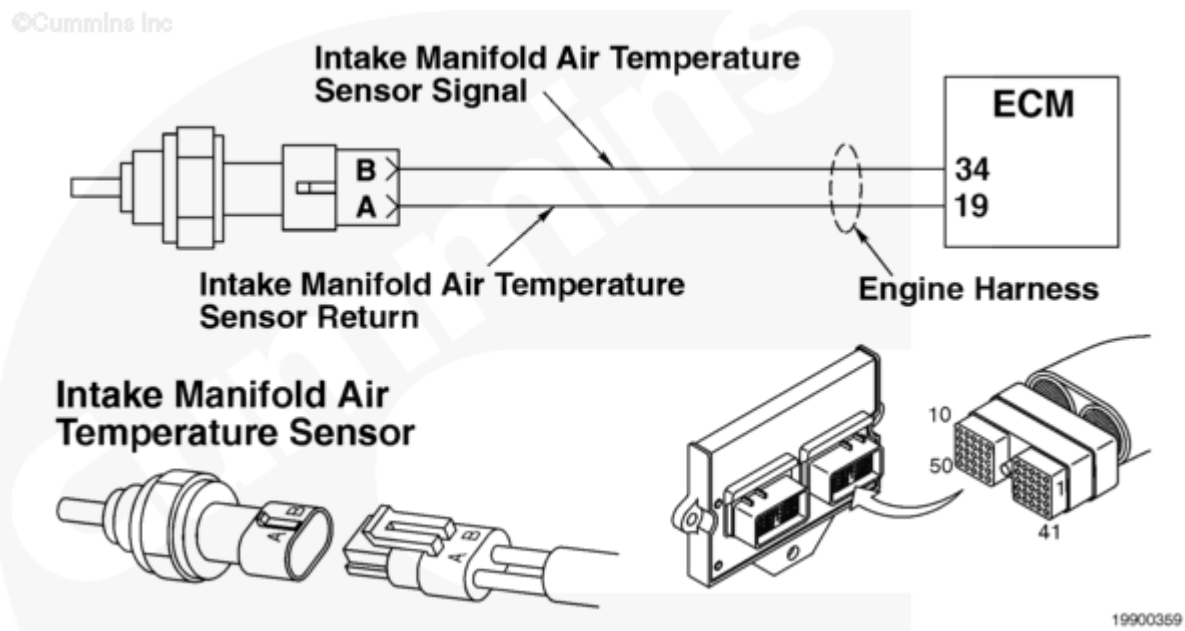

Intake Manifold Air Temperature Sensor Circuit

Circuit Description

The intake manifold temperature sensor is used by the electronic control module (ECM) to monitor the temperature of the air in the intake manifold after the aftercooler. The intake manifold temperature sensor is used by the ECM for the engine protection system, timing, and fueling control.

Component Location

Reference Section E for a detailed component location view. The intake manifold temperature sensor is located in the intake manifold at the rear of the engine.

Shoptalk

The resistance of all the temperature sensors varies with the temperature. The reading observed should compare to the following table if the sensor is functioning properly.

Temperature (°F)	Temperature (°C)	Resistance (ohms)
32	0	30k to 36k
77	25	9k to 11k
122	50	3k to 4k
167	75	1350 to 1500
212	100	600 to 675

Refer to Troubleshooting Fault Code t05-153 (</qs3/pubsys2/xml/en/procedures/07/07-t05-153.html>)