



Technical Service Bulletin

Technical Service Bulletin: tsb100132

Released Date: 27-Sep-2001

Lubricating Oil Pump Sourcing Change

Lubricating Oil Pump Sourcing Change

Warranty Statement


The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin announces changes for the supplier and to the appearance of the 19-liter lubricating oil pump.


During April, May, and June 2001, a limited production of 19-liter engines was built with newly sourced lubricating oil pumps. Part Number 3047549 is used on K19 engines, and Part Number 3096326 is used on QSK19 engines. The new lubricating oil pumps have the same part numbers as the old pumps but can be identified from the casting and identification marks shown in Figs. 1 through 4.

©Cummins Inc

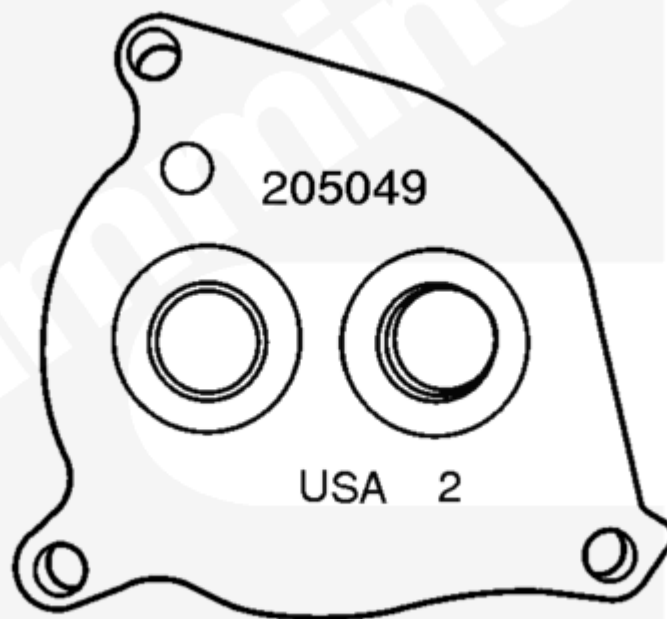


07400209

Fig. 1, Old K19 Lubricating Oil Pump Front Face, Part Number 3047549

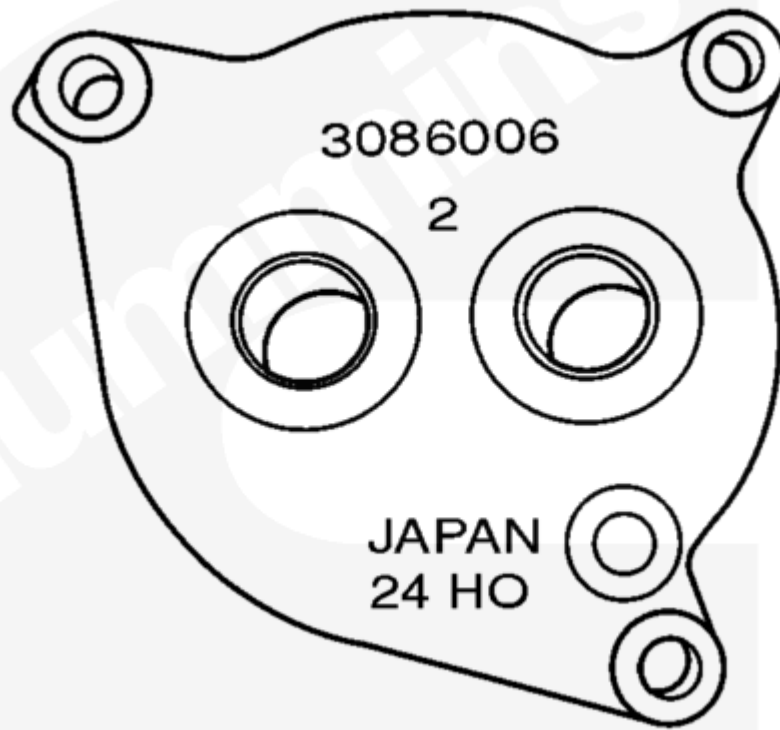


07400210

Fig. 2, New K19 Lubricating Oil Pump Front Face, Part Number 3047549

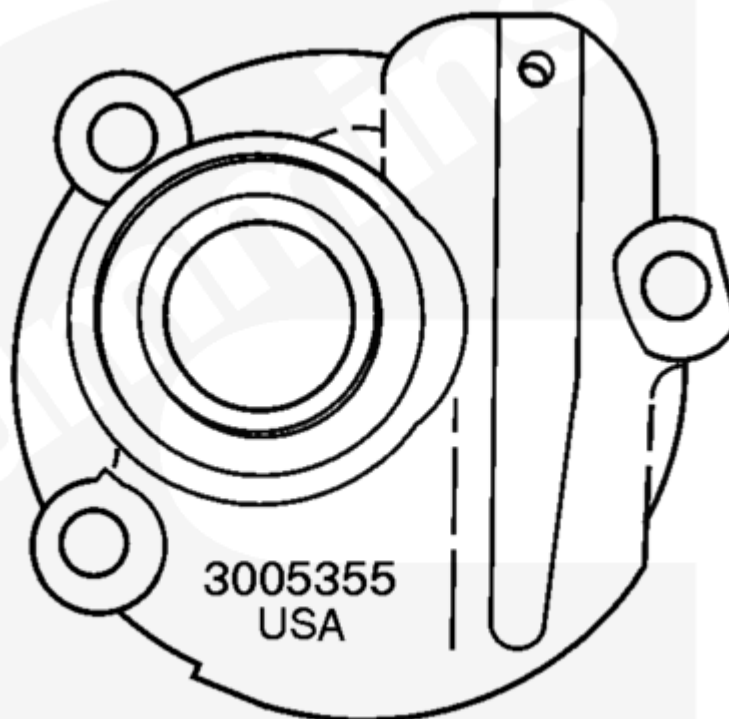

07400211

Fig. 3, Old QSK19 Lubricating Oil Pump Back or Gear Drive Side, Part Number 3096326

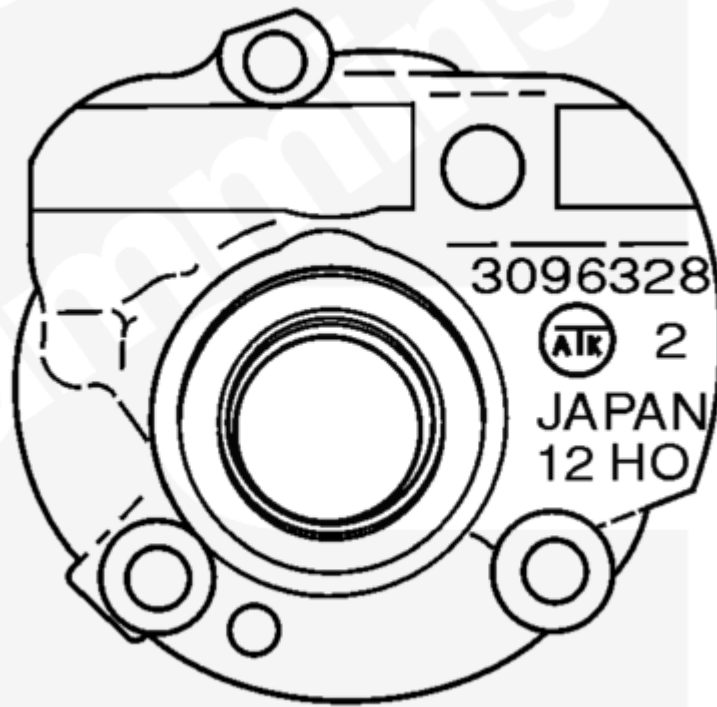


07400212

Fig. 4, New QSK19 Lubricating Oil Pump, Back or Gear Drive Side, Part Number 3096326


In addition to the physical appearance differences mentioned above, the new supplier will mark a colored dykem on the front face of each pump with the assembly number and measured end clearance inscribed within. The end clearance is given in millimeters. The end clearance for the QSK19 can range from 0.025 to 0.229 mm [0.001 to 0.009 in]. The end clearance for K19 can range from 0.127 to 0.254 mm [0.005 to 0.010 in]. The pump assembly date code is stamped in white outside the dykem area.

New K19 lubricating oil pumps will have an orange dykem in the locations shown in Fig. 5 and Fig. 6. The date code is stamped in white in Fig. 5.

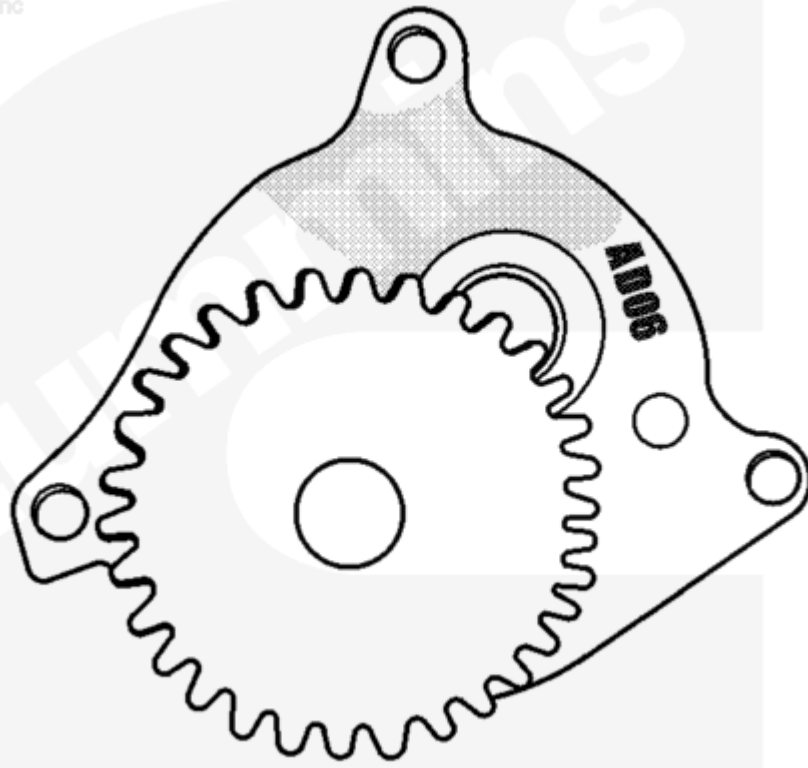

07400213

Fig. 5, K19 Lubricating Oil Pump with Date Code AD06

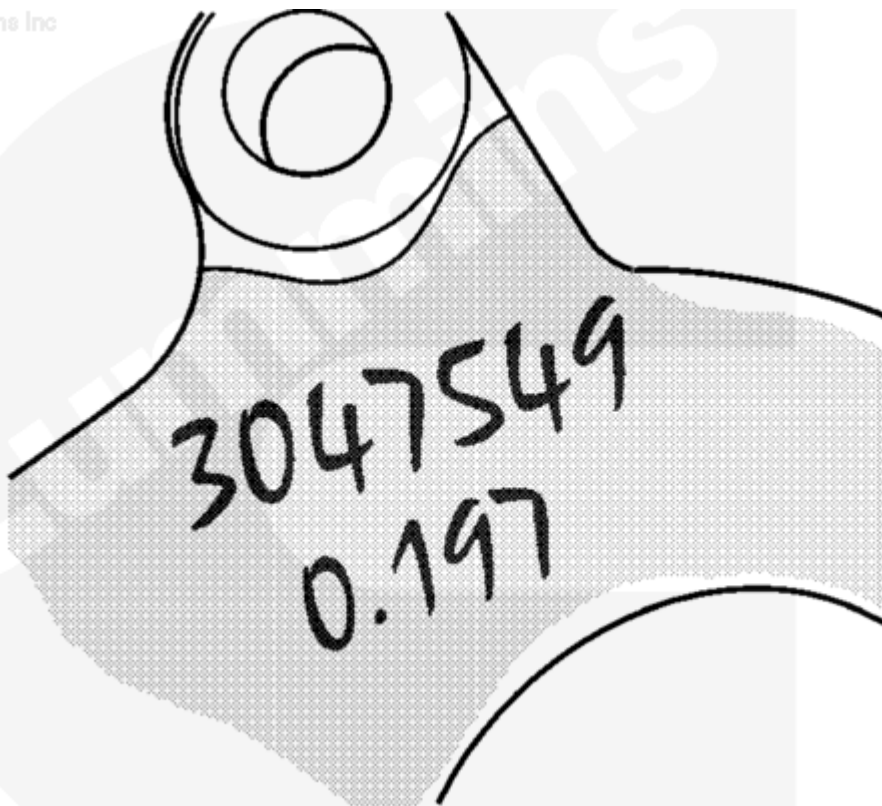

07400214

Fig. 6, Close View of K19 Lubricating Oil Pump with Part Number and End Clearance

New QSK19 lubricating oil pumps will have a yellow dykem mark with the date code stamped in white.

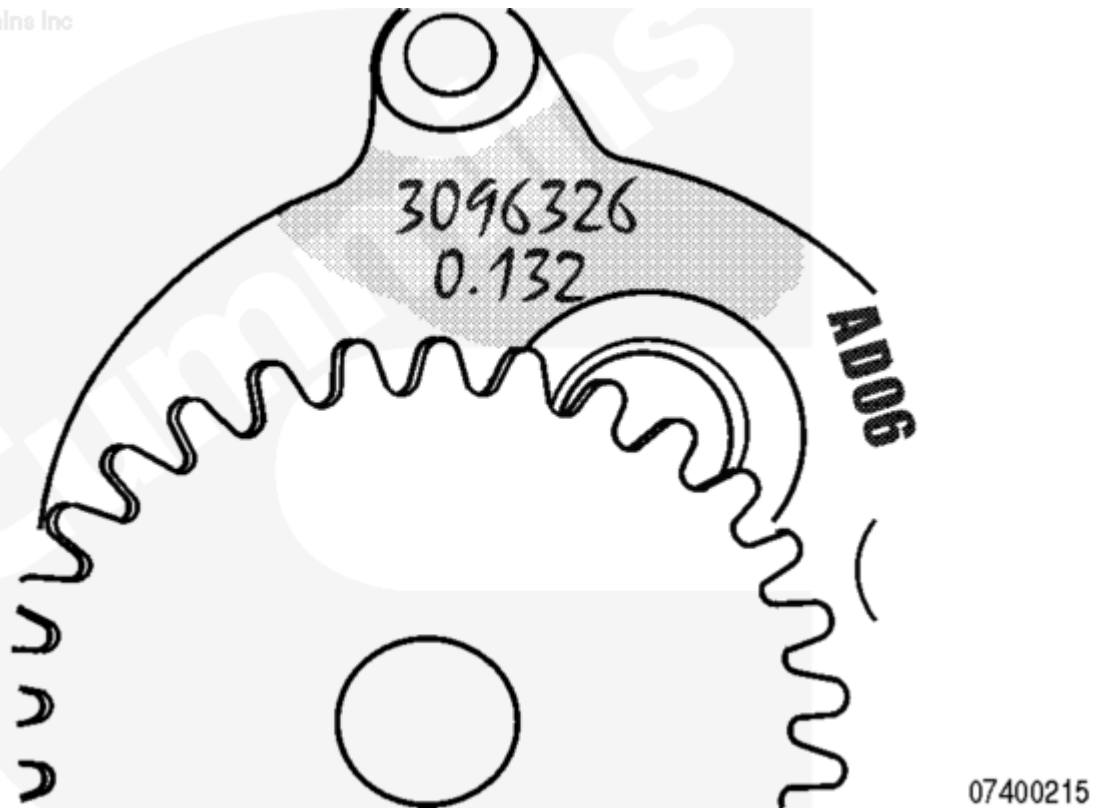


Fig. 7, QSK19 Lubricating Oil Pump with Yellow Dykem Mark, Part Number, End Clearance, and Date Code Stamped in White

The new lubricating oil pump was introduced on K19 production engines with engine serial number first 37198232, built on April 17, 2001. The lubricating oil pump was introduced on QSK19 production engines with engine serial number first 37198269, built on April 12, 2001.

If a lubricating oil pump malfunctions on a 19-liter engine built after the engine serial number first listed above, then contact Cummins High-Horsepower Service Engineering to obtain instructions about returning the pump for analysis.