



Technical Service Bulletin

Technical Service Bulletin: TSB150051

Released Date: 28-Apr-2015

Engine Brake Wiring Harness Design Change

Engine Brake Wiring Harness Design Change

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document introduces new engine brake wiring harness part numbers which utilize a new design.

Product Affected

- ISX CM570
- ISX CM870
- ISX CM871
- ISX CM871 E
- QSX CM570

Description of Change

The engine brake wiring harness has been redesigned to include a mounting tab on the harness frame. See Figure 1. The mounting tab secures to a studded capscrew that **must** be used in place of the corresponding rocker shaft mounting capscrew. See Figure 2.

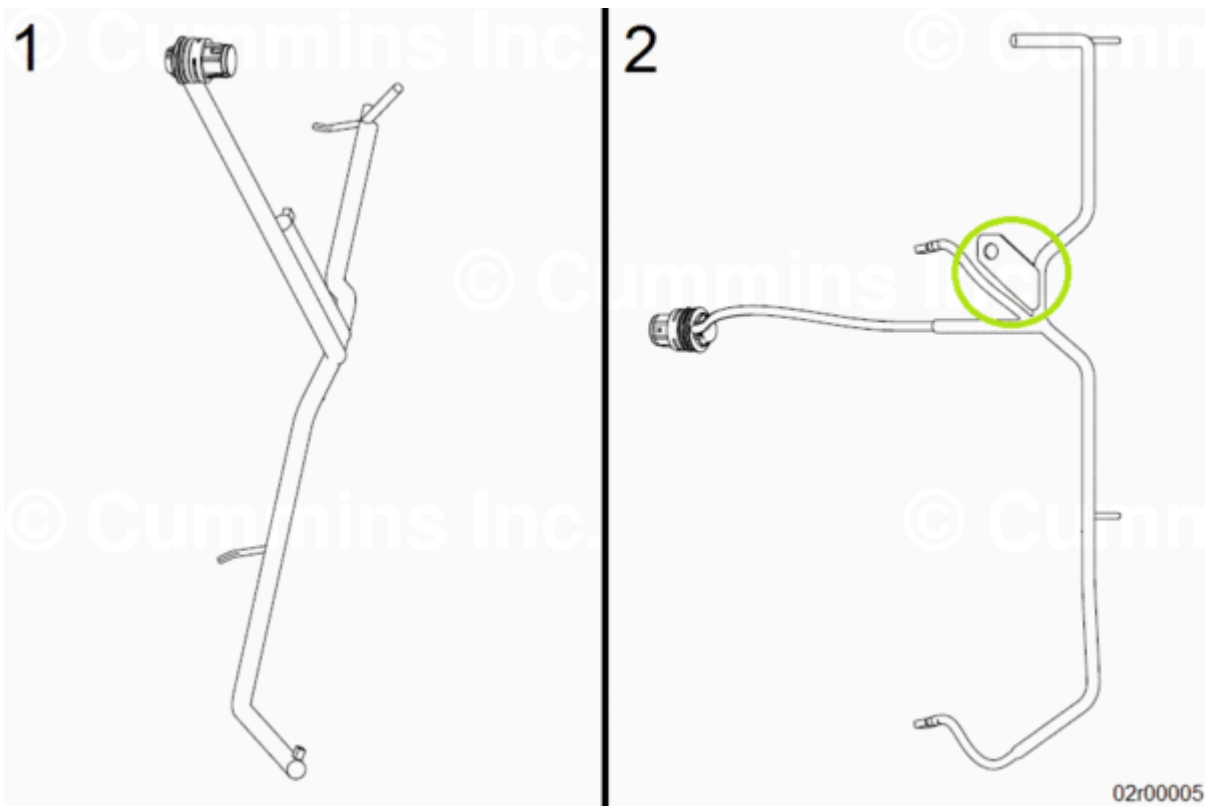


Figure 1, Number 1 on Left: Previous Design. Number 2 on Right: New Design Including Mounting Tab.

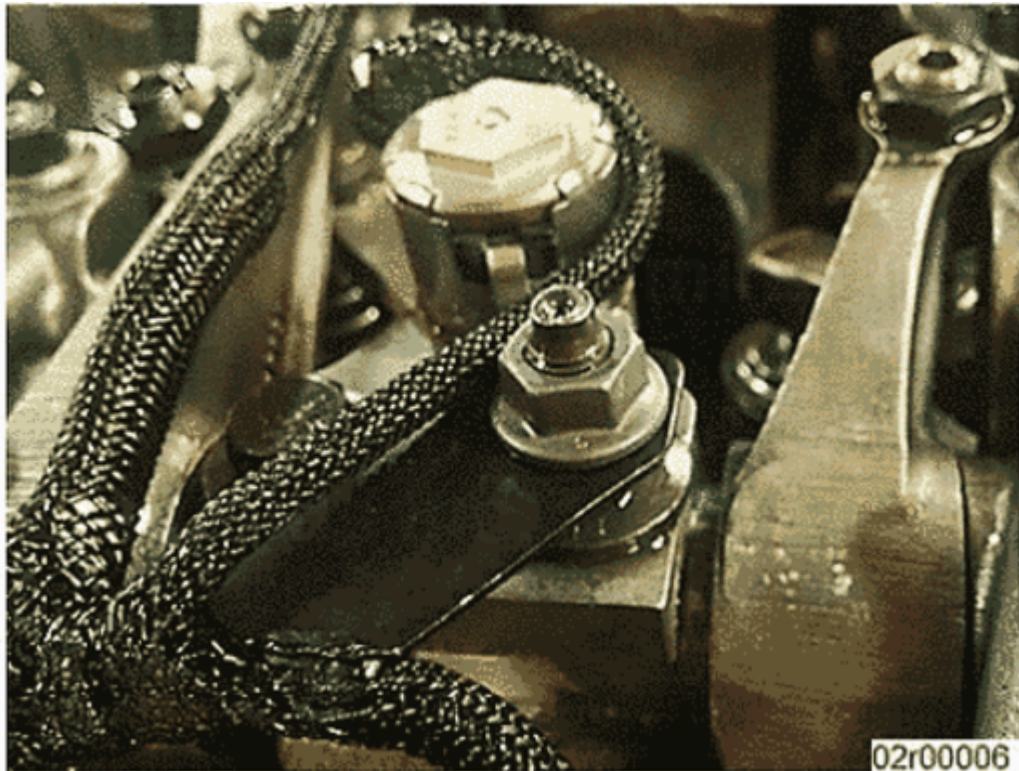


Figure 2, Mounting Tab Secured to Studed Rocker Shaft Capscrew

Reason for Change

The addition of the mounting tab to the engine brake wiring harness frame improves retention capability and prevents the engine brake wiring harness from making contact with overhead components.

Service Instructions

Replace the rocker shaft capscrew that aligns with the mounting tab hole with the studded capscrew, Part Number 4336706. Tighten the studded capscrew to the final torque value using the torque plus angle method.

Torque Value:

- 1. 30 N•m [22 ft-lb]
- 2. Rotate capscrew 60 degrees clockwise.

Fit the mounting tab over the studded capscrew and tighten the flange nut, Part Number 3902662.

Torque Value: 47 N•m [35 ft-lb]

Service Parts Availability

Service parts are available. See Table 1.

Table 1, Engine Brake Wiring Harness Part Numbers		
Part Description	Obsolete Part Number	New Part Number
Engine Brake Wiring Harness (2 Solenoid)	2864399	4331263
Engine Brake Wiring Harness (3 Solenoid)	2864398	4331306
Studded Capscrew	Not Applicable	4336706
Flange Nut	Not Applicable	3902662

Part Structure

The existing engine brake wiring harnesses part numbers have been obsoleted and superseded by the new wiring harness part numbers.

Part Inventory Action

Use existing part number inventory before using the new part numbers.

Document History

Date	Details
2015-4-14	Module Created

