


## Fault Code: 2154

### Post-Oil Filter Pressure Sensor Circuit - Voltage Above Normal or Shorted to High Source

 Printable Version

#### Overview

| Codes                                                                                  | Reason                                                                                                                                                                | Effect                      |
|----------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------|
| Fault Code: 2154<br><br>PID(P): 100<br>SPN: 611<br>FMI: 3<br>Lamp: None<br>SRT: 00-686 | Post-Oil Filter Pressure Sensor Circuit - Voltage Above Normal or Shorted to High Source. High voltage detected on SIGNAL pin 09 of the main harness A ECM connector. | Fault Code 612 is disabled. |

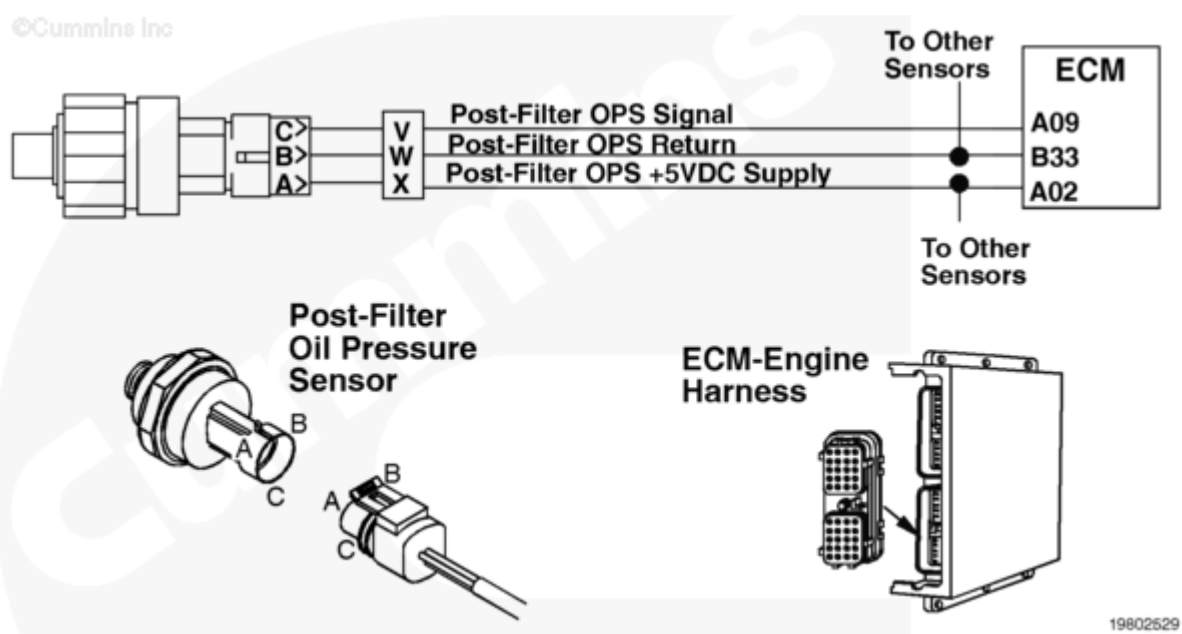

Post-Filter Oil Pressure Sensor Circuit

#### Circuit Description

The post-filter oil pressure is the engine oil pressure after the oil has passed through the oil filters. The post-filter oil pressure sensor sends the post-filter oil pressure signal to the CENSE™ ECM.

## Component Location

The post-filter oil pressure sensor is located on the oil outlet side of the lubricating oil system filter head.

## Shoptalk

- If the fault occurs **only** in a cold environment, allow the oil to warm up and see if the fault becomes inactive.

Refer to Troubleshooting Fault Code t05-2154 (</qs3/pubsys2/xml/en/procedures/81/81-t05-2154.html>)

---

**Last Modified: 07-Jul-2015**

---