



Technical Service Bulletin

Technical Service Bulletin: TSB100603

Released Date: 24-Oct-2012

QSK19 High Pressure Injection Turbocharger Mounting Hardware

QSK19 High Pressure Injection Turbocharger Mounting Hardware

Warranty Statement

The information in this document authorizes specific changes to the repair practice for failures covered under product warranty coverages.


Contents


A serious quality problem project (SEY-11005) closed that resulted in the implementation of modular common rail system turbocharger mounting hardware on all 19 liter high pressure injection engines, excluding rail engines and engines with wastegated turbocharger effective 05 May 2011.

Modular Common Rail System Hardware	
Part Number	Description
3627095	Mounting Capscrew
4986447	12.7 mm [0.50 in] spacer
4986448	9.6 mm [0.38 in] spacer
3016182	Locking Nuts

In the event of a failure of the high pressure injection turbocharger mounting hardware, the modular common rail system mounting hardware should be installed. The installation of the modular common rail system mounting hardware results in a more robust bolted joint over the current high pressure injection hardware.

The correct mounting configuration for the modular common rail system hardware is illustrated below.



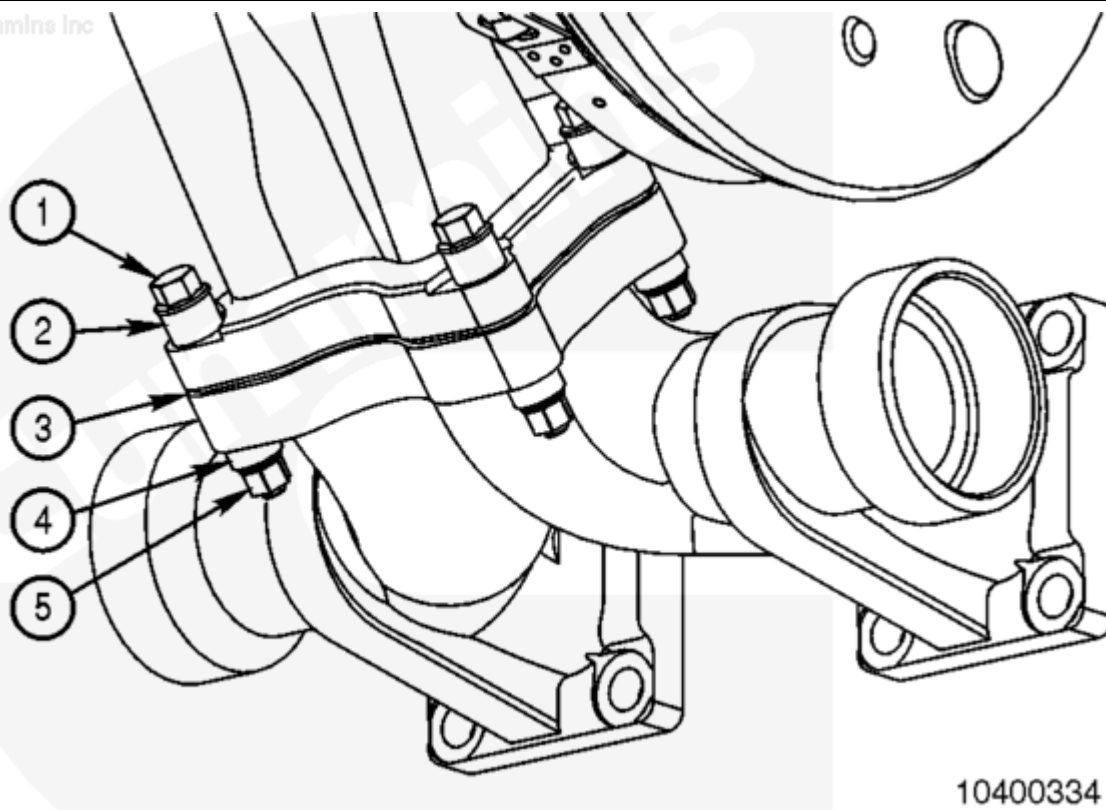

10400334

Turbocharger Mounting

1. Mounting Capscrew
2. 12.7 mm [0.50 in] spacer
3. Gasket
4. 9.6 mm [0.38 in] spacer
5. Locking Nut

In the event of a turbocharger mounting hardware failure on a rear-out turbocharger arrangement with an on-engine torque converter cooler, it is also necessary to replace the turbocharger drain line connection, if modular common rail system hardware is installed.

Turbocharger Drain Line		
New Part Number	Description	Quantity
AS16020NF	Hose	1
S120	Screw, hexagon head cap	1
S223	Nut, heavy hexagon	1
S602	Washer, plain	3
S604	Washer, lock	1
43828A	Clamp, hose	2
3003536	Elbow, hose	1
3093632	Spacer, mounting	1
3200393	Clip	1
4000574	Brace, tube	1
4094903	Tube, turbocharger oil drain	1

Turbocharger Drain Line		
New Part Number	Description	Quantity
4967359	Connector, female	1




1. Place the gasket on the oil drain connection. Install a capscrew with a lock washer up through the connection.




2. Position the turbocharger drain tube connection with gasket to turbocharger. Hand start the first capscrew with a lock washer up through the tube connection into the turbocharger. Install the second capscrew with a lock washer up through the tube connection into the turbocharger.

Torque Value: 45 N-m [33 ft-lb]

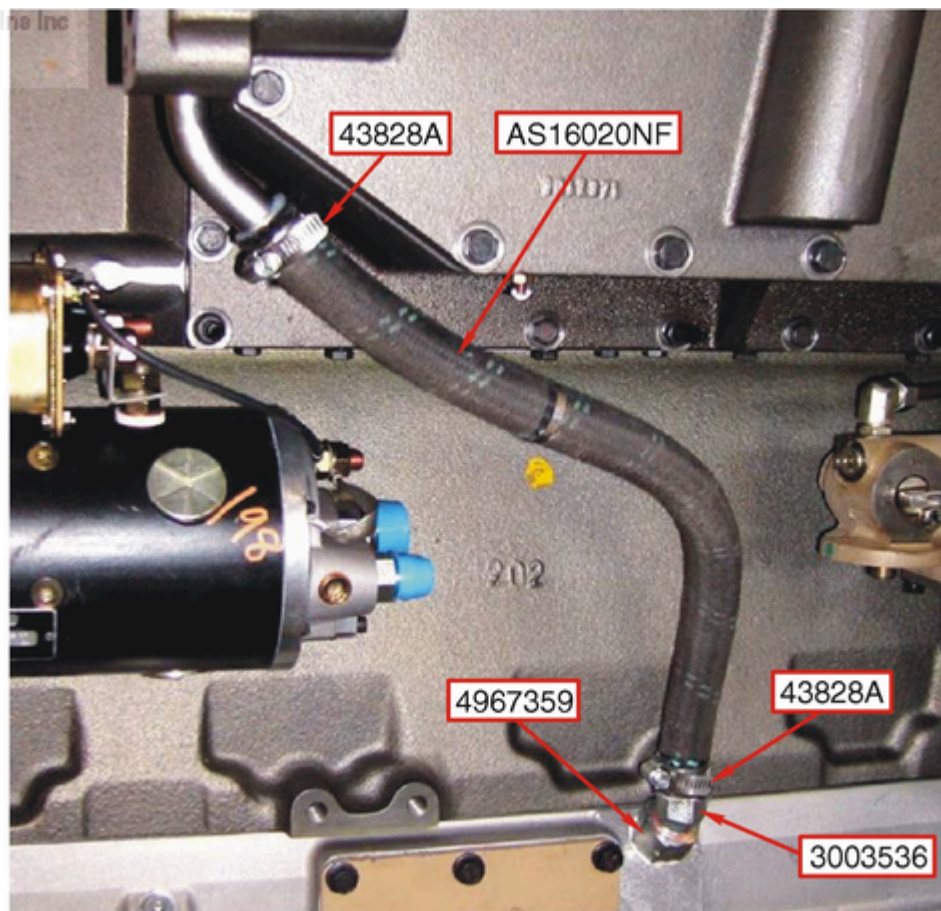

3. Apply Loctite™ 5699 RTV Silicone, Part Number 3164067, or equivalent, to the hose coupling on the elbow and on the oil drain tube. Slide a hose clamp over each end of the flexible hose. Push one end of the hose onto the elbow hose coupling and the other end onto the oil drain tube.

Torque Value: 5 N-m [44 in-lb]

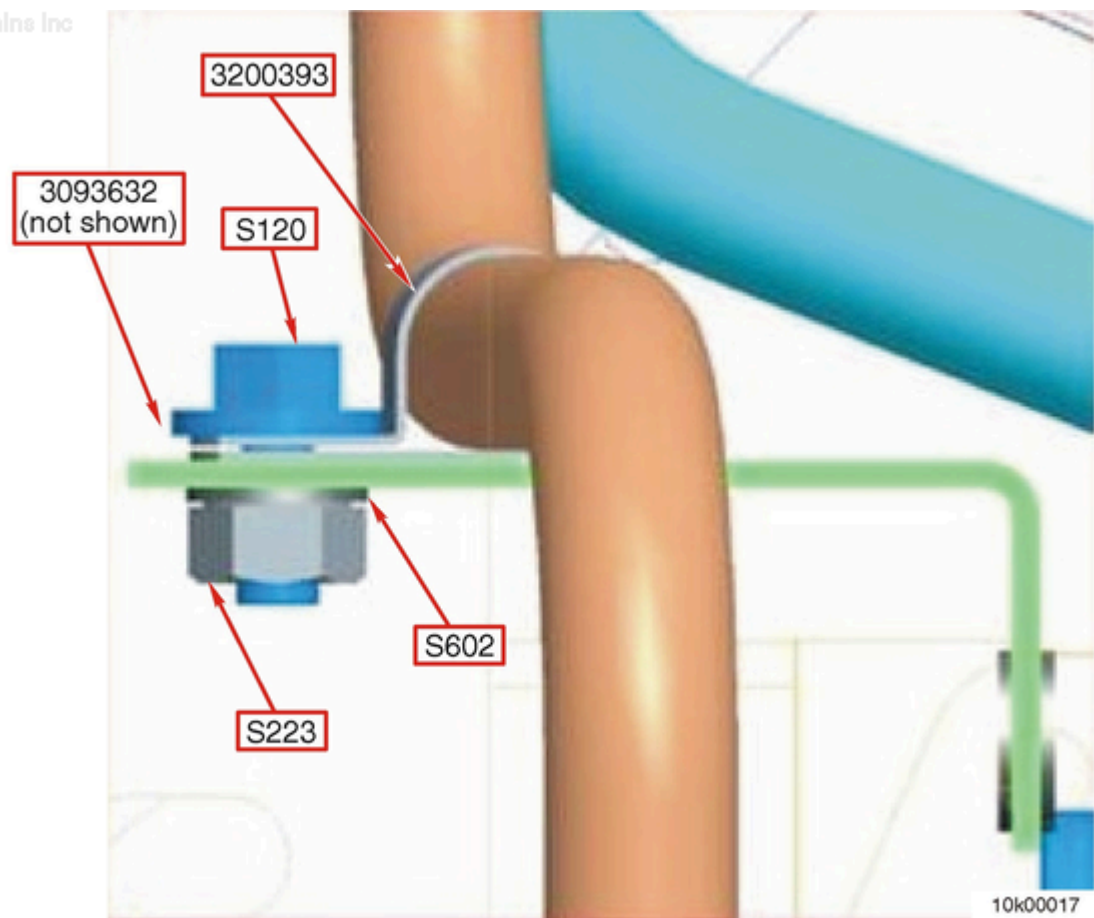

4. Place the P-clip on the turbocharger oil drain tube and attach it to the tube brace.



5. Remove the capscrew with washer from the lube cooler. Position the washer between the tube brace and the lube cooler. Put a second washer over the threads of the capscrew.



6. Install the captive washer cap screw with the washer through the tube brace and the second washer. Install into lube cooler.

Capscrew Torque Value: 45 N-m [33 ft-lb]

P-clip Torque Value: 45 N-m [33 ft-lb]

Document History

Date	Details
2012-7-8	Module Created
2012-10-18	Incorrect Part Number
2012-10-22	QSOL Quick Fix Reason: Incorrect Part Number Notes: none

Last Modified: 24-Oct-2012