



|                                                   |                            |
|---------------------------------------------------|----------------------------|
| Technical Service Bulletin: TSB101081             | Released Date: 18-Feb-2011 |
| New Twin-Cylinder Air Compressor Support Brackets |                            |

## New Twin-Cylinder Air Compressor Support Brackets

### Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

### Contents

This document introduces new air compressor support brackets for K19 and QSK19 engines that are equipped with the twin-cylinder air compressor, Part Number 3103409.

The new brackets, Part Numbers 2888623 and 2888626, obsolete and supersede the previous versions, Part Numbers 4081295 and 4081296. These brackets are being introduced as a product improvement. The new design is a two-piece, rigid-mounted bracket design. This design eliminates the wear that was seen on the previous brackets caused by movement between the two bracket pieces. The difference between the two bracket designs are shown in Figure 1, Old Design, and Figure 2, New Design.

The parts being removed from options CP4073 and CP4076 are listed in Table 1. Listed in Table 2 are the parts being added to options CP4073 and CP4076. These are also the parts required to upfit an engine from the previous brackets to the improved bracket design.

The new bracket design utilizes the same mounting holes as the fuel filter options that were mounted directly below the old air compressor support bracket. These options are listed in Table 3. In order to install the new air compressor support bracket design, these fuel filter options **must** be moved. The fuel filter option may be remote mounted or moved to the hand hole cover, as shown in Figure 3. It may be necessary to rotate the fuel filter housing 180 degrees to allow proper routing of the fuel pump inlet hose. Table 4 lists fuel line part numbers and lengths that can be ordered for the new fuel filter mounting locations.

This change took effect in production on October 21, 2010. Any engines built after this date will have been built with the new compressor support bracket design.

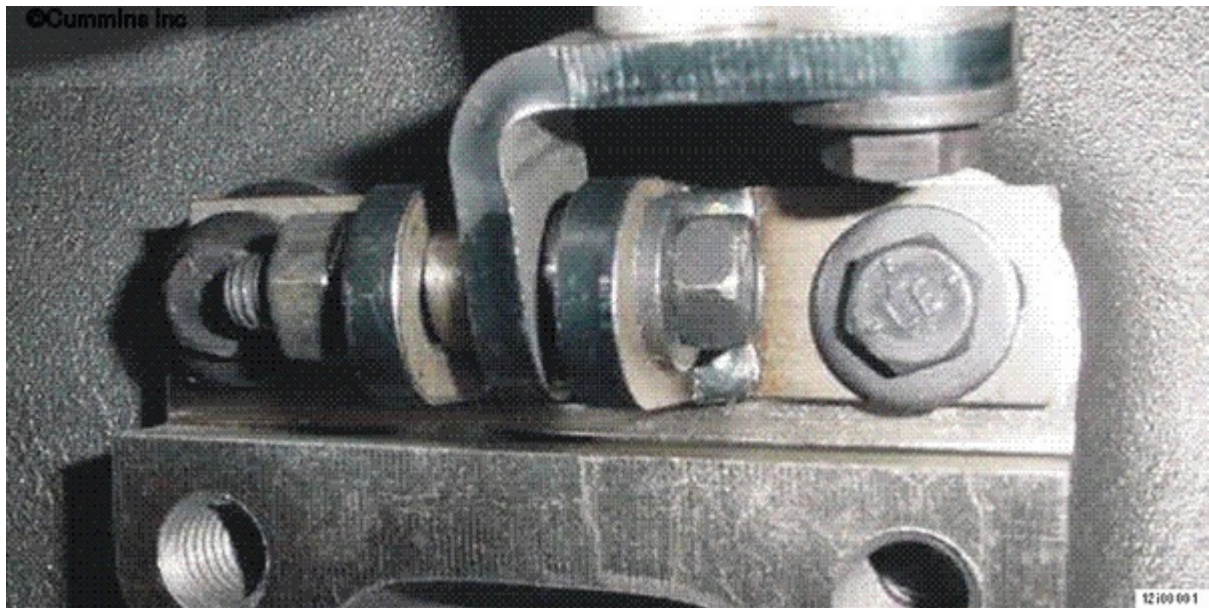


Figure 1, Old Design


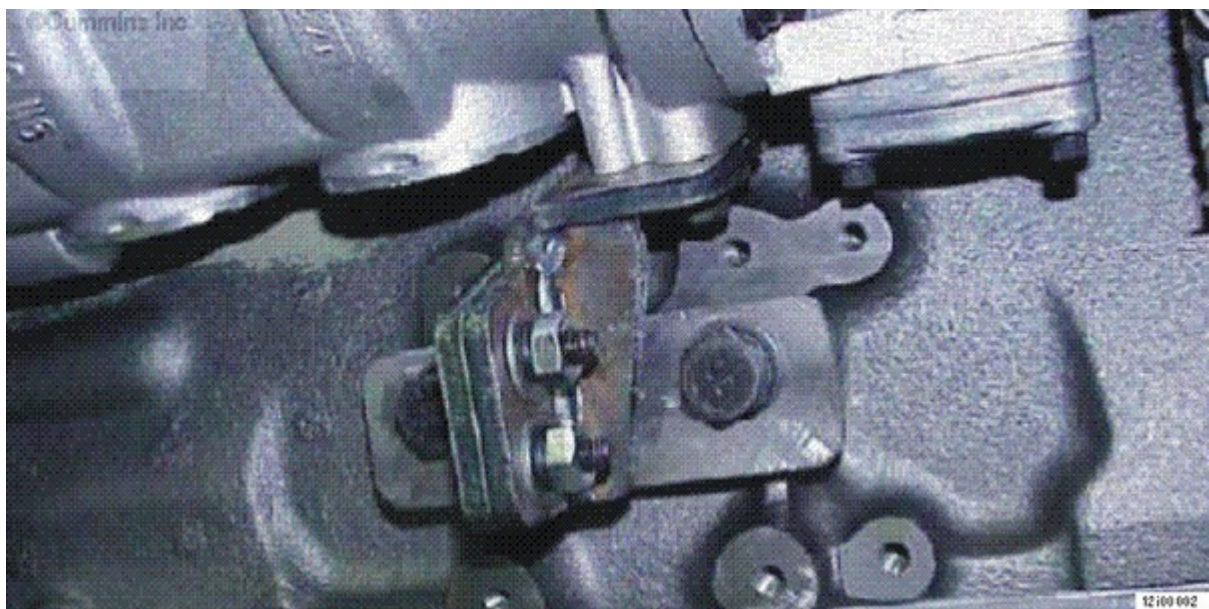


Figure 2, New Design

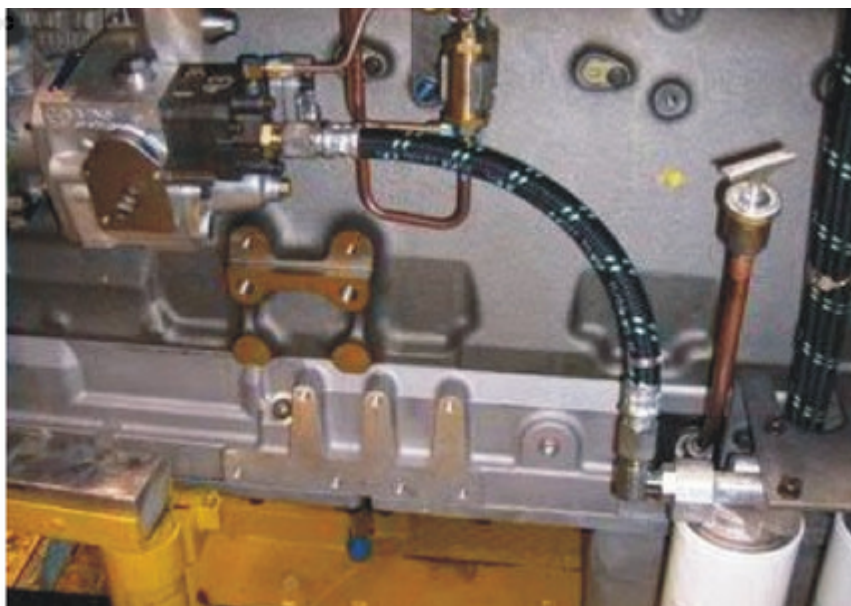

1200010

Figure 3, Alternate Fuel Filter Mounting Location

**Note :** The twin cylinder air compressor option is not shown in Figure 3.

**Table 1 - Parts Removed from Options CP4073 and CP4076**

| Part Number | Quantity | Description               |
|-------------|----------|---------------------------|
| 4081295     | 1        | Brace, Air Compressor     |
| 3006182     | 2        | Screw, Captive Washer Cap |
| 3014766     | 2        | Screw, Captive Washer Cap |
| 4081296     | 1        | Brace, Air Compressor     |
| S 223       | 1        | Nut, Heavy Hexagon        |
| S 602       | 1        | Washer, Plain             |
| S 604       | 1        | Washer, Lock              |
| 3006182     | 2        | Screw, Captive Washer Cap |
| 3014766     | 2        | Screw, Captive Washer Cap |
| 3040837     | 1        | Screw, Captive Washer Cap |
| 3410273     | 1        | Spacer, Mounting          |

**Table 2 - Parts Added to Options CP4073 and CP4076**

| Part Number | Quantity | Description               |
|-------------|----------|---------------------------|
| 2888623     | 1        | Brace, Air Compressor     |
| 3006182     | 2        | Screw, Captive Washer Cap |
| 2888626     | 1        | Brace, Air Compressor     |
| 3074629     | 2        | Screw, Twelve Point Cap   |
| S 603       | 2        | Washer, Lock              |
| 127316      | 2        | Washer, Plain             |

| Table 2 - Parts Added to Options CP4073 and CP4076 |          |                           |
|----------------------------------------------------|----------|---------------------------|
| Part Number                                        | Quantity | Description               |
| 3012472                                            | 2        | Screw, Captive Washer Cap |
| 108330                                             | 4        | Washer, Plain             |
| S 604                                              | 2        | Washer, Lock              |
| S 223                                              | 2        | Nut, Heavy Hexagon        |

| Table 3 - Incompatible Options List |              |
|-------------------------------------|--------------|
| QSK19                               |              |
| Air Compressor                      | Fuel fFilter |
| CP4076                              | FF4051       |
| CP4076                              | FF4087       |

| K19            |              |
|----------------|--------------|
| Air Compressor | Fuel fFilter |
| CP4073         | FF4002       |
| CP4073         | FF4020       |
| CP4073         | FF4034       |
| CP4073         | FF4037       |
| CP4073         | FF4044       |
| CP4073         | FF4070       |
| CP4073         | FF4072       |

| Table 4 - Alternate Parts List to Move Fuel Filter Option |                             |                 |
|-----------------------------------------------------------|-----------------------------|-----------------|
| QSK19                                                     |                             |                 |
| Part Number                                               | Description                 | Length          |
| 3201394                                                   | Bracket, hand hole mounting | --              |
| 3081983                                                   | Fuel line, flexible hose    | 63.5 cm [25 in] |
| 3090055                                                   | Fuel line, flexible hose    | 91.5 cm [36 in] |
| 3402243                                                   | Fuel line, flexible hose    | 140 cm [55 in]  |
| 3086194                                                   | Fuel line, flexible hose    | 183 cm [72 in]  |

| K19         |                             |                 |
|-------------|-----------------------------|-----------------|
| Part Number | Description                 | Length          |
| 3201394     | Bracket, hand hole mounting | - -             |
| 2870341     | Fuel line flexible hose     | 40.5 cm [16 in] |
| 2870342     | Fuel line, flexible hose    | 45.5 cm 18 in]  |
| 2870343     | Fuel line, flexible hose    | 51 cm [20 in]   |
| 4081101     | Fuel line, flexible hose    | 91.5 cm [36 in] |
| 2870345     | Fuel line, flexible hose    | 183 cm [72 in]  |

## Document History

| Date       | Details                                                            |
|------------|--------------------------------------------------------------------|
| 2010-10-25 | Module Created                                                     |
| 2011-2-7   | Compatibility issues were found with specific fuel filter options. |

---

Last Modified: 18-Feb-2011

---